

D

Е

F

Н

J

Κ

L

M

ΑV

Р

CONTENTS

BASE AUDIO	Reference Value	21
BASIC INSPECTION8	WIRING DIAGRAM	23
DIAGNOSIS AND REPAIR WORKFLOW8 Work Flow8	BASE AUDIO Wiring Diagram	
SYSTEM DESCRIPTION10	SYMPTOM DIAGNOSIS	24
AUDIO SYSTEM	AUDIO SYSTEM SYMPTOMSSymptom Table	
System Description	NORMAL OPERATING CONDITION Description	
DIAGNOSIS SYSTEM (AUDIO UNIT)13	PRECAUTION	27
Diagnosis Description13	PRECAUTIONS	27
DTC/CIRCUIT DIAGNOSIS14	EXCEPT FOR MEXICO	27
POWER SUPPLY AND GROUND CIRCUIT14	EXCEPT FOR MEXICO: Precaution for Supplemental Restraint System (SRS) "AIR BAG" and	
AUDIO UNIT14 AUDIO UNIT : Diagnosis Procedure14	"SEAT BELT PRE-TENSIONER" EXCEPT FOR MEXICO : Precaution for Battery	
STEERING SWITCH SIGNAL A CIRCUIT15	Service	
Description	FOR MEXICO)- T
STEERING SWITCH SIGNAL B CIRCUIT17	PRE-TENSIONER"FOR MEXICO : Precaution for Battery Service	
Description17 Diagnosis Procedure17	PREPARATION	
Component Inspection18	PREPARATION	_
STEERING SWITCH SIGNAL GND CIRCUIT19 Description	Commercial Service Tools	
Diagnosis Procedure	REMOVAL AND INSTALLATION	30
Component Inspection20	AUDIO UNIT	30
ECU DIAGNOSIS INFORMATION21	Exploded ViewRemoval and Installation	
AUDIO UNIT21	FRONT DOOR SPEAKER	

Exploded View	31	SATELLITE RADIO TUNER	55
Removal and Installation	31	SATELLITE RADIO TUNER: Diagnosis Proce-	
TWEETER	32	dure	55
Exploded View		TEL ADAPTER UNIT	55
Removal and Installation		TEL ADAPTER UNIT : Diagnosis Procedure	
		·	
STEERING SWITCH		STEERING SWITCH SIGNAL A CIRCUIT	
Exploded View		(STEERING SWITCH TO TEL ADAPTER	
Removal and Installation	33	UNIT)	
ANTENNA AMP	34	Description	
Exploded View		Diagnosis Procedure	
Removal and Installation		Component Inspection	58
		STEERING SWITCH SIGNAL B CIRCUIT	
ANTENNA BASE		(STEERING SWITCH TO TEL ADAPTER	
Exploded View		ÙNIT)	59
Removal and Installation	35	Description	
ANTENNA FEEDER	36	Diagnosis Procedure	
		Component Inspection	60
COUPE		OTTEDING OWITOU CLONAL OND OLD OUT	
COUPE : Feeder Layout	36	STEERING SWITCH SIGNAL GND CIRCUIT	
ROADSTER	26	(STEERING SWITCH TO TEL ADAPTER	
ROADSTER : Feeder Layout		UNIT)	
BOSE AUDIO WITHOUT NAVIGATIO		Description	
BOOL AODIO WITHOUT NAVIOATIO	11	Diagnosis Procedure	
BASIC INSPECTION	38	Component Inspection	62
		STEERING SWITCH SIGNAL A CIRCUIT	
DIAGNOSIS AND REPAIR WORKFLOW		(TEL ADAPTER UNIT TO AUDIO UNIT)	63
Work Flow	38	Description	
SYSTEM DESCRIPTION	40	Diagnosis Procedure	63
01012m		Component Inspection	64
AUDIO SYSTEM	40	STEERING SWITCH SIGNAL B CIRCUIT	
System Diagram	40		٥.5
System Description		(TEL ADAPTER UNIT TO AUDIO UNIT)	
Component Parts Location		Description Diagnosis Procedure	
Component Description	43	Component Inspection	
HANDS-FREE PHONE SYSTEM	45	Component inspection	00
System Diagram		STEERING SWITCH SIGNAL GND CIRCUIT	
System Description		(TEL ADAPTER UNIT TO AUDIO UNIT)	67
Component Parts Location		Description	
Component Description		Diagnosis Procedure	
·		Component Inspection	67
DIAGNOSIS SYSTEM (AUDIO UNIT)		COMMUNICATION SIGNAL CIRCUIT	60
Diagnosis Description	50	Description	
DIAGNOSIS SYSTEM (TEL ADAPTER UNIT) 52	Diagnosis Procedure	
Diagnosis Description		Diagnosis i roccadio	00
		REQUEST SIGNAL CIRCUIT (SAT TO AU-	
DTC/CIRCUIT DIAGNOSIS	54	DIO)	
DOWED OUDDLY AND ODOUND OUDDUIT		Description	71
POWER SUPPLY AND GROUND CIRCUIT	54	Diagnosis Procedure	
AUDIO UNIT	54	BOSE AMP. ON SIGNAL CIRCUIT	 -
AUDIO UNIT : Diagnosis Procedure			
•		Description Diagnosis Procedure	
BOSE AMP		Diagnosis Frocedure	/ 3
BOSE AMP. : Diagnosis Procedure	54	MICROPHONE SIGNAL CIRCUIT	74
		Description	

Diagnosis Procedure74	FOR MEXICO: Precaution for Harness Repair.	104
TELEPHONE ON SIGNAL CIRCUIT76	PREPARATION	. 105
Description76	PREPARATION	10E
Diagnosis Procedure76	Commercial Service Tools	
ECU DIAGNOSIS INFORMATION77	REMOVAL AND INSTALLATION	
AUDIO UNIT77		
Reference Value77	AUDIO UNIT	
BOSE AMP81	Exploded ViewRemoval and Installation	
COUPE81	FRONT DOOR SPEAKER	. 107
COUPE : Reference Value81	Exploded View	
ROADSTER83	Removal and Installation	107
ROADSTER :: Reference Value83	TWEETER	100
	Exploded View	
SATELLITE RADIO TUNER86	Removal and Installation	
Reference Value86		
TEL ADAPTER UNIT88	REAR SPEAKER	
Reference Value88	Exploded View	
	Removal and Installation	109
WIRING DIAGRAM91	WOOFER	. 110
BOSE AUDIO WITHOUT NAVIGATION91	Exploded View	_
Wiring Diagram - BOSE AUDIO WITHOUT NAVI-	Removal and Installation	
GATION SYSTEM91	REAR WOOFER	. 111
SYMPTOM DIAGNOSIS95	Removal and Installation	111
	BOSE AMP	112
AUDIO SYSTEM SYMPTOMS95	DOOL ANII	. 112
Symptom Table95	COUPE	
HANDS-FREE PHONE SYMPTOMS98	COUPE : Exploded View	
Symptom Table98	COUPE : Removal and Installation	112
	ROADSTER	112
NORMAL OPERATING CONDITION100 Description100	ROADSTER: Removal and Installation	
•	ANTENNA AMP	113
PRECAUTION102	Exploded View	
PRECAUTIONS102	Removal and Installation	
PRECAUTIONS102		
EXCEPT FOR MEXICO102	ANTENNA BASE	
EXCEPT FOR MEXICO : Precaution for Supple-	Exploded View	114
	Danas and Installation	444
mental Restraint System (SRS) "AIR BAG" and	Removal and Installation	114
"SEAT BELT PRE-TENSIONER"102	Removal and Installation	
"SEAT BELT PRE-TENSIONER"102 EXCEPT FOR MEXICO : Precaution for Battery	Removal and Installation	. 115 115
"SEAT BELT PRE-TENSIONER"	Removal and Installation SATELLITE RADIO TUNER	. 115 115
"SEAT BELT PRE-TENSIONER"	Removal and Installation SATELLITE RADIO TUNER Exploded View Removal and Installation	. 115 115 115
"SEAT BELT PRE-TENSIONER"	Removal and Installation SATELLITE RADIO TUNER Exploded View Removal and Installation SATELLITE RADIO ANTENNA	.115 115 115
"SEAT BELT PRE-TENSIONER"	Removal and Installation SATELLITE RADIO TUNER Exploded View Removal and Installation	.115 115 115 116
"SEAT BELT PRE-TENSIONER"	Removal and Installation SATELLITE RADIO TUNER Exploded View Removal and Installation SATELLITE RADIO ANTENNA Exploded View Removal and Installation	. 115 115 115 . 116 116
"SEAT BELT PRE-TENSIONER"	Removal and Installation SATELLITE RADIO TUNER Exploded View Removal and Installation SATELLITE RADIO ANTENNA Exploded View Removal and Installation STEERING SWITCH	. 115 115 115 . 116 116 116
"SEAT BELT PRE-TENSIONER"	Removal and Installation SATELLITE RADIO TUNER Exploded View Removal and Installation SATELLITE RADIO ANTENNA Exploded View Removal and Installation STEERING SWITCH Exploded View	.115 115 115 116 116 116
"SEAT BELT PRE-TENSIONER"	Removal and Installation SATELLITE RADIO TUNER Exploded View Removal and Installation SATELLITE RADIO ANTENNA Exploded View Removal and Installation STEERING SWITCH	.115 115 115 116 116 116
"SEAT BELT PRE-TENSIONER"	Removal and Installation SATELLITE RADIO TUNER Exploded View Removal and Installation SATELLITE RADIO ANTENNA Exploded View Removal and Installation STEERING SWITCH Exploded View	.115 115 115 116 116 116 117 117

Α

В

С

D

Е

F

G

Н

J

Κ

L

M

0

Removal and Installation118	DIAGNOSIS SYSTEM (AV CONTROL UNIT).	.138
MICROPHONE 119	Description	
Exploded View119	On Board Diagnosis Function	
Removal and Installation119	CONSULT Function (MULTI AV)	. 149
ANTENNA FEEDER 120	ECU DIAGNOSIS INFORMATION	.153
	AV CONTROL UNIT	153
COUPE120	Reference Value	
COUPE : Feeder Layout120	Fail-Safe	
ROADSTER120	DTC Index	. 159
ROADSTER : Feeder Layout121	EDON'T DIODI AVVIINIT	
BOSE AUDIO WITH NAVIGATION	FRONT DISPLAY UNIT	
	Reference Value	. 160
PRECAUTION122	BOSE AMP	.162
PRECAUTIONS 122	COUPE	
EXCEPT FOR MEXICO122	COUPE : Reference Value	. 162
EXCEPT FOR MEXICO : Precaution for Supple-	ROADSTER	161
mental Restraint System (SRS) "AIR BAG" and	ROADSTER :: Reference Value	
"SEAT BELT PRE-TENSIONER"122	NOADSTEIN : Neierence value	. 104
EXCEPT FOR MEXICO : Cautions in Removing	WIRING DIAGRAM	.167
Battery Terminal and AV Control Unit (Models with	BOSE AUDIO WITH NAVIGATION SYSTEM.	167
AV Control Unit)122 EXCEPT FOR MEXICO : Precaution for Battery	Wiring Diagram	_
Service122		
EXCEPT FOR MEXICO : Precaution for Trouble	BASIC INSPECTION	. 173
Diagnosis122	DIAGNOSIS AND REPAIR WORK FLOW	172
EXCEPT FOR MEXICO : Precaution for Harness	Work Flow	
Repair123	ADDITIONAL SERVICE WHEN REPLACING	
FOR MEXICO123	CONTROL UNIT	
FOR MEXICO: Precaution for Supplemental Re-	Description	
straint System (SRS) "AIR BAG" and "SEAT BELT	Work Procedure	
PRE-TENSIONER"123	Work i rocedure	. 175
FOR MEXICO : Cautions in Removing Battery	CONFIGURATION (AV CONTROL UNIT)	176
Terminal and AV Control Unit (Models with AV	Description	
Control Unit)	Work Procedure	
FOR MEXICO: Precaution for Battery Service124 FOR MEXICO: Precaution for Trouble Diagnosis.124	Configuration List	. 176
FOR MEXICO: Precaution for Harness Repair124	DTC/CIRCUIT DIAGNOSIS	170
·	DIGICINGOTI DIAGNOSIS	. 170
PREPARATION125	U1000 CAN COMM CIRCUIT	178
PREPARATION125	Description	
Commercial Service Tools	DTC Logic	
	Diagnosis Procedure	. 178
SYSTEM DESCRIPTION126	U1010 CONTROL UNIT (CAN)	
COMPONENT PARTS 126	DTC Logic	. 179
Component Parts Location126	U1200 AV CONTROL UNIT	180
Component Description128	DTC Logic	
SYSTEM 130	· ·	
3131EWI 130	U1201 AV CONTROL UNIT	
MULTI AV SYSTEM130	DTC Logic	. 181
MULTI AV SYSTEM : System Diagram130	U1202 AV CONTROL UNIT	182
MULTI AV SYSTEM : System Description131	DTC Logic	
MULTI AV SYSTEM : Fail-Safe137		
	U1204 AV CONTROL UNIT	183

DTC Logic183	DTC Logic200
Diagnosis Procedure183	Diagnosis Procedure200
U1205 AV CONTROL UNIT184	U122E AV CONTROL UNIT201
DTC Logic	DTC Logic201
Diagnosis Procedure184	U1232 STEERING ANGLE SENSOR202
U1206 AV CONTROL UNIT185	DTC Logic202
DTC Logic185	Diagnosis Procedure202
Diagnosis Procedure185	U1243 DISPLAY UNIT203
U1207 AV CONTROL UNIT186	DTC Logic
DTC Logic186	Diagnosis Procedure203
Diagnosis Procedure186	U1244 GPS ANTENNA205
U1216 AV CONTROL UNIT187	DTC Logic
DTC Logic187	Diagnosis Procedure205
U1217 AV CONTROL UNIT188	U1258 SATELLITE RADIO ANTENNA 206
DTC Logic	DTC Logic
· ·	Diagnosis Procedure206
U1218 AV CONTROL UNIT189	U1263 USB207
DTC Logic189 Diagnosis Procedure189	DTC Logic
•	Diagnosis Procedure207
U1219 AV CONTROL UNIT190	-
DTC Logic	U1264 ANTENNA AMP
Diagnosis Procedure190	DTC Logic
U121A AV CONTROL UNIT191	COUPE208
DTC Logic191	COUPE : Diagnosis Procedure208
Diagnosis Procedure191	ROADSTER208
U121B AV CONTROL UNIT192	ROADSTER : Diagnosis Procedure208
DTC Logic192	U1265 BOSE AMP210
Diagnosis Procedure192	DTC Logic210
U121C AV CONTROL UNIT193	Diagnosis Procedure210
DTC Logic193	U1300 AV COMM CIRCUIT211
Diagnosis Procedure193	Description211
U121D AV CONTROL UNIT194	·
DTC Logic194	U1310 AV CONTROL UNIT212 DTC Logic212
Diagnosis Procedure194	
U121E AV CONTROL UNIT195	POWER SUPPLY AND GROUND CIRCUIT 213
DTC Logic195	AV CONTROL UNIT213
Diagnosis Procedure195	AV CONTROL UNIT : Diagnosis Procedure213
U1225 AV CONTROL UNIT196	FRONT DISPLAY UNIT213
DTC Logic196	FRONT DISPLAY UNIT : Diagnosis Procedure213
U1227 AV CONTROL UNIT197	POSE AMB 214
DTC Logic	BOSE AMP. : Diagnosis Procedure214
Diagnosis Procedure197	-
U1228 AV CONTROL UNIT198	RGB DIGITAL IMAGE SIGNAL CIRCUIT 215
DTC Logic	Description215 Diagnosis Procedure215
· ·	
U1229 AV CONTROL UNIT199	COMPOSITE IMAGE SIGNAL CIRCUIT 216
DTC Logic199	Description
11122A AV CONTROL LINIT 200	Diagnosis Procedure216

A

В

С

D

Е

F

G

Н

J

Κ

L

M

0

AUX IMAGE SIGNAL CIRCUIT	217 Exploded View	249
Description		249
Diagnosis Procedure	217	050
DICK E IECT CIONAL CIDCUIT	REAR WOOFER	
DISK EJECT SIGNAL CIRCUIT		250
Description Diagnosis Procedure		251
	COLIDE	254
MICROPHONE SIGNAL CIRCUIT	COLIDE : Exploded View	
Description	.219 COUDE: Demoval and Installation	
Diagnosis Procedure	.219	
CAMERA IMAGE SIGNAL CIRCUIT	ROADSTER	
Description	ROADSTER : Removal and Installation	251
Diagnosis Procedure		253
	Expladed View	
STEERING SWITCH SIGNAL A CIRCUIT	Removal and Installation	
Description	.223	
Diagnosis Procedure		
Component Inspection	Expressed view	
STEERING SWITCH SIGNAL B CIRCUIT	Removal and Installation	254
Description	.225 MULTIFUNCTION SWITCH	255
Diagnosis Procedure		
Component Inspection	.225 Removal and Installation	
STEERING SWITCH GROUND CIRCUIT		
Description		
Diagnosis Procedure	Exploded view	
Component Inspection		256
	STEERING SWITCH	257
SYMPTOM DIAGNOSIS	229 Exploded View	
MULTIAN OVOTEM OVMOTOMO	Pemoval and Installation	
MULTI AV SYSTEM SYMPTOMS		
Symptom Table		
NORMAL OPERATING CONDITION	Removal and Installation	258
Description	.236 AUXILIARY INPUT JACKS	259
	Evaloded View	
REMOVAL AND INSTALLATION	Removal and Installation	
AV CONTROL UNIT	243	
Exploded View	MICKOI HOIL	
Removal and Installation	Exploded view	
	Removal and installation	260
FRONT DISPLAY UNIT		261
Exploded View		261
Removal and Installation	Removal and Installation	
FRONT DOOR SPEAKER	246 CATELLITE DADIO ANTENNA	
Exploded View	SATELLITE RADIO ANTENNA	
Removal and Installation	Exploded view	
	Removal and installation	∠04
TWEETER	REAR VIEW CAMERA	265
Exploded View		265
Removal and Installation	.247 Adjustment	265
REAR SPEAKER	248 STEEDING ANGLE SENSOR	200
Exploded View	STEENING ANGLE SENSON	
Removal and Installation		200
	ANTENNA FEEDER	267
WOOFER	249	

COUPE267 ROADSTER267 COUPE: Feeder Layout267 ROADSTER: Feeder Layout268 Α В С D Е F G Н Κ L M

Δ١٨

0


Ρ

BASIC INSPECTION

DIAGNOSIS AND REPAIR WORKFLOW

Work Flow

OVERALL SEQUENCE

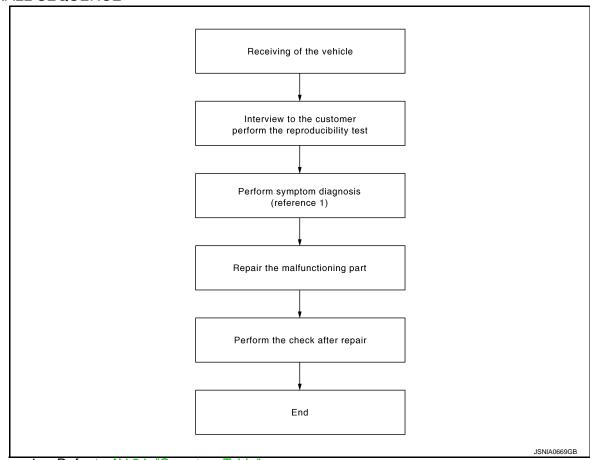

Reference 1 ··· Refer to AV-24, "Symptom Table".

DETAILED FLOW

1. CHECK SYMPTOM

Check the malfunction symptoms by performing the following items.

- Interview the customer to obtain the malfunction information (conditions and environment when the malfunction occurred).
- Check the symptom.

>> GO TO 2.

2. PERFORM DIAGNOSIS BY SYMPTOM

Perform the relevant diagnosis referring to the diagnosis chart by symptom. Refer to <u>AV-24, "Symptom Table"</u>.

>> GO TO 3.

3.REPAIR OR REPLACE MALFUNCTIONING PARTS

Repair or replace the malfunctioning parts.

>> GO TO 4.

DIAGNOSIS AND REPAIR WORKFLOW

< BASIC INSPECTION > [BASE AUDIO]

4.FINAL CHECK

Perform the operation to check that the malfunction symptom is solved or any other symptoms are present. <u>Is there any symptom?</u>

YES >> GO TO 2.

NO >> INSPECTION END

В

Α

С

D

Е

F

G

Н

1

J

Κ

L

M

ΑV


0

SYSTEM DESCRIPTION


AUDIO SYSTEM

System Diagram

COUPE MODELS

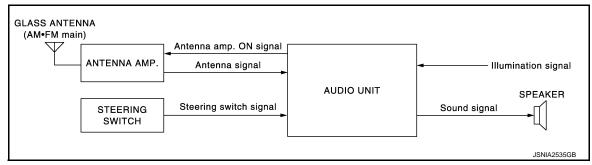

ROADSTER MODELS

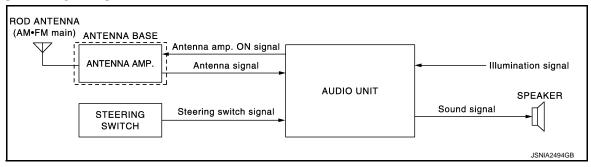

System Description

INFOID:0000000008195181

AUDIO SYSTEM

Audio functions

AM/FM radio
CD

- Radio signal are received by glass antenna, next it is amplified by antenna amp., and finally it is input to audio unit. (coupe models)
- Radio signal are received by rod antenna, next it is amplified by antenna amp., and finally it is input to audio unit. (roadster models)
- Audio unit outputs the audio signal to each speaker.

[BASE AUDIO]

Component Parts Location

INFOID:0000000008195182

Α

В


D

Е

F


Н

COUPE MODELS

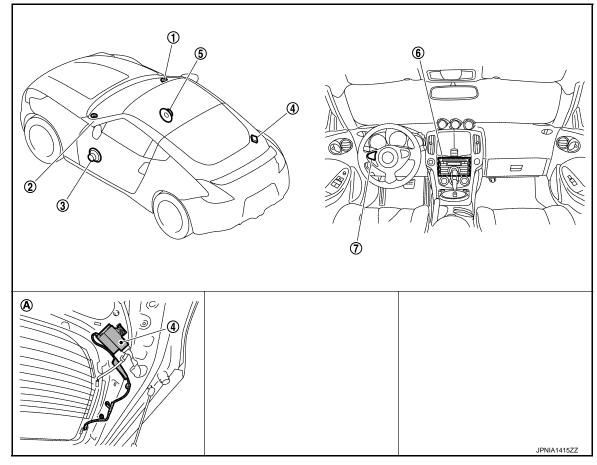

- 1. Tweeter RH
- 4. Antenna amp.
- 7. Steering switch
- A. Back door side RH
- 2. Tweeter LH
- 5. Front door speaker RH
- 3. Front door speaker LH
- 6. Audio unit

ROADSTER MODELS

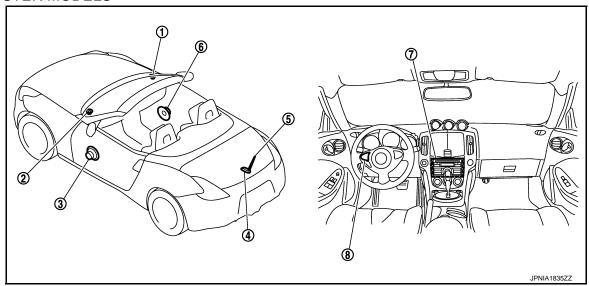

1. Tweeter RH

2. Tweeter LH

3. Front door speaker LH

Revision: 2012 August AV-11 2013 370Z

M

L

K

AV

0

AUDIO SYSTEM

< SYSTEM DESCRIPTION >

[BASE AUDIO]

4. Antenna base

5. Rod antenna

6. Front door speaker RH

7. Audio unit

8. Steering switch

Component Description

INFOID:0000000008195183

Part name	Description
Audio unit	Controls audio system functions.
Front door speaker	Outputs sound signal from audio unit.Outputs high, mid and low range sounds.
Tweeter	Outputs sound signal from audio unit.Outputs high range sounds.
Antenna amp. (coupe models)	 Radio signal received by glass antenna is amplified and transmitted to audio unit. Power (antenna amp. ON signal) is supplied from audio unit.
Antenna base (roadster models)	 An antenna base integrated with radio antenna amp. is adopted. Radio signal received by rod antenna is amplified and transmitted to audio unit. Power (antenna amp. ON signal) is supplied from audio unit.
Steering switch	Each audio operation can be operated.Steering switch signal (operation signal) is output to audio unit.

DIAGNOSIS SYSTEM (AUDIO UNIT)

< SYSTEM DESCRIPTION >

[BASE AUDIO]

INFOID:0000000008195184

Α

В

C

D

Е

F

Н

DIAGNOSIS SYSTEM (AUDIO UNIT)


Diagnosis Description

Self-diagnosis mode can check the following items.

Audio unit software versions


OPERATION PROCEDURE

- 1. Turn ignition switch to the ON position.
- 2. Turn the audio unit off.
- 3. While pressing the "MENU", "1", "5", "PWR" button, the self-diagnosis mode is started. When the self-diagnosis mode is started, a short beep will be head.

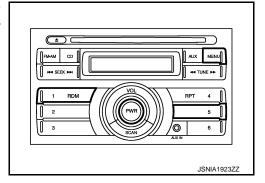

Software Version Check

- 1. Press the "PWR" switch to enter version diagnostics. "Audio software version is displayed.
- 2. Press the "PWR" switch again to display the CD changer version is displayed. When not connect it, "FF"

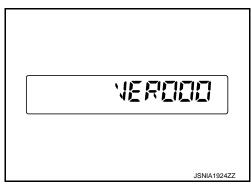

ΑV

M

0

POWER SUPPLY AND GROUND CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BASE AUDIO]

DTC/CIRCUIT DIAGNOSIS

POWER SUPPLY AND GROUND CIRCUIT

AUDIO UNIT

AUDIO UNIT: Diagnosis Procedure

INFOID:0000000008195185

1.CHECK FUSE

Check that the following fuses of the audio unit are not blown.

Power source	Fuse No.
Battery	34
Ignition switch ACC or ON	19

Is inspection result OK?

YES >> GO TO 2.

NO >> If fuse is blown, be sure to eliminate cause of malfunction before installing new fuse.

2.CHECK AUDIO UNIT POWER SUPPLY CIRCUIT

Check voltage between the audio unit and ground.

Signal name	Connector No.	Terminal No.	Ignition switch position	Voltage
Battery power supply	M80	19	OFF	Battery voltage
ACC power supply	IVIOU	7	ACC	battery voltage

Is inspection result OK?

YES >> INSPECTION END

NO >> Check harness between audio unit and fuse.

STEERING SWITCH SIGNAL A CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BASE AUDIO]

STEERING SWITCH SIGNAL A CIRCUIT

Description INFOID:000000008195186

Transmits the steering switch signal to audio unit.

Diagnosis Procedure

INFOID:0000000008195187

Α

В

D

Е

F

1. CHECK STEERING SWITCH SIGNAL A CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect audio unit connector and spiral cable connector.
- 3. Check continuity between audio unit harness connector and spiral cable harness connector.

Audio unit		Spiral cable		Continuity
Connector	Terminal	Connector Terminal		Continuity
M80	6	M36	24	Existed

4. Check continuity between audio unit harness connector and ground.

Audio unit			Continuity
Connector	Terminal	Ground	Continuity
M80	6		Not existed

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK SPIRAL CABLE

Check spiral cable.

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace spiral cable. Refer to SR-17, "Removal and Installation".

3.CHECK AUDIO UNIT VOLTAGE

- 1. Connect audio unit connector and spiral cable connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between audio unit harness connector.

(+)	(-	-)	
Audi	o unit	Audio unit		Voltage (Approx.)
Connector	Terminal	Connector Terminal		(11 -)
M80	6	M80	15	5.0 V

Is the inspection result normal?

YES >> GO TO 4.

NO >> Replace audio unit. Refer to AV-30, "Removal and Installation".

4. CHECK STEERING SWITCH

- 1. Turn ignition switch OFF.
- Check steering switch. Refer to <u>AV-16</u>. "Component Inspection".

Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace steering switch. Refer to AV-33, "Removal and Installation".

ΑV

L

M

2013 370Z

STEERING SWITCH SIGNAL A CIRCUIT


< DTC/CIRCUIT DIAGNOSIS >

[BASE AUDIO]

INFOID:0000000008195188

Component Inspection

Measure the resistance between the steering switch connector.

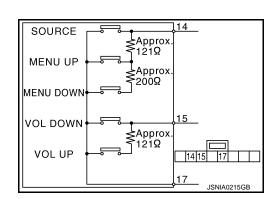

Standard

Steering switch		Condition	Resistance
Terminal	Terminal	Condition	Ω
		MENU DOWN switch ON	
14	15	MENU UP switch ON	119 – 123
		SOURCE switch ON	0
15		VOL UP switch ON	119 – 123
15		VOL DOWN switch ON	0

STEERING SWITCH SIGNAL B CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BASE AUDIO]

STEERING SWITCH SIGNAL B CIRCUIT

Description INFOID:0000000008195189

Transmits the steering switch signal to audio unit.

Diagnosis Procedure

INFOID:0000000008195190

Α

В

D

Е

F

1. CHECK STEERING SWITCH SIGNAL B CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect audio unit connector and spiral cable connector.
- 3. Check continuity between audio unit harness connector and spiral cable harness connector.

Audi	Audio unit Spiral cable		Continuity	
Connector	Terminal	Connector	Terminal	Continuity
M80	16	M36	31	Existed

4. Check continuity between audio unit harness connector and ground.

Audio unit			Continuity
Connector	Terminal	Ground	Continuity
M80	16		Not existed

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK SPIRAL CABLE

Check spiral cable.

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace spiral cable. Refer to <u>SR-17</u>, "Removal and Installation".

3.CHECK AUDIO UNIT VOLTAGE

- 1. Connect audio unit connector and spiral cable connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between audio unit harness connector.

(+)	(-	-)	
Audi	o unit	Audio unit		Voltage (Approx.)
Connector	Terminal	Connector Terminal		(11 -)
M80	16	M80	15	5.0 V

Is the inspection result normal?

YES >> GO TO 4.

Revision: 2012 August

NO >> Replace audio unit. Refer to AV-30, "Removal and Installation".

4. CHECK STEERING SWITCH

- 1. Turn ignition switch OFF.
- Check steering switch. Refer to <u>AV-18</u>. "Component Inspection".

Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace steering switch.Refer to AV-33, "Removal and Installation".

AV-17

ΑV

M

2013 370Z

STEERING SWITCH SIGNAL B CIRCUIT


< DTC/CIRCUIT DIAGNOSIS >

[BASE AUDIO]

INFOID:0000000008195191

Component Inspection

Measure the resistance between the steering switch connector.

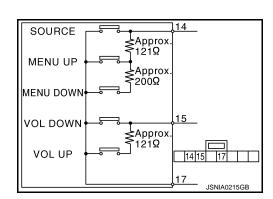

Standard

Steering switch		Condition	Resistance	
Terminal	Terminal	Condition	Ω	
		MENU DOWN switch ON	315 – 327	
14	17	MENU UP switch ON	119 – 123	
		SOURCE switch ON	0	
15		VOL UP switch ON	119 – 123	
15		VOL DOWN switch ON	0	

STEERING SWITCH SIGNAL GND CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BASE AUDIO]

STEERING SWITCH SIGNAL GND CIRCUIT

Description INFOID:000000008195192

Transmits the steering switch signal to audio unit.

Diagnosis Procedure

INFOID:0000000008195193

Α

В

D

Е

F

Н

1. CHECK STEERING SWITCH SIGNAL A CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect audio unit connector and spiral cable connector.
- 3. Check continuity between audio unit harness connector and spiral cable harness connector.

Audi	o unit	Spira	l cable	Continuity	
Connector	Terminal	Connector Termina		Continuity	
M80	15	M36	33	Existed	

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2. CHECK SPIRAL CABLE

Check spiral cable.

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace spiral cable. Refer to <u>SR-17</u>, "Removal and Installation".

3.CHECK GROUND CIRCUIT

- 1. Connect audio unit connector and spiral cable connector.
- 2. Turn ignition switch ON.
- 3. Check continuity between audio unit harness connector.

Audio unit			Continuity
Connector	Terminal	Ground	Continuity
M80	15		Existed

Is the inspection result normal?

YES >> GO TO 4.

NO >> Replace audio unit. Refer to AV-30, "Removal and Installation".

4. CHECK STEERING SWITCH

M

Check steering switch. Refer to AV-20, "Component Inspection".

Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace steering switch. Refer to <u>AV-33, "Removal and Installation"</u>.

Р

Revision: 2012 August **AV-19** 2013 370Z

ΑV

STEERING SWITCH SIGNAL GND CIRCUIT


< DTC/CIRCUIT DIAGNOSIS >

[BASE AUDIO]

INFOID:0000000008195194

Component Inspection

Measure the resistance between the steering switch connector.

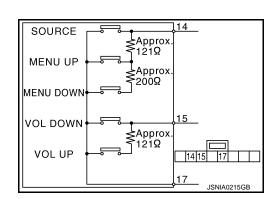

Standard

Steering switch		Condition	Resistance
Terminal	Terminal	Containon	Ω
		MENU DOWN switch ON	315 – 327
14	15	MENU UP switch ON	119 – 123
		SOURCE switch ON	0
15		VOL UP switch ON	119 – 123
15		VOL DOWN switch ON	0

[BASE AUDIO]

Α

C

D

Е

F

G

Н

J

K

L

M

ΑV

0

Р


SKIB3609E

ECU DIAGNOSIS INFORMATION

AUDIO UNIT

Reference Value

TERMINAL LAYOUT

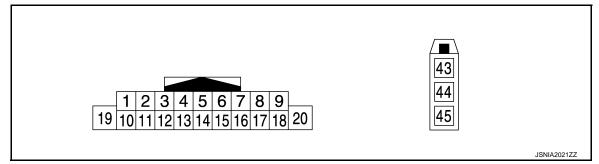

PHYSICAL VALUES

	minal e color)	Description	Description		Condition	Reference value	
+	_	Signal name	Input/ Output		Condition	(Approx.)	
2 (L)	3 (V)	Sound signal front speaker LH	Output	Ignition switch ON	Audio signal output	(V) 1 0 -1 *** 2ms SKIB3609E	
					Keep pressing SOURCE switch	0 V	
6 (B)	6 15 (B)	Steering switch signal A	Input	Ignition switch ON	Keep pressing MENU UP switch	1.0 V	
(P)					Keep pressing MENU DOWN switch	2.0 V	
					Except for above	5.0 V	
7 (L)	Ground	ACC power supply	Input	Ignition switch ACC	_	Battery voltage	
9	8			Ignition	Lighting switch is OFF.	0 V	
(R)	(W)	Illumination signal	Input	switch OFF	Lighting switch is 1ST or 2ND.	12.0 V	
11 (V)	12 (LG)	Sound signal front speaker RH	Output	Ignition switch ON	Audio signal output	(V) 1 0 -1 + + 2ms	

AUDIO UNIT

< ECU DIAGNOSIS INFORMATION >

[BASE AUDIO]

	minal e color)	Description		Condition		Reference value	
+	_	Signal name	Input/ Output		Condition	(Approx.)	
4.0			Ignition _ Input switch		Keep pressing VOL DOWN switch	0 V	
16 (L)	15 (B)	Steering switch signal B			Keep pressing VOL UP switch	1.0 V	
				Except for above	5.0 V		
19 (Y)	Ground	Battery power supply	Input	Ignition switch OFF	_	Battery voltage	
43	Ground	Antenna amp. ON signal	Output	Ignition switch ON	_	12.0 V	
44	_	Antenna signal	Input	_	_	_	

< WIRING DIAGRAM > [BASE AUDIO]

Α


В

WIRING DIAGRAM

BASE AUDIO

Wiring Diagram

For connector terminal arrangements, harness layouts, and alphabets in a (option abbreviation; if not described in wiring diagram), refer to GI-12, "Connector Information".

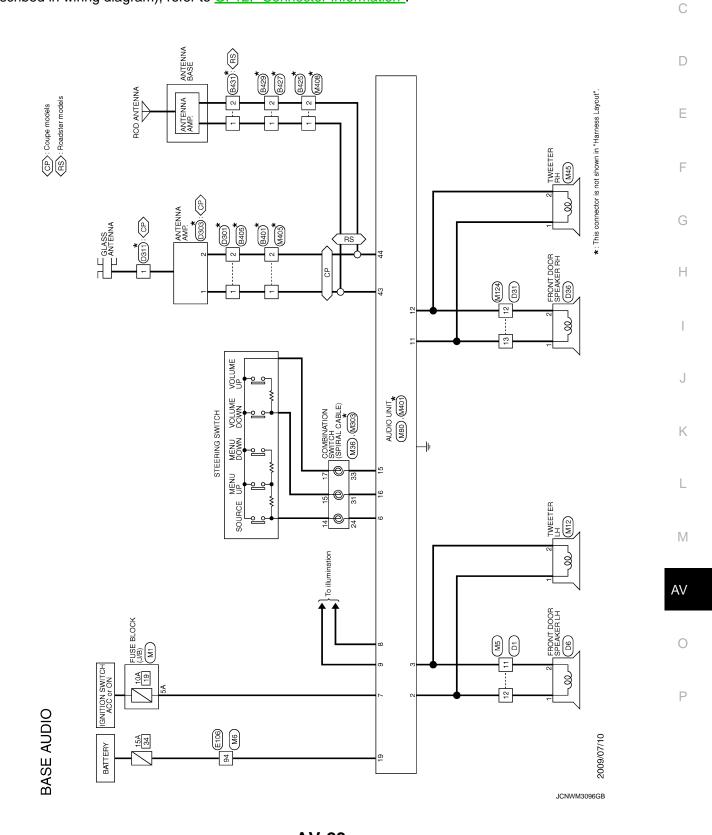

SYMPTOM DIAGNOSIS

AUDIO SYSTEM SYMPTOMS

Symptom Table

AUDIO SYSTEM

Coupe Models

Symptoms	Check items	Possible malfunction location / Action to take
Audio unit does not start.	_	Audio unit power supply and ground circuit. Refer to AV-14, "AUDIO UNIT: Diagnosis Procedure".
	No sound from all speakers.	Audio unit power supply and ground circuit. Refer to AV-14, "AUDIO UNIT: Diagnosis Procedure".
No sound comes out.	Only a certain speaker (front right, front left, rear right, or rear left) does not output sound.	 Poor connector connection of speaker. Sound signal circuit malfunction between audio unit and speaker. Malfunction in speaker. Malfunction in audio unit.
	Noise comes out from all speaker.	Malfunction in audio unit.
Noise is mixed with audio.	Noise comes out only from a certain speaker (front right, front left, rear right, or rear left).	 Poor connector connection of speaker. Sound signal circuit malfunction between audio unit and speaker. Malfunction in speaker. Poor installation of speaker (e.g. backlash and looseness) Malfunction in audio unit.
	Noise is mixed with radio only (when the car hits a bump or while driving over bad roads).	Poor connector connection of antenna or antenna feeder.
Radio is not received or poor reception.	Other audio sounds are normal. Any radio cannot be received or poor reception is caused even after moving to a service area with good reception (e.g. a place with clear view and no obstacles generating external noises).	Antenna amp. ON signal circuit malfunction. Poor connector connection of antenna or antenna feeder.

Roadster Models

Symptoms	Check items	Possible malfunction location / Action to take	
Audio unit does not start.	_	Audio unit power supply and ground circuit. Refer to AV-14, "AUDIO UNIT: Diagnosis Procedure".	
No sound comes out.	No sound from all speakers.	Audio unit power supply and ground circuit. Refer to AV-14, "AUDIO UNIT: Diagnosis Procedure".	
	Only a certain speaker (front right, front left, rear right, or rear left) does not output sound.	 Poor connector connection of speaker. Sound signal circuit malfunction between audio unit and speaker. Malfunction in speaker. Malfunction in audio unit. 	

AUDIO SYSTEM SYMPTOMS

< SYMPTOM DIAGNOSIS >

[BASE AUDIO]

Α

В

С

D

Е

F

G

Н

Symptoms	Check items	Possible malfunction location / Action to take
Noise is mixed with audio.	Noise comes out from all speaker.	Malfunction in audio unit.
	Noise comes out only from a certain speaker (front right, front left, rear right, or rear left).	 Poor connector connection of speaker. Sound signal circuit malfunction between audio unit and speaker. Malfunction in speaker. Poor installation of speaker (e.g. backlash and looseness) Malfunction in audio unit.
	Noise is mixed with radio only (when the car hits a bump or while driving over bad roads).	 Poor connector connection of antenna or antenna feeder. Loose antenna base mounting nut. Refer to <u>AV-35</u>, "<u>Exploded View</u>".
Radio is not received or poor reception.	Other audio sounds are normal. Any radio cannot be received or poor reception is caused even after moving to a service area with good reception (e.g. a place with clear view and no obstacles generating external noises).	 Antenna amp. ON signal circuit malfunction. Poor connector connection of antenna or antenna feeder. Loose antenna base mounting nut. Refer to <u>AV-35</u>, "<u>Exploded View</u>".

RELATED TO STEERING SWITCH

Symptoms	Possible malfunction location / Action to take
All steering switches are not operated.	Steering switch signal ground circuit. Refer to AV-19, "Diagnosis Procedure".
Only specified switch cannot be operated.	Replace steering switch.
"MENU UP", "MENU DOWN" and "SOURCE" switches are not operated.	Steering switch signal A circuit. Refer to AV-15, "Diagnosis Procedure".
"VOL UP" and "VOL DOWN" switches are not operated.	Steering switch signal B circuit. Refer to AV-17, "Diagnosis Procedure".

Κ

J

 \mathbb{N}

ΑV

0

F

[BASE AUDIO]

NORMAL OPERATING CONDITION

Description INFOID:000000008195198

RELATED TO AUDIO

- The majority of the audio malfunctions are the result of outside causes (bad CD, electromagnetic interference, etc.). Check the symptoms below to diagnose the malfunction.
- The vehicle itself can be a source of noise if noise prevention parts or electrical equipment is malfunctioning.
 Check that noise is caused and/or changed by engine speed, ignition switch turned to each position, and operation of each piece of electrical equipment. Then determine the cause.

NOTE:

Check that the CDs carry the Compact Disc Logo. If not, the disc is not mastered to the red book Compact Disc Standard and may not play.

Symptoms	Cause and Counter measure	
Connectalou	Check that the CD was inserted correctly.	
	Check that the CD is scratched or dirty.	
	Check that there is condensation inside the player, and if there is, wait until the condensation is gone (about 1 hour) before using the player.	
Cannot play	The player will play correctly after it returns to the normal temperature if there is a temperature increase error.	
	Check that the finalization process, such as session close and disc close, is done for the disc.	
	Check that the CD is protected by copyright.	
Poor sound quality	Check that the CD is scratched or dirty.	
The songs do not play back in the desired order.	The playback order is the order in which the files were written by the software, so the files might not play in the desired order.	
Poor reception only from a certain radio broadcast station.	Check incoming radio wave signal strength of applicable broadcast station.	
Buzz/rattle sound from speaker	The majority of rattle sounds are not indicative of an issue with the speaker, usually something nearby the speaker is causing the rattle.	

Noise resulting from variations in field strength, such as fading noise and multi-path noise, or external noise from trains and other sources, is not a malfunction.

NOTE:

- Fading noise: This noise occurs because of variations in the field strength in a narrow range due to mountains or buildings blocking
 the signal.
- Multi-path noise: This noise results from a time difference between the broadcast waves directly from the station arriving at the
 antenna and the waves reflected by mountains or buildings.

PRECAUTIONS

[BASE AUDIO] < PRECAUTION >

PRECAUTION

PRECAUTIONS EXCEPT FOR MEXICO

EXCEPT FOR MEXICO: Precaution for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRE-TENSIONER" INFOID:0000000008195199

The Supplemental Restraint System such as "AIR BAG" and "SEAT BELT PRE-TENSIONER", used along with a front seat belt, helps to reduce the risk or severity of injury to the driver and front passenger for certain types of collision. This system includes seat belt switch inputs and dual stage front air bag modules. The SRS system uses the seat belt switches to determine the front air bag deployment, and may only deploy one front air bag, depending on the severity of a collision and whether the front occupants are belted or unbelted. Information necessary to service the system safely is included in the "SRS AIR BAG" and "SEAT BELT" of this Service Manual.

WARNING:

Always observe the following items for preventing accidental activation.

- To avoid rendering the SRS inoperative, which could increase the risk of personal injury or death in the event of a collision that would result in air bag inflation, all maintenance must be performed by an authorized NISSAN/INFINITI dealer.
- Improper maintenance, including incorrect removal and installation of the SRS, can lead to personal injury caused by unintentional activation of the system. For removal of Spiral Cable and Air Bag Module, see "SRS AIR BAG".
- Never use electrical test equipment on any circuit related to the SRS unless instructed to in this Service Manual. SRS wiring harnesses can be identified by yellow and/or orange harnesses or harness connectors.

PRECAUTIONS WHEN USING POWER TOOLS (AIR OR ELECTRIC) AND HAMMERS

Always observe the following items for preventing accidental activation.

- When working near the Air Bag Diagnosis Sensor Unit or other Air Bag System sensors with the ignition ON or engine running, never use air or electric power tools or strike near the sensor(s) with a hammer. Heavy vibration could activate the sensor(s) and deploy the air bag(s), possibly causing serious injury.
- When using air or electric power tools or hammers, always switch the ignition OFF, disconnect the battery, and wait at least 3 minutes before performing any service.

EXCEPT FOR MEXICO: Precaution for Battery Service

Before disconnecting the battery, lower both the driver and passenger windows. This will prevent any interference between the window edge and the vehicle when the door is opened/closed. During normal operation, the window slightly raises and lowers automatically to prevent any window to vehicle interference. The automatic window function will not work with the battery disconnected.

FOR MEXICO

FOR MEXICO: Precaution for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRE-TENSIONER" INFOID:0000000008195200

The Supplemental Restraint System such as "AIR BAG" and "SEAT BELT PRE-TENSIONER", used along with a front seat belt, helps to reduce the risk or severity of injury to the driver and front passenger for certain types of collision. Information necessary to service the system safely is included in the "SRS AIR BAG" and "SEAT BELT" of this Service Manual.

WARNING:

Always observe the following items for preventing accidental activation.

 To avoid rendering the SRS inoperative, which could increase the risk of personal injury or death in the event of a collision that would result in air bag inflation, all maintenance must be performed by an authorized NISSAN/INFINITI dealer.

INFOID:0000000008655653

Α

Е

ΑV

Р

AV-27 Revision: 2012 August 2013 370Z

PRECAUTIONS

< PRECAUTION > [BASE AUDIO]

• Improper maintenance, including incorrect removal and installation of the SRS, can lead to personal injury caused by unintentional activation of the system. For removal of Spiral Cable and Air Bag Module, see "SRS AIR BAG".

Never use electrical test equipment on any circuit related to the SRS unless instructed to in this Service Manual. SRS wiring harnesses can be identified by yellow and/or orange harnesses or harness connectors.

PRECAUTIONS WHEN USING POWER TOOLS (AIR OR ELECTRIC) AND HAMMERS

WARNING:

Always observe the following items for preventing accidental activation.

- When working near the Air Bag Diagnosis Sensor Unit or other Air Bag System sensors with the ignition ON or engine running, never use air or electric power tools or strike near the sensor(s) with a hammer. Heavy vibration could activate the sensor(s) and deploy the air bag(s), possibly causing serious injury.
- When using air or electric power tools or hammers, always switch the ignition OFF, disconnect the battery, and wait at least 3 minutes before performing any service.

FOR MEXICO: Precaution for Battery Service

INFOID:0000000008195201

Before disconnecting the battery, lower both the driver and passenger windows. This will prevent any interference between the window edge and the vehicle when the door is opened/closed. During normal operation, the window slightly raises and lowers automatically to prevent any window to vehicle interference. The automatic window function will not work with the battery disconnected.

PREPARATION

< PREPARATION > [BASE AUDIO]

PREPARATION

PREPARATION

Commercial Service Tools

Tool name	me	Description
Power tool	tool PBIC0191E	Loosening screws

F

Α

В

С

D

Е

INFOID:0000000008195202

G

Н

|

J

Κ

L

M

ΑV


0

REMOVAL AND INSTALLATION

AUDIO UNIT


Exploded View

REMOVAL

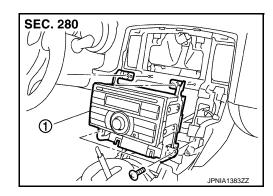

1. Audio unit

DISASSEMBLY

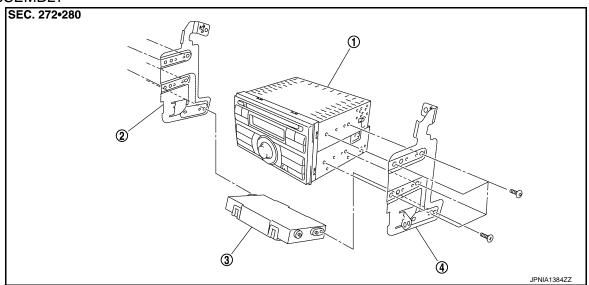

1. Audio unit

2. Bracket LH

B. A/C auto amp.

4. Bracket RH

Removal and Installation

INFOID:0000000008195204

REMOVAL

- 1. Remove cluster lid C. Refer to IP-14, "Exploded View".
- 2. Remove audio unit with A/C auto amp. as a single unit from the body.
- 3. Remove bracket screws to remove audio unit.

INSTALLATION

Install in the reverse order of removal.

FRONT DOOR SPEAKER

< REMOVAL AND INSTALLATION >

[BASE AUDIO]

Α

В

C

D


Е

F

FRONT DOOR SPEAKER

Exploded View

INFOID:0000000008195205

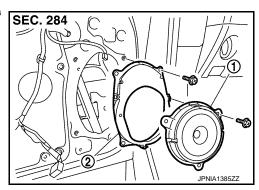

- Front door speaker
- 2. Bracket

Removal and Installation

INFOID:0000000008195206

REMOVAL

- 1. Remove door finisher. Refer to INT-15, "Removal and Installation" (coupe models) or INT-48, "Removal and Installation" (roadster models).
- 2. Remove front door speaker from bracket.

INSTALLATION

Install in the reverse order of removal.

Н

Κ

L

M

ΑV


0

[BASE AUDIO]

TWEETER

Exploded View

INFOID:0000000008195207

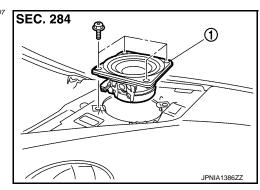

Tweeter

Removal and Installation

INFOID:0000000008195208

REMOVAL

- 1. Remove speaker grille. Refer to IP-14, "Exploded View".
- 2. Remove tweeter screws, then lift up tweeter, disconnect connector and remove tweeter.

INSTALLATION

Install in the reverse order of removal.

STEERING SWITCH		
< REMOVAL AND INSTALLATION >	[BASE AUDIO]	
STEERING SWITCH		
Exploded View	INFOID:000000008195209	
Refer to SR-14, "Exploded View".	1	
Removal and Installation	INFOID:000000008195210	
REMOVAL Refer to SR-14, "Removal and Installation".	(
INSTALLATION Installation is the reverse order of removal.	ı	
	I	
	(
	ı	
	1	
	1	
	A	


0

[BASE AUDIO]

ANTENNA AMP.

Exploded View

INFOID:0000000008195211

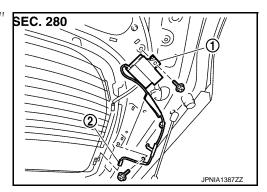

- 1. Antenna amp.
- 2. Connector

Removal and Installation

INFOID:0000000008195212

REMOVAL

- 1. Remove back door finisher side. Refer to INT-33, "Exploded View".
- 2. Disconnect connector and remove screw, then remove antenna amp.

INSTALLATION

Install in the reverse order of removal.

[BASE AUDIO]

Α

В

D

Е

F

Н


J

K

ANTENNA BASE

Exploded View

INFOID:0000000008195213

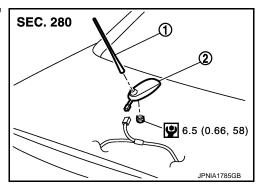

- 1. Antenna rod
- 2. Antenna base

Refer to GI-4, "Components" for symbols in the figure.

Removal and Installation

INFOID:0000000008195214

REMOVAL

- 1. Remove trunk lid finisher inner. Refer to INT-79, "Exploded View".
- 2. Remove antenna base mounting nut, disconnect the antenna base connector.
- 3. Remove antenna base.

INSTALLATION

Installation is the reverse order of removal.

CAUTION:

Be careful about tightening torque. Antenna sensitivity becomes poor, and when it is excessive, trunk lid panel may be deformed, when antenna base mounting nut tightening torque is loose.

L

M

ΑV


C

ANTENNA FEEDER

COUPE

COUPE: Feeder Layout

INFOID:0000000008195215

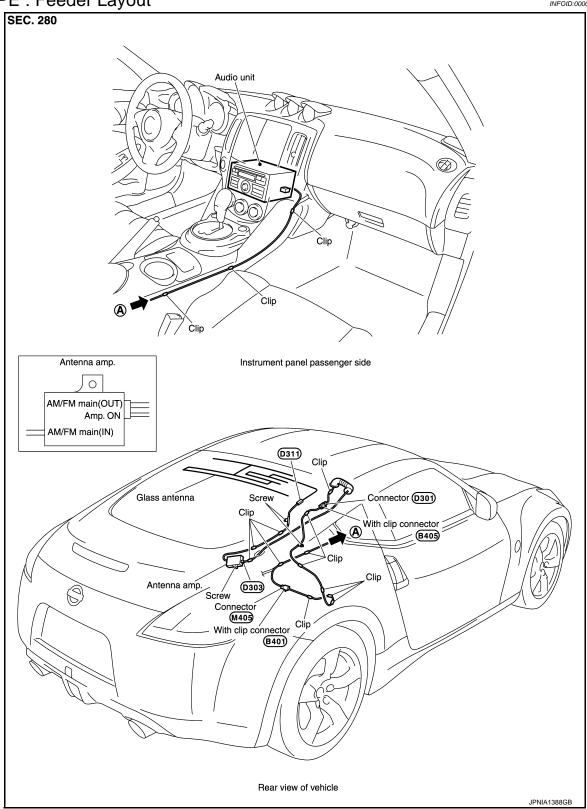

ROADSTER

ROADSTER: Feeder Layout INFOID:0000000008195216 SEC. 280 Ĉlip Instrument panel passenger side Clip Connector (B408) With clip connector B425 With clip connector Connector Clip (B431) (B429) With clip connector (B427) Rear view of vehicle JPNIA1837GB

Α

В

С

D

Ε

F

G

Н

l

K

-

M

AV

0


Р

BASIC INSPECTION

DIAGNOSIS AND REPAIR WORKFLOW

Work Flow

OVERALL SEQUENCE

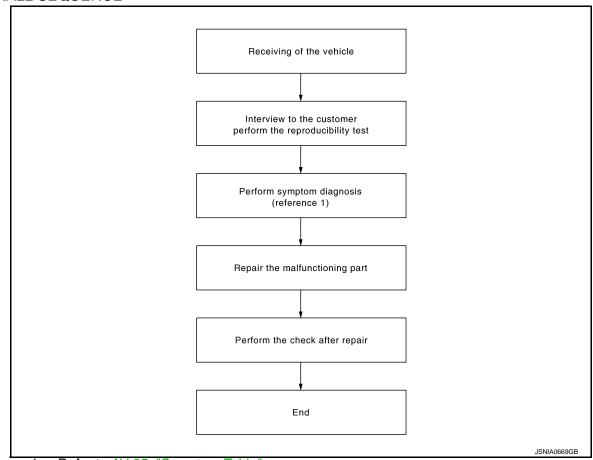

Reference 1 ··· Refer to AV-95, "Symptom Table".

DETAILED FLOW

1. CHECK SYMPTOM

Check the malfunction symptoms by performing the following items.

- Interview the customer to obtain the malfunction information (conditions and environment when the malfunction occurred).
- Check the symptom.

>> GO TO 2.

2. PERFORM DIAGNOSIS BY SYMPTOM

Perform the relevant diagnosis referring to the diagnosis chart by symptom. Refer to <u>AV-95</u>, "Symptom Table"".

>> GO TO 3.

3. REPAIR OR REPLACE MALFUNCTIONING PARTS

Repair or replace the malfunctioning parts.

>> GO TO 4.

DIAGNOSIS AND REPAIR WORKFLOW [BOSE AUDIO WITHOUT NAVIGATION]

< BASIC INSPECTION >

4.FINAL CHECK

Perform the operation to check that the malfunction symptom is solved or any other symptoms are present. <u>Is there any symptom?</u>

YES >> GO TO 2.

NO >> INSPECTION END

Α

В

С

D

Е

F

G

Н

J

Κ

L

M

ΑV

0


Р

SYSTEM DESCRIPTION


AUDIO SYSTEM

System Diagram

COUPE MODELS

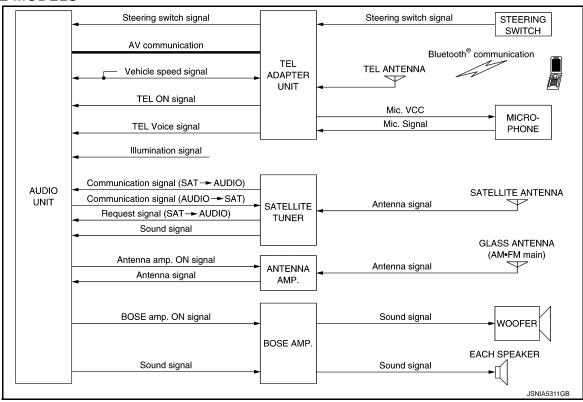


ROADSTER MODELS

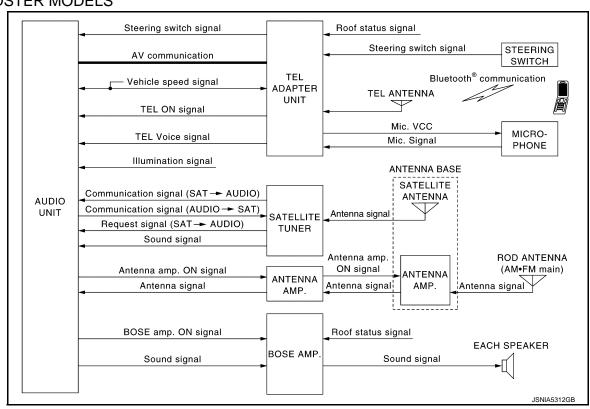

NOTE:

An antenna base integrated with antenna amp. and satellite antenna are adopted.

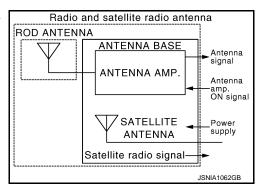

System Description

INFOID:0000000008195219

Α

Е

AUDIO SYSTEM

Audio functions

AM/FM radio		
Satellite radio (except for Mexico models)		
6CD		
Speed sensitive volume		
Sound equalizer automatic switching (roadster models)		

Sound equalizer automatic switching (roadster models)

- Radio signals are received by glass antenna, next it is amplified by antenna amp., and finally it is input to audio unit. (coupe models)
- Radio signals are received by rod antenna, next it is amplified by antenna amp., and finally it is input to audio unit. (roadster models)
- Audio unit outputs sound signal to BOSE amp. and BOSE amp. outputs to woofer and each speaker. (coupe models)
- Audio unit outputs sound signal to BOSE amp. and BOSE amp. outputs to each speaker. (roadster models)

Satellite Radio System

- Radio signals are supplied to satellite radio tuner from the satellite radio antenna.
- The satellite radio tuner sends sound signal to the audio unit.
- Audio unit outputs sound signal to BOSE amp. and BOSE amp. outputs to woofer and each speaker. (coupe models)
- Audio unit outputs sound signal to BOSE amp. and BOSE amp. outputs to each speaker. (roadster models)

Speed Sensitive Volume

- Volume level of this system gone up and down automatically in proportion to the vehicle speed.
- The control level can be selected by the customer.

Sound Equalizer Automatic Switching Function

Sound quality in a fully-open retractable soft top condition is improved by the correction for bringing the frequency characteristics in a fully-open retractable soft top condition closer to the characteristics in a fully-closed retractable soft top condition. When the retractable soft top is in a fully-open condition, sound pressure is reduced due to the absence of sound echo generated by sound reflection from the retractable soft top. BOSE amp. detects an open-close condition of the retractable soft top by receiving a roof status signal from the retractable soft top control unit and switches the equalizer to correct the frequency characteristics in a fully-open retractable soft top condition. During the switching of the equalizer, audio stops temporarily due to the temporary mute.

۸۱/

M

L


0

Р

Component Parts Location

INFOID:0000000008195220

COUPE MODELS

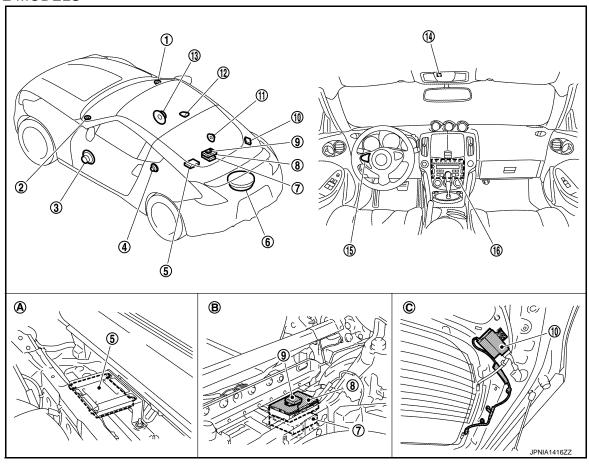

- 1. Tweeter RH
- 4. Rear speaker LH
- 7. Satellite radio tuner*
- 10. Antenna amp.
- 13. Front door speaker RH
- 16. Audio unit
- A. Luggage side LH

- 2. Tweeter LH
- 5. BOSE amp.
- 8. TEL adapter unit
- 11. Rear speaker RH
- 14. Microphone
- B. Luggage side RH

- 3. Front door speaker LH
- 6. Woofer
- 9. TEL antenna
- 12. Satellite radio antenna*
- 15. Steering switch
- C. Back door side RH

*: Except for Mexico models

[BOSE AUDIO WITHOUT NAVIGATION]

Α

В

D

Е

F

Н


K

M

ΑV

Р

ROADSTER MODELS

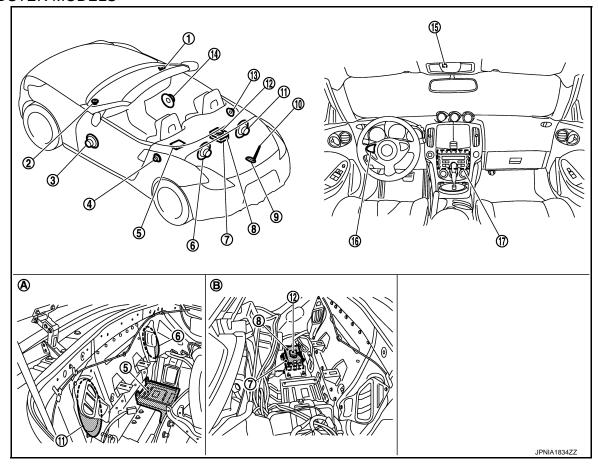

- 1. Tweeter RH
- 4. Rear speaker LH
- 7. Satellite radio tuner
- 10. Rod antenna
- 13. Rear speaker RH
- 16. Steering switch
- A. Luggage side LH

- 2. Tweeter LH
- 5. BOSE amp.
- 8. TEL adapter unit
- 11. Rear woofer RH
- 14. Front door speaker RH
- 17. Audio unit
- B. Luggage side RH

- 3. Front door speaker LH
- 6. Rear woofer LH
- 9. Antenna base12. TEL antenna
- 15. Microphone

Component Description

INFOID:0000000008195221

Part name	Description
Audio unit	Controls audio system and satellite radio system functions.
BOSE amp.	Coupe models Receives power (BOSE amp. ON) and sound signals from audio unit, and outputs sound signals to woofer and each speaker. Roadster models Receives power (BOSE amp. ON) and sound signals from audio unit, and outputs sound signals to woofer and each speaker. Input roof status signal from retractable soft top control unit.
Steering switch	 Each audio operation can be operated. Steering switch signal (operation signal) is output to audio unit through TEL adapter unit.
Front door speaker	Outputs sound signal from BOSE amp.Outputs mid and low range sounds.
Tweeter	Outputs sound signal from BOSE amp.Outputs high range sounds.

AUDIO SYSTEM

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITHOUT NAVIGATION]

Part name	Description
Rear speaker	Outputs sound signal from BOSE amp.Outputs high, mid and low range sounds.
Woofer (coupe models)	Outputs sound signal from BOSE amp.Outputs low range sounds.
Rear woofer (roadster models)	Outputs sound signal from BOSE amp.Outputs low range sounds.
Antenna amp. (coupe models)	 Radio signal received by glass antenna is amplified and transmitted to audio unit. Power (antenna amp. ON signal) is supplied from audio unit.
Antenna base (roadster models)	An antenna base integrated with radio antenna amp. and satellite radio antenna are adopted. Radio antenna Radio signal received by rod antenna is amplified and transmitted to audio unit. Power (antenna amp. ON signal) is supplied from audio unit. Satellite radio antenna Receives the satellite radio wave and outputs it to the satellite radio tuner.
Satellite radio antenna	Sound signal (satellite radio) is received and output to satellite radio tuner.
Satellite radio tuner	Receives radio signals from satellite radio antenna.Sends sound signals to audio unit.

Α

В

D

Е

M


ΑV

INFOID:0000000008195222


HANDS-FREE PHONE SYSTEM

System Diagram

COUPE MODELS

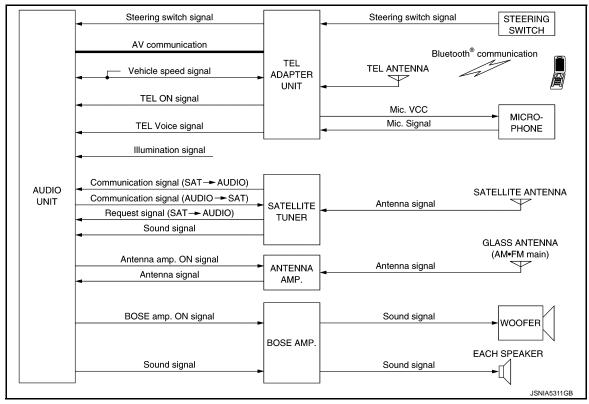

ROADSTER MODELS

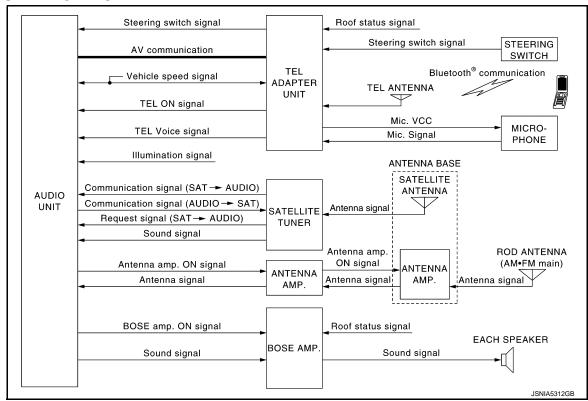


NOTE:

HANDS-FREE PHONE SYSTEM

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITHOUT NAVIGATION]

An antenna base integrated with antenna amp. and satellite antenna are adopted.

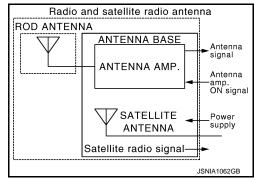

System Description

INFOID:0000000008195223

- The connection between portable telephone and TEL adapter unit is performed with Bluetooth[®] communication.
- The voice guidance signal is input from the TEL adapter unit to the audio unit and output via BOSE amp. to the front speaker when operating the telephone.
- TEL adapter unit has the on board self-diagnosis function. Refer to AV-52, "Diagnosis Description".
- Start of hads-free phone system can be performed by steering switch.

WHEN RECEIVING A CALL

Telephone voice signal received with the portable telephone is input from TEL antenna via TEL adapter unit to audio unit with Bluetooth[®] communication and output via BOSE amp. to the front speaker. The operation is performed with the steering switch or voice recognition function.

WHEN A CALL IS ORIGINATED

Speech sound (telephone voice signal) is input from the microphone to the TEL adapter unit. It is input from the TEL antenna via Bluetooth[®] communication to the portable telephone. It is transmitted to the phone on the other side. The operation is performed with the steering switch or voice recognition function.

VOICE RECOGNITION FUNCTION

- Each operation of multi AV system can be performed by inputting sound to microphone.
- Start of voice recognition system can be performed by steering switch.
- System operation is available only when the retractable soft top is closed. (roadster models)

Component Parts Location

INFOID:0000000008195224

Α

В

D

Е

F


Н

K

L

M

COUPE MODELS

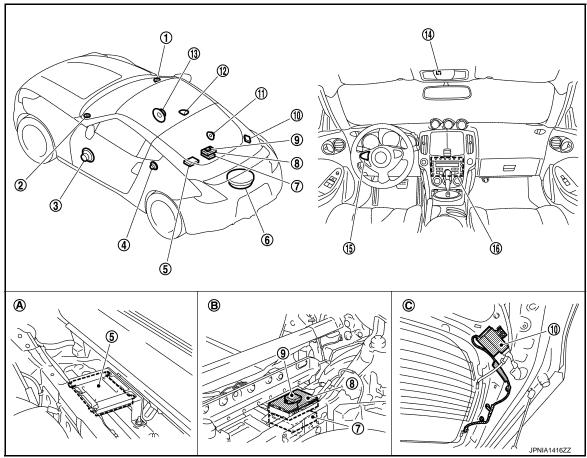

- 1. Tweeter RH
- 4. Rear speaker LH
- 7. Satellite radio tuner*
- 10. Antenna amp.
- 13. Front door speaker RH

*: Except for Mexico models

- 16. Audio unit
- A. Luggage side LH

- 2. Tweeter LH
- 5. BOSE amp.
- 8. TEL adapter unit
- 11. Rear speaker RH
- 14. Microphone
- B. Luggage side RH

- 3. Front door speaker LH
- 6. Woofer
- 9. TEL antenna
- 12. Satellite radio antenna*
- Steering switch
- C. Back door side RH


AV

0

Р

Revision: 2012 August

ROADSTER MODELS

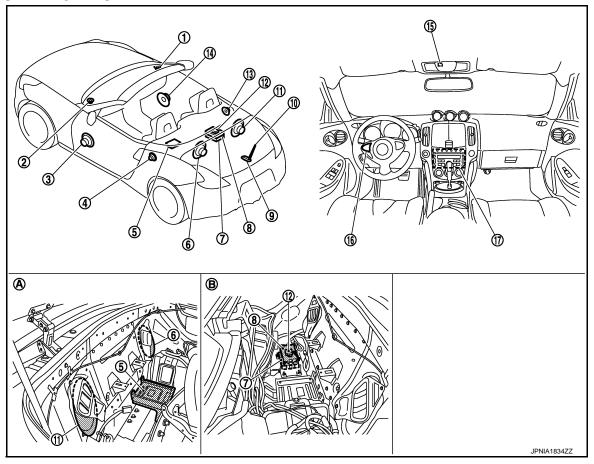

- 1. Tweeter RH
- 4. Rear speaker LH
- 7. Satellite radio tuner
- 10. Rod antenna
- 13. Rear speaker RH
- 16. Steering switch
- A. Luggage side LH

- 2. Tweeter LH
- 5. BOSE amp.
- 8. TEL adapter unit
- 11. Rear woofer RH
- 14. Front door speaker RH
- 17. Audio unit
- B. Luggage side RH

- 3. Front door speaker LH
- 6. Rear woofer LH
- 9. Antenna base
- 12. TEL antenna
- 15. Microphone

Component Description

INFOID:0000000008195225

Part name	Description
Audio unit	 Receives telephone voice signal from TEL adapter unit. Sends telephone voice and voice guidance signals to BOSE amp. Audio unit and TEL adapter unit exchange data by AV communication, and control audio unit display. Receives the steering switch signal (operation signal) from the steering switch through TEL adapter unit.
BOSE amp.	Inputs power (BOSE amp. ON) and sound signal from audio unit, and outputs sound signal to each speaker.
Front door speaker Tweeter	Receives telephone voice and voice guidance signals from BOSE amp.
Steering switch	 The hands-free phone system can be operated. Steering switch signal (operation signal) is output to audio unit through TEL adapter unit.

HANDS-FREE PHONE SYSTEM

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITHOUT NAVIGATION]

Part name	Description
Microphone	 Uses when operating the hands-free phone. Outputs microphone signal (telephone voice signal) to the TEL adapter unit. The power (microphone power supply) is supplied from the TEL adapter unit.
TEL adapter unit	 Inputs the telephone voice signal from TEL antenna during reception and outputs into the audio unit. Inputs the telephone voice signal from microphone during speech recognition and outputs it to the TEL antenna. Input roof status signal from retractable soft top control unit. (roadster models)
TEL antenna	Connects with the portable telephone via Bluetooth® communication and communicates the telephone voice signal.

Е

Α

В

С

D

F

G

Н

J

Κ

L

M

ΑV

0

Р

DIAGNOSIS SYSTEM (AUDIO UNIT)

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITHOUT NAVIGATION]

DIAGNOSIS SYSTEM (AUDIO UNIT)

Diagnosis Description


INFOID:0000000008195226

Self-diagnosis mode can check the following items.


- Audio unit hardware/software versions
- Continuity of each speaker channel
- Continuity of each audio unit switch

OPERATION PROCEDURE

- 1. Turn ignition switch to the ON position.
- 2. Turn the audio unit off.
- 3. While pressing the "1" button, turn the volume control dial clockwise or counterclockwise 30 clicks or more. When the self-diagnosis mode is started, a short beep will be heard.

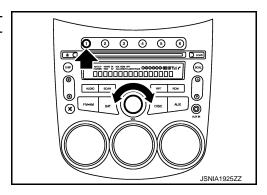


4. Initially, all display segments will be illuminated.

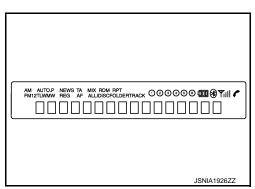

Version Check

1. Press the "DISP" switch to enter version diagnostics. "Soft" (audio software version) is displayed.

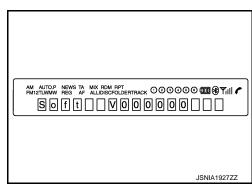

DIAGNOSIS SYSTEM (AUDIO UNIT)

< S	SYSTEM DESCRIPTION >	[BOSE AUDIO WITHOUT NAVIGATION]
2.	Press the "DISP" switch again to display the "Hard" (audio haware version).	ard-
		AM AUTOP NEWS TA MIX RDM RPT FM12TLWAW REG AF ALLIDISCFOLDERTRACK 000000000000000000000000000000000000
		JSNIA1928ZZ
3.	Press the "DISP" switch again to display the "CD Mech" mechanism version).	
		AM AUTOP NEWS TA MIX ROM RPT RETACK 000000 0000 1111 / RM12TLWAW RES AF ALLDISCFOLDERTRACK 00000 00000 1111 / RM12TLWAW RES AF ALLDISCFOLDERTRACK 000000 00000 1111 / RM12TLWAW RES AF ALLDISCFOLDERTRACK 000000 00000 1111 / RM12TLWAW RES AF ALLDISCFOLDERTRACK 000000 00000 00000 00000 00000 00000 0000
		[SNIA402077
		JSNIA1929ZZ
4.	Press the "DISP" switch again to display the "EEP" (audio EEPROM version).	unit
		AM AUTOP NEWS TA MIX RDM RPT FM12TLWMW REG AF ALLIDISCFOLDERTRACK 000000000000000000000000000000000000
		JSNIA1930ZZ
5.	Press the "DISP" switch again to display the "SDARS" (sate radio version). NOTE:	ellite
	Except for Mexico models	AM AUTOP NEWS TA MIX RDM RPT FMIZTUWAWN REG AF ALLIDISCFOLDERTRACK ① ② ② ② ③ ③ ⑤ ⑤ ¶ ¶ ¶ I •
		SDARSTVOOOOOTTA
		JSNIA1931ZZ
		JSNIA1931ZZ

AV-51 Revision: 2012 August 2013 370Z

DIAGNOSIS SYSTEM (TEL ADAPTER UNIT)

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITHOUT NAVIGATION]

DIAGNOSIS SYSTEM (TEL ADAPTER UNIT)

Diagnosis Description

INFOID:0000000008195227

HANDS FREE PHONE SYSTEM ON BOARD DIAGNOSIS

During on board diagnosis the diagnosis function of TEL adapter unit starts with the operation of the steering switch and performs the diagnosis when ignition switch ACC.

ON BOARD DIAGNOSIS ITEM

The on board diagnosis has 3 modes: the self-diagnosis mode that performs the trouble diagnosis, the speaker adaptation data deleting mode and the hands free phone system initialization mode.

CAUTION:

- Perform the diagnosis with the vehicle stopped.
- Perform STEP2 if necessary.

STEP	MODE	Description	
STEP 1	Self-diagnosis	The self-diagnosis mode performs the microphone test and the diagnosis of TEL adapter unit, TEL antenna and steering unit, and then reads out the results with the sound and indicates them on the audio screen.	
STEP 2	Hands free phone system initialization	Hands free phone system initialization mode can perform the initialization of hands free phone system.	
SIEPZ	Speaker adaptation data deleting	The speaker adaptation data deleting mode can delete the speaker adaptation data.	

SELF-DIAGNOSIS RESULTS

Self-diagnosis mode reads out the self-diagnosis results and indicates DTC on the audio screen. **NOTE:**

- Error count is read out simultaneously when reading out the DTC name.
- The errors are read out continuously when some errors occur at the same time. The DTC displays are combined and displayed. For example, DTC 01100 is displayed when DTC 01000 and DTC 00100 are indicated at the same time.

Self-diagnosis results

DTC (Audio screen)	Failure massage	Possible causes	
DTC 10000	Internal failure	TEL adapter unit	
DTC 01000	Bluetooth antenna open	TEL antenna	
DTC 00100	Bluetooth antenna shorted	TEL antenna	
DTC 00010	Button ladder A is stuck	Steering switch	
DTC 00001	Button ladder B is stuck		
DTC 00000	There are no failure records to report	_	


The Details of Error Count

The error count guides "0" when the error occurs. The next time it counts up "1" if it is normal with the ignition switch ON. It continues the count up unless the initialization of hands free phone system is performed.

DIAGNOSIS SYSTEM (TEL ADAPTER UNIT)

Α

FLOW CHART OF TROUBLE DIAGNOSIS

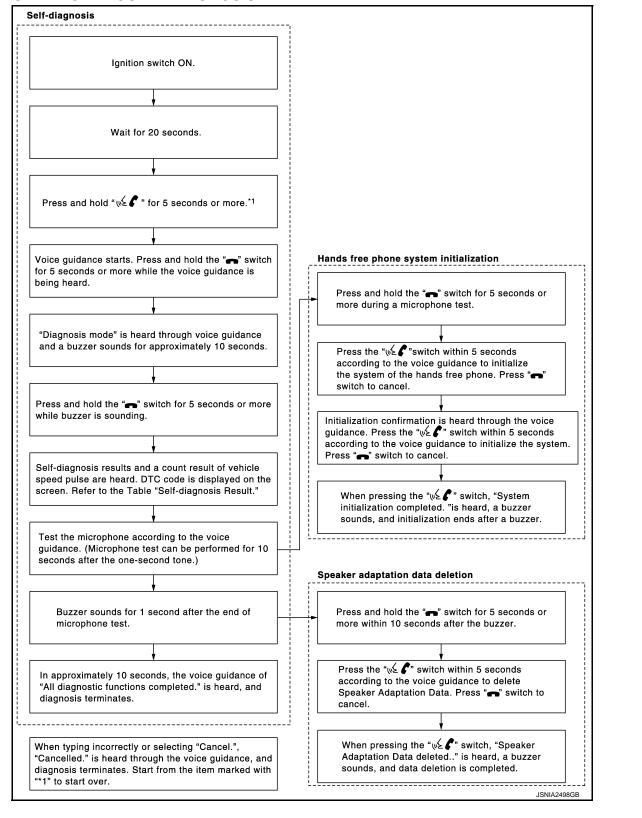

POWER SUPPLY AND GROUND CIRCUIT

[BOSE AUDIO WITHOUT NAVIGATION]

< DTC/CIRCUIT DIAGNOSIS >

DTC/CIRCUIT DIAGNOSIS

POWER SUPPLY AND GROUND CIRCUIT

AUDIO UNIT

AUDIO UNIT: Diagnosis Procedure

INFOID:0000000008195228

1. CHECK FUSE

Check that the following fuses of the audio unit are not blown.

Power source	Fuse No.
Battery	34
Ignition switch ACC or ON	19

Is inspection result OK?

YES >> GO TO 2.

NO >> If fuse is blown, be sure to eliminate cause of malfunction before installing new fuse.

2.CHECK AUDIO UNIT POWER SUPPLY CIRCUIT

Check voltage between the audio unit and ground.

Signal name	Connector No.	Terminal No.	Ignition switch position	Voltage
Battery power supply	M81	19	OFF	Battery voltage
ACC power supply	IVIÖ I	7	ACC	Dattery voltage

Is inspection result OK?

YES >> INSPECTION END

NO >> Check harness between audio unit and fuse.

BOSE AMP.

BOSE AMP.: Diagnosis Procedure

INFOID:0000000008195229

1. CHECK FUSE

Check that the following fuses of the BOSE amp. are not blown.

Power source	Fuse No.
Battery	8

Is inspection result OK?

YES >> GO TO 2.

NO >> If fuse is blown, be sure to eliminate cause of malfunction before installing new fuse.

2.CHECK POWER SUPPLY CIRCUIT

Check voltage between BOSE speaker amp harness connector and ground.

Signal name	Connector No.	Terminal No.	Ignition switch position	Voltage
Battery power supply	B42	11	OFF	Battery voltage

Is inspection result OK?

YES >> GO TO 3.

NO >> Check harness between BOSE amp. and fuse.

3.CHECK GROUND CIRCUIT

- 1. Turn ignition switch OFF.
- Disconnect BOSE amp. connector.
- 3. Check continuity between BOSE amp. harness connector and ground.

POWER SUPPLY AND GROUND CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

Signal name	Connector No.	Terminal No.	Ignition switch position	Continuity
Ground	B42	12	OFF	Existed

Is inspection result OK?

YES >> INSPECTION END

>> Repair harness or connector.

SATELLITE RADIO TUNER

SATELLITE RADIO TUNER: Diagnosis Procedure

INFOID:0000000008195230

Α

В

D

Е

Н

1.CHECK FUSES

Check that the following fuses of the satellite radio tuner are not blown.

Power source	Fuse No.
Battery	34
Ignition switch ACC or ON	19

Is inspection result OK?

YES >> GO TO 2.

NO >> If fuse is blown, be sure to eliminate cause of malfunction before installing new fuse.

2.CHECK POWER SUPPLY CIRCUIT

Check voltage between the satellite radio tuner and ground.

Signal name	Connector No.	Terminal No.	Ignition switch position	Voltage
Battery power supply	B236	12	OFF	Battery voltage
ACC power supply	D230	16	ACC	Battery voltage

Is inspection result OK?

YES >> INSPECTION END

NO >> Check harness between satellite radio tuner and fuse.

TEL ADAPTER UNIT

TEL ADAPTER UNIT : Diagnosis Procedure

INFOID:0000000008195231

1.CHECK FUSES

Check that the following fuses of the TEL adapter unit are not blown.

Power source	Fuse No.
Battery	34
Ignition switch ACC or ON	19

Is inspection result OK?

YES >> GO TO 2.

NO >> If fuse is blown, be sure to eliminate cause of malfunction before installing new fuse.

2.CHECK POWER SUPPLY CIRCUIT

Check voltage between TEL adapter unit harness connector and ground.

Signal name	Connector No.	Terminal No.	Ignition switch position	Voltage
Battery power supply	B237	1	OFF	Battery voltage
ACC power supply	D231	2	ACC	battery voltage

Is inspection result OK?

YES >> GO TO 3.

NO >> Check harness between TEL adapter unit and fuse.

AV-55 Revision: 2012 August 2013 370Z

Р

POWER SUPPLY AND GROUND CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

3. CHECK GROUND CIRCUIT

- 1. Turn ignition switch OFF.
- Disconnect TEL adapter unit connector.
 Check continuity between TEL adapter unit harness connector and ground.

Signal name	Connector No.	Terminal No.	Ignition switch position	Continuity
Ground	B237	4	OFF	Existed

Is inspection result OK?

YES >> INSPECTION END

NO >> Repair harness or connector.

STEERING SWITCH SIGNAL A CIRCUIT (STEERING SWITCH TO TEL ADAPT-ER UNIT)

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

INFOID:0000000008195233

D

Е

F

STEERING SWITCH SIGNAL A CIRCUIT (STEERING SWITCH TO TEL ADAPTER UNIT)

Description INFOID:0000000008195232

- Transmits the steering switch signal to audio unit.
- Transmits the steering switch signal to audio unit through TEL adapter unit.

Diagnosis Procedure

1. CHECK STEERING SWITCH SIGNAL A CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect TEL adapter unit connector and spiral cable connector.
- Check continuity between TEL adapter unit harness connector and spiral cable harness connector.

TEL ada	apter unit	Spiral cable		Continuity
Connector	Terminal	Connector	Terminal	Continuity
B237	12	M36	24	Existed

4. Check continuity between TEL adapter unit harness connector and ground.

TEL adapter unit			Continuity
Connector	Terminal	Ground	Continuity
B237	12		Not existed

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2. CHECK SPIRAL CABLE

Check spiral cable.

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace spiral cable. Refer to <u>SR-17</u>, "Removal and Installation".

3.CHECK TEL ADAPTER UNIT VOLTAGE

- 1. Connect TEL adapter unit connector and spiral cable connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between TEL adapter unit harness connector.

((+)		-)	
TEL ada	apter unit	TEL adapter unit		Voltage (Approx.)
Connector	Terminal	Connector	Terminal	(
B237	12	B237	14	5.0 V

Is the inspection result normal?

YES >> GO TO 4.

NO >> Replace TEL adapter unit. Refer to AV-118, "Removal and Installation".

4. CHECK STEERING SWITCH

- Turn ignition switch OFF.
- Check steering switch. Refer to <u>AV-58, "Component Inspection"</u>.

Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace steering switch. Refer to AV-117, "Removal and Installation".

IV

ΑV

Р

K

Revision: 2012 August **AV-57** 2013 370Z

STEERING SWITCH SIGNAL A CIRCUIT (STEERING SWITCH TO TEL ADAPTER UNIT)


< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

INFOID:0000000008195234

Component Inspection

Measure the resistance between the steering switch connector.

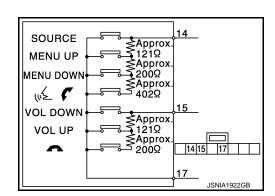

Standard

Steerin	g switch	Condition	Resistance	
Terminal	Terminal	Condition	Ω	
		w≨ € switch ON	709 – 737	
14	14	MENU DOWN switch ON	315 – 327	
	4-7	MENU UP switch ON	119 – 123	
	17	17	SOURCE switch ON	0
	15	VOL DOWN switch ON	0	
15		VOL UP switch ON	119 – 123	
		switch ON	315 – 327	

STEERING SWITCH SIGNAL B CIRCUIT (STEERING SWITCH TO TEL ADAPT-ER UNIT)

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

INFOID:0000000008195236

D

Е

F

STEERING SWITCH SIGNAL B CIRCUIT (STEERING SWITCH TO TEL ADAPTER UNIT)

Description INFOID:0000000008195235

- Transmits the steering switch signal to audio unit.
- Transmits the steering switch signal to audio unit through TEL adapter unit.

Diagnosis Procedure

1. CHECK STEERING SWITCH SIGNAL B CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect TEL adapter unit connector and spiral cable connector.
- Check continuity between TEL adapter unit harness connector and spiral cable harness connector.

TEL ada	apter unit	Spiral cable		Continuity
Connector	Terminal	Connector	Terminal	Continuity
B237	13	M36	31	Existed

Check continuity between TEL adapter unit harness connector and ground.

TEL adapter unit			Continuity
Connector	Terminal	Ground	Continuity
B237	13		Not existed

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2. CHECK SPIRAL CABLE

Check spiral cable.

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace spiral cable. Refer to <u>SR-17</u>, "Removal and Installation".

3.CHECK TEL ADAPTER UNIT VOLTAGE

- 1. Connect TEL adapter unit connector and spiral cable connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between TEL adapter unit harness connector.

(+)		(–)		
TEL ada	apter unit	TEL adapter unit		Voltage (Approx.)
Connector	Terminal	Connector	Terminal	(44)
B237	13	B237	14	5.0 V

Is the inspection result normal?

YES >> GO TO 4.

NO >> Replace TEL adapter unit. Refer to AV-118, "Removal and Installation".

4. CHECK STEERING SWITCH

- Turn ignition switch OFF.
- Check steering switch. Refer to <u>AV-60, "Component Inspection"</u>.

Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace steering switch.Refer to AV-117, "Removal and Installation".

M

ΑV

Р

K

Revision: 2012 August **AV-59** 2013 370Z

STEERING SWITCH SIGNAL B CIRCUIT (STEERING SWITCH TO TEL ADAPTER UNIT)


< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

INFOID:0000000008195237

Component Inspection

Measure the resistance between the steering switch connector.

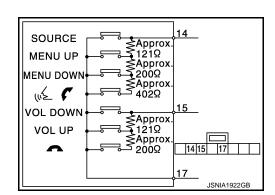

Standard

Steerin	g switch	Condition	Resistance
Terminal	Terminal	Condition	Ω
		w≨ € switch ON	709 – 737
14	14 17	MENU DOWN switch ON	315 – 327
		MENU UP switch ON	119 – 123
		SOURCE switch ON	0
		VOL DOWN switch ON	0
15		VOL UP switch ON	119 – 123
		switch ON	315 – 327

STEERING SWITCH SIGNAL GND CIRCUIT (STEERING SWITCH TO TEL ADAPTER UNIT)

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

STEERING SWITCH SIGNAL GND CIRCUIT (STEERING SWITCH TO TEL ADAPTER UNIT)

Description INFOID:000000008195238

- Transmits the steering switch signal to audio unit.
- Transmits the steering switch signal to audio unit through TEL adapter unit.

Diagnosis Procedure

1. CHECK STEERING SWITCH SIGNAL GND CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect TEL adapter unit connector and spiral cable connector.
- Check continuity between TEL adapter unit harness connector and spiral cable harness connector.

TEL ada	apter unit	Spiral cable		Continuity
Connector	Terminal	Connector	Terminal	Continuity
B237	14	M36	33	Existed

4. Connect TEL adapter unit connector.

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK SPIRAL CABLE

Check spiral cable.

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace spiral cable. Refer to SR-17, "Removal and Installation".

3. CHECK GROUND CIRCUIT

- 1. Connect TEL adapter unit connector.
- 2. Check continuity between TEL adapter unit harness connector and ground.

TEL ada	apter unit		Continuity
Connector	Terminal	Ground	Continuity
B237	14		Existed

Is the inspection result normal?

YES >> GO TO 4.

NO >> Replace TEL adapter unit. Refer to AV-118, "Removal and Installation".

4. CHECK STEERING SWITCH

Check steering switch. Refer to AV-62, "Component Inspection".

Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace steering switch. Refer to AV-117, "Removal and Installation".

AV

M

K

В

D

Е

F

Н

INFOID:0000000008195239

Р

Revision: 2012 August **AV-61** 2013 370Z

STEERING SWITCH SIGNAL GND CIRCUIT (STEERING SWITCH TO TEL ADAPTER UNIT)


< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

INFOID:0000000008195240

Component Inspection

Measure the resistance between the steering switch connector.

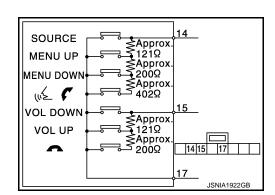

Standard

Steering switch		Condition	Resistance
Terminal	Terminal	Ω	
	14 17	ແຂ້ 🌈 switch ON	709 – 737
14		MENU DOWN switch ON	315 – 327
		MENU UP switch ON	119 – 123
		SOURCE switch ON	0
		VOL DOWN switch ON	0
15	VOL UP switch ON	119 – 123	
		switch ON	315 – 327

STEERING SWITCH SIGNAL A CIRCUIT (TEL ADAPTER UNIT TO AUDIO UNIT) [BOSE AUDIO WITHOUT NAVIGATION]

< DTC/CIRCUIT DIAGNOSIS >

STEERING SWITCH SIGNAL A CIRCUIT (TEL ADAPTER UNIT TO AUDIO UNIT)

Description INFOID:0000000008195241

- Transmits the steering switch signal to audio unit.
- Transmits the steering switch signal to audio unit through TEL adapter unit.

Diagnosis Procedure

CHECK STEERING SWITCH SIGNAL A CIRCUIT

- Turn ignition switch OFF.
- Disconnect audio unit connector and TEL adapter unit connector.
- Check continuity between audio unit harness connector and TEL adapter unit harness connector.

Audi	o unit	TEL adapter unit		Continuity
Connector	Terminal	Connector	Terminal	Continuity
M81	6	B237	17	Existed

Check continuity between audio unit harness connector and ground.

Audio unit			Continuity
Connector	Terminal	Ground	Continuity
M81	6		Not existed

Is the inspection result normal?

>> GO TO 2. YES

NO >> Repair harness or connector.

2.CHECK TEL ADAPTER UNIT POWER SUPPLY

Check TEL adapter unit power supply. Refer to AV-55, "TEL ADAPTER UNIT: Diagnosis Procedure".

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace TEL adapter unit. Refer to AV-118, "Removal and Installation".

3. CHECK AUDIO UNIT VOLTAGE

- 1. Connect audio unit connector and TEL adapter unit connector.
- 2. Turn ignition switch ON.
- Check voltage between audio unit harness connector.

(+)		(–)		
Audi	o unit	Audio unit		Voltage (Approx.)
Connector	Terminal	Connector	Terminal	, , ,
M81	6	M81	15	5.0 V

Is the inspection result normal?

YES >> GO TO 4.

NO >> Replace audio unit. Refer to AV-106, "Removal and Installation".

4. CHECK STEERING SWITCH

- Turn ignition switch OFF.
- Check steering switch. Refer to AV-64, "Component Inspection".

Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace steering switch. Refer to AV-117, "Removal and Installation". Е

F

D

INFOID:0000000008195242

K

M

ΑV


STEERING SWITCH SIGNAL A CIRCUIT (TEL ADAPTER UNIT TO AUDIO UNIT) [BOSE AUDIO WITHOUT NAVIGATION]

< DTC/CIRCUIT DIAGNOSIS >

Component Inspection

INFOID:0000000008195243

Measure the resistance between the steering switch connector.

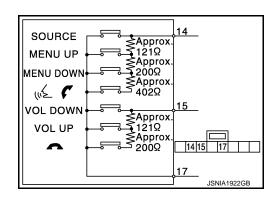

Standard

Steering switch		Condition	Resistance
Terminal	Terminal	Condition	Ω
		w≨ € switch ON	709 – 737
14	14	MENU DOWN switch ON	315 – 327
		MENU UP switch ON	119 – 123
		SOURCE switch ON	0
		VOL DOWN switch ON	0
15		VOL UP switch ON	119 – 123
		switch ON	315 – 327

STEERING SWITCH SIGNAL B CIRCUIT (TEL ADAPTER UNIT TO AUDIO UNIT) [BOSE AUDIO WITHOUT NAVIGATION]

< DTC/CIRCUIT DIAGNOSIS >

STEERING SWITCH SIGNAL B CIRCUIT (TEL ADAPTER UNIT TO AUDIO UNIT)

Description INFOID:0000000008195244

- Transmits the steering switch signal to audio unit.
- Transmits the steering switch signal to audio unit through TEL adapter unit.

Diagnosis Procedure

CHECK STEERING SWITCH SIGNAL B CIRCUIT

- Turn ignition switch OFF.
- Disconnect audio unit connector and TEL adapter unit connector.
- Check continuity between audio unit harness connector and TEL adapter unit harness connector.

Audi	o unit	TEL adapter unit		Continuity
Connector	Terminal	Connector	Terminal	Continuity
M81	16	B237	18	Existed

Check continuity between audio unit harness connector and ground.

Audio unit			Continuity
Connector	Terminal	Ground	Continuity
M81	16		Not existed

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK TEL ADAPTER UNIT POWER SUPPLY

Check TEL adapter unit power supply.

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace TEL adapter unit. Refer to AV-118, "Removal and Installation".

3.CHECK AUDIO UNIT VOLTAGE

- 1. Connect audio unit connector and TEL adapter unit connector.
- 2. Turn ignition switch ON.
- Check voltage between audio unit harness connector.

(+)		(–)		
Audi	o unit	Audio unit		Voltage (Approx.)
Connector	Terminal	Connector	Terminal	(, 44, 2,)
M81	16	M81	15	5.0 V

Is the inspection result normal?

YES >> GO TO 4.

NO >> Replace audio unit. Refer to AV-106, "Removal and Installation".

4. CHECK STEERING SWITCH

- Turn ignition switch OFF.
- Check steering switch. Refer to AV-66, "Component Inspection".

Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace steering switch. Refer to AV-117, "Removal and Installation".

AV-65

2013 370Z

INFOID:0000000008195245

D

Е

F

K

ΑV

Р

Revision: 2012 August


STEERING SWITCH SIGNAL B CIRCUIT (TEL ADAPTER UNIT TO AUDIO UNIT) [BOSE AUDIO WITHOUT NAVIGATION]

< DTC/CIRCUIT DIAGNOSIS >

Component Inspection

INFOID:0000000008195246

Measure the resistance between the steering switch connector.

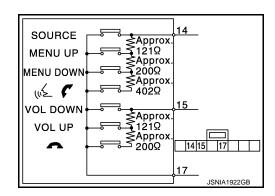

Standard

Steering switch		Condition	Resistance	
Terminal	Terminal	Condition	Ω	
	14	w≨ € switch ON	709 – 737	
14		MENU DOWN switch ON	315 – 327	
	4-7	MENU UP switch ON	119 – 123	
	17	SOURCE switch ON	0	
	1	VOL DOWN switch ON	0	
15		VOL UP switch ON	119 – 123	
		switch ON	315 – 327	

STEERING SWITCH SIGNAL GND CIRCUIT (TEL ADAPTER UNIT TO AUDIO UNIT)

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

STEERING SWITCH SIGNAL GND CIRCUIT (TEL ADAPTER UNIT TO AU-DIO UNIT)

Description INFOID:0000000008195247

- Transmits the steering switch signal to audio unit.
- Transmits the steering switch signal to audio unit through TEL adapter unit.

Diagnosis Procedure

1. CHECK STEERING SWITCH SIGNAL GND CIRCUIT

- Turn ignition switch OFF.
- Disconnect audio unit connector and TEL adapter unit connector. 2.
- Check continuity between audio unit harness connector and TEL adapter unit harness connector.

Audi	o unit	TEL ada	apter unit	Continuity
Connector	Terminal	Connector Terminal		Continuity
M81	15	B237	19	Existed

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK GROUND CIRCUIT

- Connect audio unit connector.
- Check continuity between audio unit harness connector and ground.

Audi	o unit		Continuity
Connector	Terminal	Ground	Continuity
M81	15		Existed

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace audio unit. Refer to AV-106, "Removal and Installation".

3.CHECK STEERING SWITCH

Check steering switch. Refer to AV-67, "Component Inspection".


Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace steering switch. Refer to AV-117, "Removal and Installation".

Component Inspection

Measure the resistance between the steering switch connector.

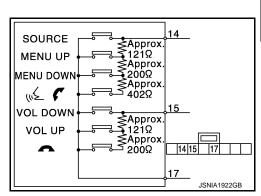

В

INFOID:0000000008195248

Е

D

F

K

M

INFOID:0000000008195249

ΑV

Р

STEERING SWITCH SIGNAL GND CIRCUIT (TEL ADAPTER UNIT TO AUDIO UNIT)

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

Standard

Steering switch		Condition	Resistance
Terminal	Terminal	Condition	Ω
	14	w≨ € switch ON	709 – 737
14		MENU DOWN switch ON	315 – 327
	4	MENU UP switch ON	119 – 123
	17	SOURCE switch ON	0
		VOL DOWN switch ON	0
15		MENU UP switch ON 119 – 12 SOURCE switch ON 0 VOL DOWN switch ON 0 VOL UP switch ON 119 – 12	119 – 123
		switch ON	315 – 327

COMMUNICATION SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

COMMUNICATION SIGNAL CIRCUIT

Description INFOID:0000000008195259

Satellite radio tuner and audio unit are connected with a serial communication. They transmit the operation signal from audio unit to satellite radio tuner.

Diagnosis Procedure

INFOID:0000000008195260

Α

D

Е

1. CHECK CONTINUITY COMMUNICATION SIGNAL (AUDIO-SAT) CIRCUIT

- Turn ignition switch OFF.
- 2. Disconnect satellite radio tuner connector and audio unit connector.
- Check continuity between satellite radio tuner harness connector and audio unit harness connector.

Satellite radio tuner		Audio unit		Continuity
Connector	Terminal	Connector Terminal		Continuity
B236	9	M83	39	Existed
D230	10	IVIOS	40	Existed

Check continuity between satellite radio tuner harness connector and ground.

Satellite radio tuner			Continuity
Connector	Terminal	Ground	Continuity
B236	9	Giodila	Not existed
	10		Not existed

Is inspection result OK?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK AUDIO UNIT

- Connect audio unit connector.
- Turn ignition switch ON. 2.
- Check voltage between audio unit harness connector and ground.

Audio unit			Voltage
Connector	Terminal	Ground	(Approx.)
M83	39		4.0 V

Is inspection result OK?

YES >> GO TO 3.

NO >> Replace audio unit. Refer to AV-106, "Removal and Installation".

3.CHECK SATELLITE RADIO TUNER

- Turn ignition switch OFF.
- 2. Disconnect audio unit connector, and connect satellite radio tuner connector.
- 3. Turn ignition switch ON.
- Check voltage between satellite radio tuner harness connector and ground.

Satellite radio tuner			Voltage
Connector	Terminal	Ground	(Approx)
B236	10		7.5 V

Is inspection result OK?

YES >> GO TO 4.

>> Replace satellite radio tuner. Refer to AV-115, "Removal and Installation". NO

AV-69 Revision: 2012 August 2013 370Z

ΑV

COMMUNICATION SIGNAL CIRCUIT

[BOSE AUDIO WITHOUT NAVIGATION]

< DTC/CIRCUIT DIAGNOSIS >

4. CHECK COMMUNICATION SIGNAL (SAT-AUDIO)

- 1. Turn ignition switch OFF.
- 2. Connect audio unit connector.
- 3. Turn ignition switch ON.
- 4. Check signal between satellite radio tuner harness connector and ground.

Satellite r	adio tuner		Condition	Reference value
Connector	Terminal		Condition	Reference value
B236	9	Ground	When satellite radio mode is selected.	(V) 6 4 2 0 • • • 1ms

Is inspection result OK?

YES >> GO TO 5.

NO >> Replace satellite radio tuner. Refer to AV-115, "Removal and Installation".

5. CHECK COMMUNICATION SIGNAL (AUDIO-SAT)

Check signal between audio unit harness connector and ground.

Audi	o unit		Condition	Reference value
Connector	Terminal		Condition	receivance value
B83	40	Ground	When satellite radio mode is selected.	(V) 10 0 -10 + 1ms SKIA9301J

Is inspection result OK?

YES >> INSPECTION END

NO >> Replace audio unit. Refer to AV-106, "Removal and Installation".

REQUEST SIGNAL CIRCUIT (SAT TO AUDIO)

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

REQUEST SIGNAL CIRCUIT (SAT TO AUDIO)

Description INFOID:0000000008195261

Request signal transmits the signal to recognize the connection of satellite radio tuner from satellite radio tuner to audio unit.

Diagnosis Procedure

INFOID:0000000008195262

Α

D

Е

F

1. CHECK CONTINUITY REQUEST SIGNAL CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect satellite radio tuner connector and audio unit connector.
- 3. Check continuity between satellite radio tuner unit harness connector and audio unit harness connector.

Satellite r	Satellite radio tuner		o unit	Continuity
Connector	Terminal	Connector Terminal		Continuity
B236	8	M83	38	Existed

4. Check continuity between satellite radio tuner harness connector and ground.

Satellite radio tuner			Continuity
Connector	Terminal	Ground	Continuity
B236	8		Not existed

Is inspection result OK?

YES >> GO TO 2.

NO >> Repair harness or connector.

2. CHECK AUDIO UNIT

- 1. Connect audio unit connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between audio unit harness connector and ground.

Audio unit			Voltage
Connector	Terminal	Ground	(Approx.)
M83	38		4.0 V

Is inspection result OK?

YES >> GO TO 3.

NO >> Replace audio unit. Refer to AV-106, "Removal and Installation".

3.CHECK CONTINUITY REQUEST SIGNAL

- Turn ignition switch OFF.
- 2. Connect satellite radio tuner connector.
- Turn ignition switch ON.
- 4. Check signal between satellite radio tuner harness connector and ground.

Satellite radio tuner			Condition	Deference value
Connector	Terminal	1	Condition	Reference value
B236	8	Ground	When satellite radio mode is selected.	(V) + 100ms JSNIA0675ZZ

Revision: 2012 August AV-71 2013 370Z

W

M

0

Р

REQUEST SIGNAL CIRCUIT (SAT TO AUDIO)

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

Is inspection result OK?

YES >> INSPECTION END

NO >> Replace satellite radio tuner. Refer to AV-115, "Removal and Installation".

BOSE AMP. ON SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

BOSE AMP. ON SIGNAL CIRCUIT

Description INFOID:0000000008195263

When the audio system is turned on, a voltage signal is supplied from the audio unit to the BOSE amp. When this signal is received, the BOSE amp. will turn on.

Diagnosis Procedure

INFOID:0000000008195264

Α

D

Е

1. CHECK CONTINUITY AMP. ON SIGNAL CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect audio unit connector and BOSE amp. connector.
- 3. Check continuity between audio unit harness connector and BOSE amp. harness connector.

Audi	o unit	BOSE	E amp.	Continuity	
Connector	ector Terminal Connector		Terminal	Continuity	
M81	1	B41	31	Existed	

4. Check continuity between audio unit harness connector and ground.

Audi	o unit		Continuity	
Connector	Terminal	Ground	Continuity	
M81	1		Not existed	

Is inspection result OK?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK VOLTAGE AMP. ON SIGNAL

- Connect audio unit connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between audio unit harness connector and ground.

Audi	o unit		Voltage	
Connector	Terminal	Ground	(Approx.)	
M81	1		12.0 V	

Is inspection result OK?

YES >> Replace BOSE amp. Refer to <u>AV-112</u>, "<u>COUPE</u>: <u>Removal and Installation</u>" (coupe models), <u>AV-112</u>, "<u>ROADSTER</u>: <u>Removal and Installation</u>" (roadster models).

NO >> Replace audio unit. Refer to AV-106, "Removal and Installation".

۸۱/

M

C

Р

MICROPHONE SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

MICROPHONE SIGNAL CIRCUIT

Description INFOID:000000008195265

TEL adapter unit supplies power to microphone. The microphone transmits the sound voice to the TEL adapter unit.

Diagnosis Procedure

INFOID:0000000008195266

1.CHECK CONTINUITY BETWEEN TEL ADAPTER UNIT AND MICROPHONE CIRCUIT

- Turn ignition switch OFF.
- 2. Disconnect TEL adapter unit connector and microphone connector.
- 3. Check continuity between TEL adapter unit harness connector and microphone harness connector.

TEL ada	apter unit	Micro	phone	Continuity
Connector	Terminal	Connector	Terminal	Continuity
	7		1	
B237	8	R5	2	Existed
	29		4	

4. Check continuity between TEL adapter unit harness connector and ground.

TEL ada	apter unit		Continuity	
Connector	Terminal	Ground	Continuity	
B237	7	Giodila	Not existed	
D231	29		inot existed	

Is inspection result OK?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK MICROPHONE POWER SUPPLY

- Connect TEL adapter unit connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between TEL adapter unit harness connector and ground.

TEL ada	apter unit		Voltage
Connector	Terminal	Ground	(Approx.)
B237	29		5.0 V

Is inspection result OK?

YES >> GO TO 3.

NO >> Replace TEL adapter unit. Refer to AV-118, "Removal and Installation".

3.check microphone signal

- 1. Turn ignition switch OFF.
- 2. Connect microphone connector.
- 3. Turn ignition switch ON.
- 4. Check signal between TEL adapter unit harness connector.

MICROPHONE SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

TEL adapter unit		TEL adapter unit		Condition	Deference value	
Connector	Terminal	Connector	Terminal	Condition	Reference value	
B237	7	B237	8	Give a voice.	(V) 1 0 -1 → 2ms SKIB3609E	

Is inspection result OK?

YES >> INSPECTION END

NO >> Replace microphone. Refer to AV-119, "Removal and Installation".

Α

В

С

D

Е

F

G

Н

1

K

L

M

ΑV

0

Р

TELEPHONE ON SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

TELEPHONE ON SIGNAL CIRCUIT

Description INFOID:000000008195267

When telephone is being used. TEL adapter unit transmits telephone ON signal to audio unit.

Diagnosis Procedure

INFOID:0000000008195268

1. CHECK CONTINUITY TELEPHONE ON SIGNAL CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect TEL adapter unit connector and audio unit connector.
- 3. Check continuity between TEL adapter unit harness connector and audio unit harness connector.

TEL ada	apter unit	Audi	o unit	Continuity	
Connector	Terminal	Connector	Terminal	Continuity	
B237	11	M82	28	Existed	

4. Check continuity between TEL adapter unit harness connector and ground.

TEL ada	apter unit		Continuity
Connector	Terminal	Ground	Continuity
B237	11		Not existed

Is inspection result OK?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK TELEPHONE ON SIGNAL

- 1. Connect audio unit connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between audio unit harness connector and ground.

Audio unit			Condition	Voltage
Connector	Terminal			(Approx.)
M82	28	Ground	While using hands-free phone system	0 V
			While not using hands-free phone system	5.0 V

Is inspection result OK?

YES >> INSPECTION END

NO >> Replace audio unit. Refer to AV-106. "Removal and Installation".

Α

C

D

Е

F

G

Н

K

L

M

ΑV

0


Р

ECU DIAGNOSIS INFORMATION

AUDIO UNIT

Reference Value

TERMINAL LAYOUT

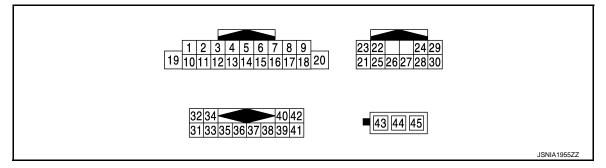

PHYSICAL VALUES

	minal e color)	Description			Condition	Reference value	
+	_	Signal name	Input/ Output	Condition		(Approx.)	
1 (V)	Ground	BOSE amp. ON signal	Output	Ignition switch ON	_	12.0 V	
2 (LG)	3 (V)	Sound signal front speaker LH	Output	Ignition switch ON	Sound signal output	(V) 1 0 -1 → 2ms SKIB3609E	
4 (L)	5 (R)	Sound signal rear speaker LH	Output	Ignition switch ON	Sound signal output	(V) 1 0 -1 → 2ms SKiB3609E	
					Keep pressing SOURCE switch	0 V	
				Ignition	Keep pressing MENU UP switch	1.25 V	
6 (W) (B)	Steering switch signal A	Input	switch ON	Keep pressing MENU DOWN switch	2.5 V		
				Keep pressing w≨ € switch	3.7 V		
					Except for above	5.0 V	
7 (L)	Ground	ACC power supply	Input	Ignition switch ACC	_	Battery voltage	

AUDIO UNIT

	minal color)	Description			Condition	Reference value		
+	_	Signal name	Input/ Output		Condition	(Approx.)		
9	8			Ignition	Lighting switch is OFF.	0 V		
(R)	(W)	Illumination signal	Input	switch OFF	Lighting switch is 1ST or 2ND.	12.0 V		
10	_	Shield	_		_	_		
11 (L)	12 (P)	Sound signal front speaker RH	Output	Ignition switch ON	Sound signal output	(V) 1 0 -1 + 2ms SKIB3609E		
13 (R)	14 (G)	Sound signal rear speaker RH	Output	Ignition switch ON	Sound signal output	(V) 1 0 -1 + 2ms SKiB3609E		
					Keep pressing VOL DOWN switch	0 V		
16 (GR)	15 (B)	Steering switch signal B	Input	Ignition switch	Keep pressing VOL UP switch	1.25 V		
				ON	Keep pressing switch	2.5 V		
					Except for above.	5.0 V NOTE: The maximum voltage varies depending on the specification (destination unit).		
18 (Y)	Ground	Vehicle speed signal (8-pulse)	Input	Ignition switch ON	When vehicle speed is approx. 40 km/h (25MPH)	0 20 ms JSNIA0012GB		
19 (Y)	Ground	Battery power supply	Input	Ignition switch OFF	_	Battery voltage		
20	_	Shield	_	_	_	_		
21 (R)	_	AV communication signal (H)	_	Input/ Output	_	_		
22 (G)	_	AV communication signal (L)	_	Input/ Output	_	_		
25	_	Shield	_	_	_	_		
-			-					

AUDIO UNIT

	minal e color)	Description	Description		Condition	Reference value
+	_	Signal name	Input/ Output		Condition	(Approx.)
26 (LG)	27 (V)	Sound signal (Telephone voice, tele- phone guidance)	Input	Ignition switch ON	Give a voice	(V) 1 0 -1 + 2ms SKIB3609E
28	Ground	Telephone ON signal	Input	Ignition switch	While using hands-free phone system	0 V
(O)	Ground	relephone ON signal	iliput	ON	While not using hands-free phone system	5.0 V
32 (B)	31 (W)	Satellite radio sound signal LH	Input	Ignition switch ON	When satellite radio mode is selected	(V) 1 0 -1 + 2ms SKIB3609E
34 (G)	33 (R)	Satellite radio sound signal RH	Input	Ignition switch ON	When satellite radio mode is selected	(V) 1 0 -1 + 2ms SKIB3609E
35	_	Shield	_	_	-	-
36	_	Shield	_	_	_	_
38 (P) ^{*1} (Y) ^{*2}	Ground	Request signal (SAT TO AUDIO)	Input	Ignition switch ON	When satellite radio mode is selected	(V) 4 0 + 100ms JSNIA0675ZZ
39 (G)	Ground	Communication signal (SAT-AUDIO)	Input	Ignition switch ON	When satellite radio mode is selected	(V) 6 4 2 0 1ms PKIBS039J
40 (L)	Ground	Communication signal (AUDIO-SAT)	Output	Ignition switch ON	When satellite radio mode is selected	(V) 10 0 -10 + 1ms SKIA9301J

AUDIO UNIT

< ECU DIAGNOSIS INFORMATION >

	minal e color)	Description			Condition	Reference value
+	_	Signal name	Input/ Output	Condition		(Approx.)
43	Ground	Antenna amp. ON signal	Output	Ignition switch ON	_	12.0 V
44	_	Antenna signal	Input	_	_	_

^{*1:} Coupe models
*2: Roadster models

BOSE AMP.

COUPE

COUPE: Reference Value

INFOID:0000000008195270

Α

В

C

D

Е

F

G

Н

K

L


M

AV

0

Р

TERMINAL LAYOUT

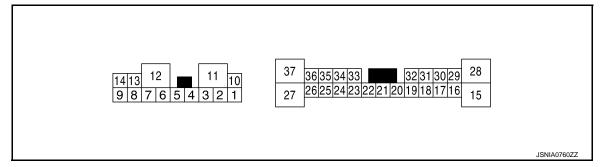

PHYSICAL VALUES

				T.			
	minal color)	Description			Condition	Reference value	
+	_	Signal name	Input/ Output	Condition		(Approx.)	
1 (L)	10 (V)	Sound signal front door speaker LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E	
2 (BG)	3 (G)	Sound signal front door speaker RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E	
4 (SB)	5 (V)	Sound signal woofer	Output	Ignition switch ON	Voice output	(V) 1 0 -1 → +2ms SKIB3609E	
6 (LG)	7 (GR)	Sound signal tweeter LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E	

Teri	minal e color)	Description			[JGGZ/GJ/G	D-f
+	-	Signal name	Input/ Output		Condition	Reference value (Approx.)
9 (R)	14 (BR)	Sound signal rear speaker RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E
11 (Y)	Ground	Battery power supply	Input	Ignition switch OFF	_	Battery voltage
12 (B)	Ground	Ground	_	Ignition switch ON	_	0 V
15 (L)	28 (P)	Sound signal rear speaker LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E
18 (P)	32 (L)	Sound signal front LH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E
19 (R)	20 (G)	Sound signal front RH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E
21 (V)	22 (SB)	Sound signal rear LH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E
23 (BR)	33 (Y)	Sound signal rear RH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E

BOSE AMP.

< ECU DIAGNOSIS INFORMATION >

[BOSE AUDIO WITHOUT NAVIGATION]

	minal color)	Description			Condition	Reference value
+	_	Signal name	Input/ Output	Condition		(Approx.)
31 (W)	Ground	BOSE amp. ON signal	Input	Ignition switch ACC	_	12.0 V
37 (B)	27 (W)	Sound signal tweeter RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E

ROADSTER

ROADSTER: Reference Value

INFOID:0000000008195271

Α

В


D

Е

G

Н

TERMINAL LAYOUT

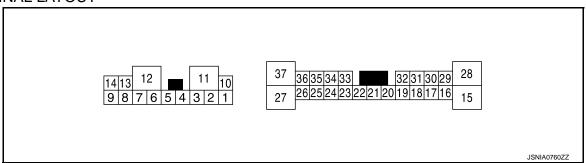

PHYSICAL VALUES

	minal e color)	Description			Condition	Reference value
+	_	Signal name	Input/ Output			(Approx.)
1 (L)	10 (V)	Sound signal rear woofer LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E
2 (LG)	3 (Y)	Sound signal rear woofer RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 *** 2ms SKIB3609E

	minal color)	Description			O an distant	Reference value
+	_	Signal name	Input/ Output		Condition	(Approx.)
4 (L)	5 (V)	Sound signal front door speaker LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E
6 (LG)	7 (GR)	Sound signal tweeter LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E
8 (BG)	13 (G)	Sound signal front door speaker RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E
9 (LG)	14 (Y)	Sound signal rear speaker RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 2ms SKIB3609E
11 (Y)	Ground	Battery power supply	Input	Ignition switch OFF	_	Battery voltage
12 (B)	Ground	Ground	_	Ignition switch ON	_	0 V
15 (L)	28 (P)	Sound signal rear speaker LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E
17 (R)	Ground	Roof status signal (AUDIO)	Input	Ignition switch ON	Retractable soft top fully open Retractable soft top other	Battery voltage
				ON	than above	0 V

BOSE AMP.

< ECU DIAGNOSIS INFORMATION >

[BOSE AUDIO WITHOUT NAVIGATION]

	minal e color)	Description			Condition	Reference value	
+	_	Signal name	Input/ Output			(Approx.)	
18 (P)	32 (L)	Sound signal front LH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E	
19 (R)	20 (G)	Sound signal front RH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E	
21 (V)	22 (SB)	Sound signal rear LH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 2ms SKIB3609E	
23 (BR)	33 (Y)	Sound signal rear RH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E	
31 (W)	Ground	BOSE amp. ON signal	Input	Ignition switch ACC	_	12.0 V	
37 (B)	27 (W)	Sound signal tweeter RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 ** 2ms SKIB3609E	

A

В

С

D

Е

F

G

Н

Κ

L


 \mathbb{N}

Ρ

SATELLITE RADIO TUNER

Reference Value

TERMINAL LAYOUT

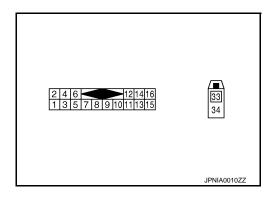

PHYSICAL VALUES

Teri	minal	Description				Reference value
+	_	Signal name	Input/ Output		Condition	(Approx.)
2 (R)	1 (G)	Satellite radio sound signal LH	Output	Ignition switch ON	When satellite radio mode is selected	(V) 1 0 -1 → + 2ms SKIB3609E
4 (B)	3 (W)	Satellite radio sound signal RH	Output	Ignition switch ON	When satellite radio mode is selected	(V) 1 0 -1 + 2ms SKIB3609E
5	_	Shield	_	_	_	_
6	_	Shield		_	_	_
8 (Y)	Ground	Request signal (SAT TO AUDIO)	Output	Ignition switch ON	When satellite radio mode is selected	(V) 10 0 -10 → +10ms SKIA9299J
9 (O)	Ground	Communication signal (SAT→AUDIO)	Output	Ignition switch ON	When satellite radio mode is selected	(V) 6 4 2 0 + 1ms PKIB5039J

SATELLITE RADIO TUNER

< ECU DIAGNOSIS INFORMATION >

[BOSE AUDIO WITHOUT NAVIGATION]

Teri	minal	Description				Reference value
+	_	Signal name	Input/ Output	Condition		(Approx.)
10 (BR)	Ground	Communication signal (AUDIO→SAT)	Input	Ignition switch ON	When satellite radio mode is selected	(V) 10 0 -10 + 1ms SKIA9301J
12 (SB)	Ground	Battery power supply	Input	Ignition switch OFF	_	Battery voltage
16 (V)	Ground	ACC power supply	Input	Ignition switch ACC	_	Battery voltage
33	_	Satellite radio antenna sig- nal	Input	_	_	_
34	_	Shield	_	_	_	_

Н

Α

В

С

D

Е

F

|

J

K

L

 \mathbb{N}

ΑV

 
0


P

TEL ADAPTER UNIT

Reference Value

INFOID:0000000008195273



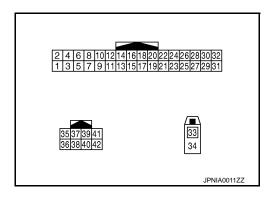

PHYSICAL VALUES

	minal color)	Description			Condition	Reference value
+	_	Signal name	Input/ Output		Condition	(Approx.)
1 (Y)	Ground	Battery power supply	Input	Ignition switch OFF	_	Battery voltage
2 (V)	Ground	ACC power supply	Input	Ignition switch ACC	_	Battery voltage
3 (SB)	Ground	Ignition signal	Input	Ignition switch ON	_	Battery voltage
4 (B)	Ground	Ground	_	Ignition switch ON	_	0 V
7 (L)	8	Microphone signal	Input	Ignition switch ON	Give a voice	(V) 1 0 -1 + 2ms SKIB3609E
8	_	Shield (microphone signal ground)	_	_	_	_
9 (BR)	10 (Y)	Sound signal (Telephone voice, tele- phone guidance)	Output	Ignition switch ON	During voice guide output with the w≤ switch pressed	(V) 1 0 -1 + 2ms SKIB3609E
11 (BG)	Ground	Telephone on signal	Output	Ignition switch	While using hands-free phone system	0 V
(50)				ON	While not using hands-free phone system	5.0 V

TEL ADAPTER UNIT

< ECU DIAGNOSIS INFORMATION >

[BOSE AUDIO WITHOUT NAVIGATION]

	minal e color)	Description			Condition	Reference value
+	_	Signal name	Input/ Output		Condition	(Approx.)
					Keep pressing SOURCE switch	0 V
				Ignition	Keep pressing MENU UP switch	1.25 V
12 (P)	14 (B)	Steering switch signal A (input)	Input	switch ON	Keep pressing MENU DOWN switch	2.5 V
					Keep pressing ò C switch	3.7 V
				Except for above	5.0 V	
					Keep pressing VOL DOWN switch	0 V
13 (L)	14 (B)	Steering switch signal B (input)	Input	Input switch ON	Keep pressing VOL UP switch	1.25 V
` '				ON	Keep pressing A switch	2.5 V
					Except for above.	5.0 V
14 (B)	Ground	Steering switch signal ground	_	Ignition switch ON	_	0 V
16	6 Ground Roof status signal (AUDIO) Inpu	Innut	Ignition	Retractable soft top fully open	Battery voltage	
(R)	Glound	Roof status signal (AUDIO)	mput	Input switch ON	Retractable soft top other than above	0 V
		Steering switch signal A (output)	Output	Ignition switch	Keep pressing SOURCE switch	0 V
					Keep pressing MENU UP switch	1.25 V
17 (W)	19 (B)				Keep pressing MENU DOWN switch	2.5 V
					Keep pressing √∠ ✓ switch	3.7 V
					Except for above	5.0 V
					Keep pressing VOL DOWN switch	0 V
18 (GR)	19 (B)	Steering switch signal B (output)	Output	Ignition switch	Keep pressing VOL UP switch	1.25 V
, ,		,		ON	Keep pressing A switch	2.5 V
					Except for above.	5.0 V
20 (L)*1 (B)*2	Ground	Control signal	_	Ignition switch ON	_	0 V
22 (P) ^{*1} (B) ^{*2}	Ground	Control signal	_	Ignition switch ON	_	0 V
23 (B)	Ground	Control signal	_	Ignition switch ON	_	0 V

TEL ADAPTER UNIT

	minal color)	Description	cription		Reference value		
+	_	Signal name	Input/ Output	Condition		(Approx.)	
24 (W)	Ground	Control signal	_	Ignition switch ON	_	0 V	
28 (V)	Ground	Vehicle speed signal (8-pulse)	Input	Ignition switch ON	When vehicle speed is approx. 40 km/h (25 MPH)	NOTE: The maximum voltage varies depending on the specification (destination unit).	
29 (P)	Ground	Microphone power supply	Output	Ignition switch ON	_	5.0 V	
33	_	TEL antenna signal	Input	_	Not connected to TEL antenna connector	5.0 V	
34	_	Shield	_		_	_	
35 (R)	_	AV communication signal (H)	Input/ Output	_	_	_	
36 (G)	_	AV communication signal (L)	Input/ Output	_	_	_	
39 (L)	_	AV communication signal (H)	Input/ Output	_	_	_	
40 (L)	_	AV communication signal (H)	Input/ Output	_	_	_	
41 (Y)	_	AV communication signal (L)	Input/ Output	_	_	_	
42 (Y)	_	AV communication signal (L)	Input/ Output	_	_	_	

^{*1:} Coupe models

^{*2:} Roadster models

Α

В

C

D

Е

F

Н

K

L

M

ΑV

0

Ρ

INFOID:0000000008195274


WIRING DIAGRAM


BOSE AUDIO WITHOUT NAVIGATION

Wiring Diagram - BOSE AUDIO WITHOUT NAVIGATION SYSTEM -


For connector terminal arrangements, harness layouts, and alphabets in a (option abbreviation; if not described in wiring diagram), refer to GL 12. "Connector Information"

described in wiring diagram), refer to GI-12, "Connector Information".

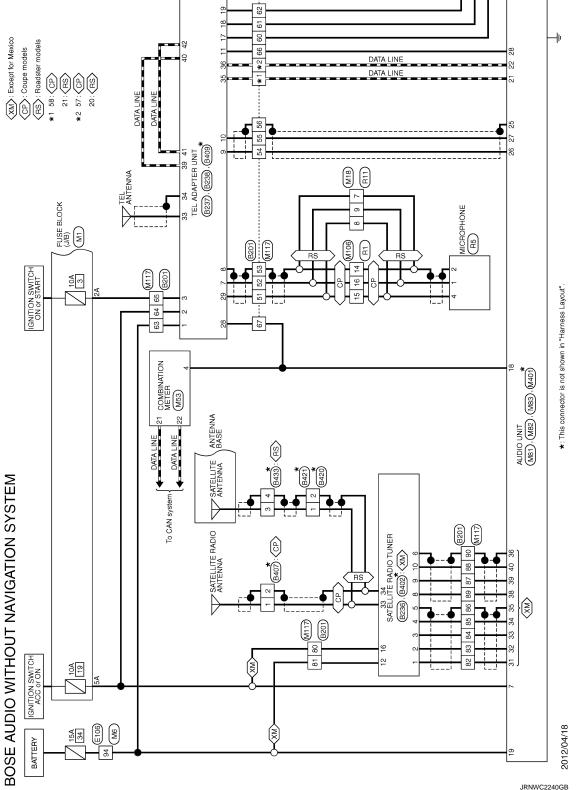


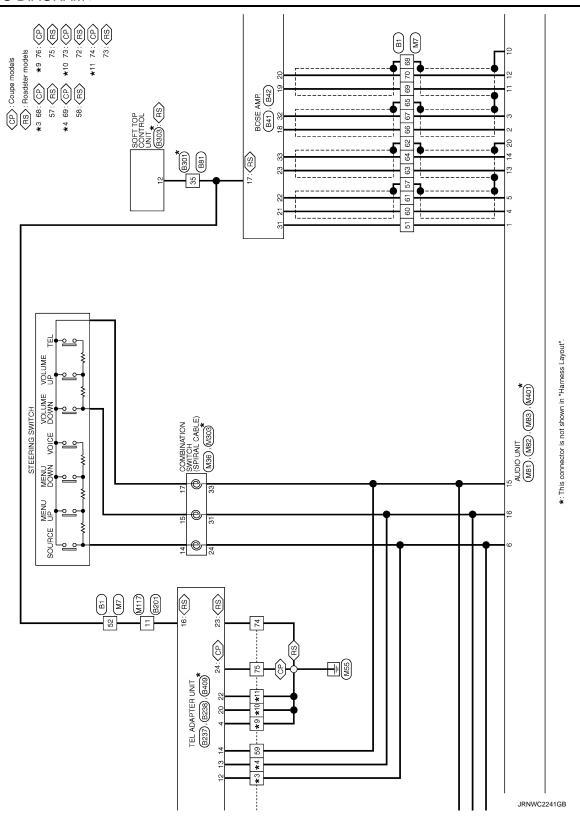

BOSE AUDIO WITHOUT NAVIGATION

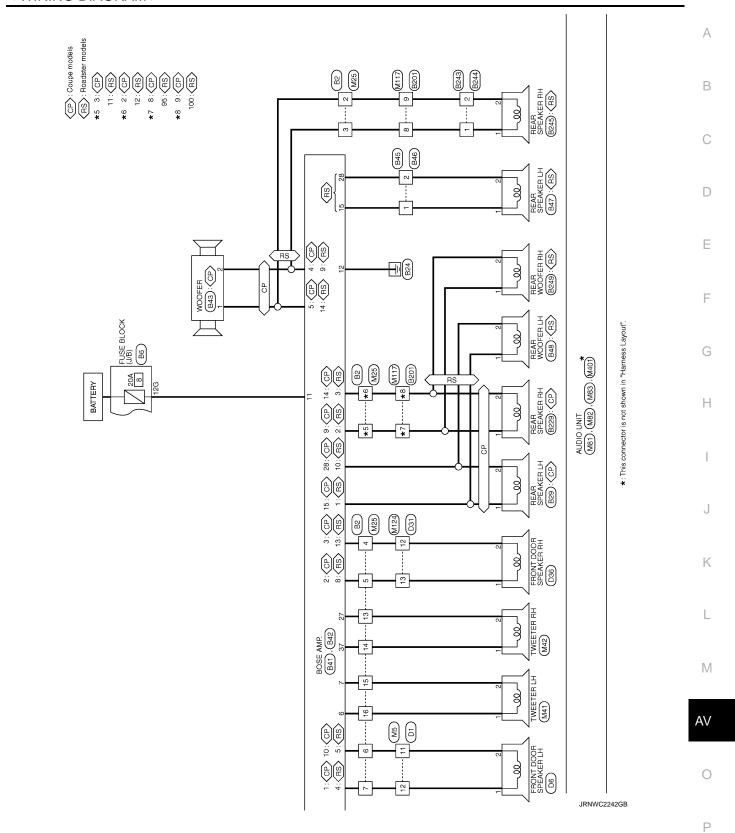



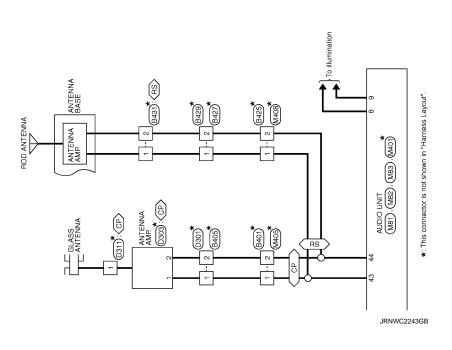

AUDIO SYSTEM SYMPTOMS

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

Α

В

C

INFOID:0000000008195275

SYMPTOM DIAGNOSIS

AUDIO SYSTEM SYMPTOMS

Symptom Table

AUDIO SYSTEM

Coupe Models

Symptoms	Check items	Possible malfunction location / Action to take
Audio unit does not start.	_	Audio unit power supply and ground circuit. Refer to AV-54, "AUDIO UNIT: Diagnosis Procedure".
	No sound from all speakers.	 BOSE amp. power supply and ground circuit. Refer to AV-54, "BOSE AMP.: Diagnosis Procedure". BOSE amp. ON signal circuit. Refer to AV-73, "Diagnosis Procedure".
	Sound is not heard from woofer.	Sound signal (woofer) circuit malfunction.
No sound comes out.	Only a certain speaker (front right, front left, rear right, or rear left) does not output sound.	 Poor connector connection of speaker. Sound signal circuit malfunction between audio unit and BOSE amp. Sound signal circuit malfunction between BOSE amp. and speaker. Malfunction in speaker. Malfunction in audio unit. Malfunction in BOSE amp.
	Noise comes out from all speaker.	Malfunction in audio unit. Malfunction in BOSE amp.
Noise is mixed with audio.	Noise comes out only from a certain speaker (front right, front left, rear right, or rear left).	 Poor connector connection of speaker. Sound signal circuit malfunction between audio unit and speaker. Sound signal circuit malfunction between BOSE amp. and speaker. Malfunction in speaker. Poor installation of speaker (e.g. backlash and looseness) Malfunction in audio unit. Malfunction in BOSE amp.
	Noise is mixed with radio only (when the car hits a bump or while driving over bad roads).	Poor connector connection of antenna or antenna feeder.
Radio is not received or poor reception.	Other audio sounds are normal. Any radio cannot be received or poor reception is caused even after moving to a service area with good reception (e.g. a place with clear view and no obstacles generating external noises).	 Antenna amp. ON signal circuit malfunction. Poor connector connection of antenna or antenna feeder.
	It change to satellite radio mode.	Sound signal circuit malfunction between satellite radio tuner and audio unit. Poor connector connection of satellite radio tuner. Loose satellite radio antenna mounting nut. Refer to AV-116, "Exploded View".
Satellite radio is not received.	It does not change to satellite radio mode.	Satellite radio tuner power supply and ground circuit. Refer to AV-55, "SATELLITE RADIO TUNER: Diagnosis Procedure". Request signal or communication signal circuit malfunction. Refer to AV-86, "Reference Value".

Roadster Models

AUDIO SYSTEM SYMPTOMS

[BOSE AUDIO WITHOUT NAVIGATION]

Symptoms	Check items	Possible malfunction location / Action to take
Audio unit does not start.	_	Audio unit power supply and ground circuit. Refer to AV-54, "AUDIO UNIT: Diagnosis Procedure".
	No sound from all speakers.	 BOSE amp. power supply and ground circuit. Refer to <u>AV-54</u>, "BOSE <u>AMP</u>.: <u>Diagnosis Procedure</u>". BOSE amp. ON signal circuit. Refer to <u>AV-73</u>. "<u>Diagnosis Procedure</u>".
	Sound is not heard from rear woofer.	Sound signal (woofer) circuit malfunction.
No sound comes out.	Only a certain speaker (front right, front left, rear right, or rear left) does not output sound.	 Poor connector connection of speaker. Sound signal circuit malfunction between audio unit and BOSE amp. Sound signal circuit malfunction between BOSE amp. and speaker. Malfunction in speaker. Malfunction in audio unit. Malfunction in BOSE amp.
	Noise comes out from all speaker.	Malfunction in audio unit. Malfunction in BOSE amp.
Noise is mixed with audio.	Noise comes out only from a certain speaker (front right, front left, rear right, or rear left).	 Poor connector connection of speaker. Sound signal circuit malfunction between audio unit and speaker. Sound signal circuit malfunction between BOSE amp. and speaker. Malfunction in speaker. Poor installation of speaker (e.g. backlash and looseness) Malfunction in audio unit. Malfunction in BOSE amp.
	Noise is mixed with radio only (when the car hits a bump or while driving over bad roads).	 Poor connector connection of antenna or antenna feeder. Loose antenna base mounting nut. Refer to <u>AV-114, "Exploded View"</u>.
Radio is not received or poor reception.	Other audio sounds are normal. Any radio cannot be received or poor reception is caused even after moving to a service area with good reception (e.g. a place with clear view and no obstacles generating external noises).	 Antenna amp. ON signal circuit malfunction. Poor connector connection of antenna or antenna feeder. Loose antenna base mounting nut. Refer to <u>AV-114</u>, "<u>Exploded View</u>".
	It change to satellite radio mode.	 Sound signal circuit malfunction between satellite radio tuner and audio unit. Poor connector connection of satellite radio tuner. Loose antenna base mounting nut. Refer to <u>AV-114</u>, "<u>Exploded View</u>".
Satellite radio is not received.	It does not change to satellite radio mode.	 Satellite radio tuner power supply and ground circuit. Refer to <u>AV-55</u>, "<u>SATELLITE RADIO TUNER</u>: <u>Diagnosis Procedure</u>". Request signal or communication signal circuit malfunction. Refer to <u>AV-86</u>, "<u>Reference Value</u>".

RELATED TO STEERING SWITCH

Symptoms	Possible malfunction location / Action to take
All steering switches are not operated.	Steering switch signal ground circuit. Refer to AV-61, "Diagnosis Procedure".
Only specified switch cannot be operated.	Steering switch

AUDIO SYSTEM SYMPTOMS

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

" " " " " " " " " " " " " " " " " " "	th to TEL adapter unit).
"A", "VOL UP" and "VOL DOWN" switches are not operated. Steering switch signal B circuit (steering switch Refer to AV-59, "Diagnosis Procedure".	ch to TEL adapter unit).

С

В

Α

D

Е

F

G

Н

1

Κ

L

 \mathbb{N}

ΑV

0

Р

HANDS-FREE PHONE SYMPTOMS

HANDS-FREE PHONE SYMPTOMS

Symptom Table

RELATED TO HANDS-FREE PHONE (EXCEPT FOR MEXICO)

- Before performing diagnosis, confirm that the cellular phone being used by the customer is compatible with the vehicle.
- It is possible that a malfunction is occurring due to a version change of the phone even though the phone is a compatible type. This can be confirmed by changing the cellular phone to another compatible type, and checking that it operates normally. It is important to determine whether the cause of the malfunction is the vehicle or the cellular phone.

Check Compatibility

- Make sure the customer's Bluetooth[®] related concern is understood.
- 2. Verify the customer's concern.

NOTE:

The customer's phone may be required, depending upon their concern.

3. Write down the customer's phone brand, model, and service provider.

NOTE:

It is necessary to know the service provider. On occasion, a given phone may be on the approved list with one provider, but may not be on the approved list with other providers.

- Go to "www.nissanusa.com/bluetooth/".
- Using the website's search engine, find out if the customer's phone is on the approved list.
- If the customer's phone is NOT on the approved list:
 Stop diagnosis here. The customer needs to obtain a Bluetooth[®] phone that is on the approved list before any further action.
- c. If the feature related to the customer's concern shows as "N" (not compatible): Stop diagnosis here. If the customer still wants the feature to function, they will need to get an approved phone showing the feature as "Y" (compatible) in the "Basic Features" list.
- d. If the feature related to the customer's concern shows as "Y" (compatible): Perform diagnosis as per the following table.

Symptoms	Check items	Possible malfunction location/Action to take
Does not recognize cellular phone connection.	Repeat the registration of cellular phone.	TEL adapter unit
Hands-free phone cannot be	 Both the reception and the speech cannot be performed. Audio cannot be operated by steering switch. 	TEL adapter unit power supply and ground circuit. Refer to AV-55, "TEL ADAPTER UNIT : Diagnosis Procedure".
established.	 Both the reception and the speech cannot be performed. Audio can be operated by steering switch. 	Telephone ON signal circuit. Refer to AV-76, "Diagnosis Procedure".
The other party's voice cannot be heard by hands-free phone.	Audio system sound is normal.	Sound signal (telephone voice, telephone guidance) circuit
be fleatu by flatius-free priorie.	Audio system sound does not sound.	Refer to AV-95, "Symptom Table".
Originating sound is not heard	Sound operation function is normal.	TEL adapter unit
by the other party with hands- free phone communication.	Sound operation function does not work.	Microphone signal circuit. Refer to AV-74, "Diagnosis Procedure".
When hands-free phone is in use, the information (connection time etc.) is not displayed on the audio screen.	_	AV communication signal (H, L)

RELATED TO HANDS-FREE PHONE (FOR MEXICO)

HANDS-FREE PHONE SYMPTOMS

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITHOUT NAVIGATION]

Symptoms	Check items	Possible malfunction location/Action to take
Does not recognize cellular phone connection.	Repeat the registration of cellular phone.	TEL adapter unit
Hands-free phone cannot be	 Both the reception and the speech cannot be performed. Audio cannot be operated by steering switch. 	TEL adapter unit power supply and ground circuit. Refer to AV-55, "TEL ADAPTER UNIT : Diagnosis Procedure".
established.	 Both the reception and the speech cannot be performed. Audio can be operated by steering switch. 	Telephone ON signal circuit. Refer to AV-76, "Diagnosis Procedure".
The other party's voice cannot be heard by hands-free phone.	Audio system sound is normal.	Sound signal (telephone voice, telephone guidance) circuit
be fleatd by flatius-free priorie.	Audio system sound does not sound.	Refer to AV-95, "Symptom Table".
Originating sound is not heard	Sound operation function is normal.	TEL adapter unit
by the other party with hands- free phone communication.	Sound operation function does not work.	Microphone signal circuit. Refer to AV-74, "Diagnosis Procedure".
When hands-free phone is in use, the information (connection time etc.) is not displayed on the audio screen.	_	AV communication signal (H, L)

RELATED TO STEERING SWITCH

Symptoms	Possible malfunction location / Action to take	
All steering switches are not operated.	Steering switch signal ground circuit. Refer to AV-61, "Diagnosis Procedure".	
Only specified switch cannot be operated.	Steering switch	
" " " " " " " " " " " " "	 Steering switch signal A circuit (steering switch to TEL adapter unit). Refer to <u>AV-57</u>, "<u>Diagnosis Procedure</u>". Steering switch signal A circuit (TEL adapter unit to audio unit). Refer to <u>AV-63</u>, "<u>Diagnosis Procedure</u>". 	
"A", "VOL UP" and "VOL DOWN" switches are not operated.	 Steering switch signal B circuit (steering switch to TEL adapter unit). Refer to <u>AV-59</u>, "<u>Diagnosis Procedure</u>". Steering switch signal B circuit (TEL adapter unit to audio unit). Refer to <u>AV-65</u>, "<u>Diagnosis Procedure</u>". 	k

M

Α

В

D

Е

F

G

Н

AV

0

P

Revision: 2012 August **AV-99** 2013 370Z

NORMAL OPERATING CONDITION

Description INFOID:000000008195277

RELATED TO AUDIO

- The majority of the audio malfunctions are the result of outside causes (bad CD, electromagnetic interference, etc.). Check the symptoms below to diagnose the malfunction.
- The vehicle itself can be a source of noise if noise prevention parts or electrical equipment is malfunctioning. Check that noise is caused and/or changed by engine speed, ignition switch turned to each position, and operation of each piece of electrical equipment. Then determine the cause.

NOTE:

- CD-R is not guaranteed to play because they can contain compressed audio (MP3, WMA) or could be incorrectly mastered by the customer on a computer.
- Check that the CDs carry the Compact Disc Logo. If not, the disc is not mastered to the red book Compact Disc Standard and may not play.

Symptoms	Cause and Counter measure		
	Check that the CD was inserted correctly.		
	Check that the CD is scratched or dirty.		
	Check that there is condensation inside the player, and if there is, wait until the condensation is gone (about 1 hour) before using the player.		
Cannot play	The player will play correctly after it returns to the normal temperature if there is a temperature increase error.		
	Only the music CD files (CD-DA data) will be played if there is a mixture of music CD files (CD-DA data) and MP3/WMA files on a CD.		
	Files with extensions other than ".MP3", ".WMA", ".mp3", or ".wma" cannot be played.		
	Check that the finalization process, such as session close and disc close, is done for the disc.		
	Check that the CD is protected by copyright.		
Poor sound quality	Check that the CD is scratched or dirty.		
It takes a relatively long time before the music starts playing.	If there are many folder or file levels on the MP3/WMA CD, or if it is a multi session disc, some time may be required before the music starts playing.		
The songs do not play back in the desired order.	The playback order is the order in which the files were written by the software, so the files might not play in the desired order.		
Poor reception only from a certain radio broadcast station.	Check incoming radio wave signal strength of applicable broadcast station.		
Buzz/rattle sound from speaker	The majority of rattle sounds are not indicative of an issue with the speaker, usually something nearby the speaker is causing the rattle.		

Noise resulting from variations in field strength, such as fading noise and multi-path noise, or external noise from trains and other sources, is not a malfunction.

NOTE:

- Fading noise: This noise occurs because of variations in the field strength in a narrow range due to mountains or buildings blocking the signal.
- Multi-path noise: This noise results from a time difference between the broadcast waves directly from the station arriving at the
 antenna and the waves reflected by mountains or buildings.

RELATED TO TELEPHONE

Symptom	Possible cause	Possible solution
The voice on the other side is difficult to be heard.	The interior of the vehicle is too noisy.	Close the windows or have other occupants be quiet.
The voice is difficult to reach the	The volume of the voice is too low.	Speak louder.
other side of the connection.	Pronunciation is unclear.	Speak clearly.

RELATED TO HANDS-FREE PHONE (EXCEPT FOR MEXICO)

NORMAL OPERATING CONDITION

< SYMPTOM DIAGNOSIS >

The other party's voice cannot be heard by hands-free phone.

Poor sound quality

[BOSE AUDIO WITHOUT NAVIGATION]

charge quicker than usual. The Bluetooth® Hands-Free Phone

When the radio wave condition is not ideal or ambient sound is too

Do not place the cellular phone in an area surrounded by metal or far away from the in-vehicle phone module to prevent tone quality

loud, it may be difficult to hear the other person's voice during a

System cannot charge cellular phones.

degradation and wireless connection disruption.

Symptom	Cause and Counter measure
Does not recognize cellular phone connection. (No connection is displayed on the display at the guide.)	Some Bluetooth [®] enabled cellular phones may not be recognized by the in-vehicle phone module. Refer to "RELATED TO HANDS-FREE PHONE (Check Compatibility)" of HANDS-FREE PHONE SYMPTOMS.
Cannot use hands-free phone	Customer will not be able to use a hands-free phone under the following conditions. The vehicle is outside of the telephone service area. The vehicle is in an area where it is difficult to receive radio waves; such as in a tunnel, in an underground parking garage, near a tall building or in a mountainous area. The cellular phone is locked to prevent it from being dialed.
	While a cellular phone is connected through the Bluetooth [®] wireless connection, the battery power of the cellular phone may discharge quicker than usual. The Bluetooth [®] Hands-Free Phone System cannot charge cellular phones.
The other party's voice cannot be heard by hands-free phone.	When the radio wave condition is not ideal or ambient sound is too loud, it may be difficult to hear the other person's voice during a call.
Poor sound quality	Do not place the cellular phone in an area surrounded by metal or far away from the in-vehicle phone module to prevent tone quality degradation and wireless connection disruption.
RELATED TO HANDS-FREE PHONE (FOR MEX	ICO)
Symptom	Cause and Counter measure
Cannot use hands-free phone	Customer will not be able to use a hands-free phone under the following conditions. The vehicle is outside of the telephone service area. The vehicle is in an area where it is difficult to receive radio waves; such as in a tunnel, in an underground parking garage, near a tall building or in a mountainous area. The cellular phone is locked to prevent it from being dialed.
	While a cellular phone is connected through the Bluetooth® wireless connection, the battery power of the cellular phone may dis-

AV

M

0

P

PRECAUTION

PRECAUTIONS EXCEPT FOR MEXICO

EXCEPT FOR MEXICO: Precaution for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRE-TENSIONER"

The Supplemental Restraint System such as "AIR BAG" and "SEAT BELT PRE-TENSIONER", used along with a front seat belt, helps to reduce the risk or severity of injury to the driver and front passenger for certain types of collision. This system includes seat belt switch inputs and dual stage front air bag modules. The SRS system uses the seat belt switches to determine the front air bag deployment, and may only deploy one front air bag, depending on the severity of a collision and whether the front occupants are belted or unbelted. Information necessary to service the system safely is included in the "SRS AIR BAG" and "SEAT BELT" of this Service Manual.

WARNING:

Always observe the following items for preventing accidental activation.

- To avoid rendering the SRS inoperative, which could increase the risk of personal injury or death in the event of a collision that would result in air bag inflation, all maintenance must be performed by an authorized NISSAN/INFINITI dealer.
- Improper maintenance, including incorrect removal and installation of the SRS, can lead to personal injury caused by unintentional activation of the system. For removal of Spiral Cable and Air Bag Module, see "SRS AIR BAG".
- Never use electrical test equipment on any circuit related to the SRS unless instructed to in this Service Manual. SRS wiring harnesses can be identified by yellow and/or orange harnesses or harness connectors.

PRECAUTIONS WHEN USING POWER TOOLS (AIR OR ELECTRIC) AND HAMMERS

WARNING:

Always observe the following items for preventing accidental activation.

- When working near the Air Bag Diagnosis Sensor Unit or other Air Bag System sensors with the
 ignition ON or engine running, never use air or electric power tools or strike near the sensor(s) with
 a hammer. Heavy vibration could activate the sensor(s) and deploy the air bag(s), possibly causing
 serious injury.
- When using air or electric power tools or hammers, always switch the ignition OFF, disconnect the battery, and wait at least 3 minutes before performing any service.

EXCEPT FOR MEXICO : Precaution for Battery Service

Before disconnecting the battery, lower both the driver and passenger windows. This will prevent any interference between the window edge and the vehicle when the door is opened/closed. During normal operation, the window slightly raises and lowers automatically to prevent any window to vehicle interference. The automatic window function will not work with the battery disconnected.

EXCEPT FOR MEXICO: Precaution for Trouble Diagnosis

INFOID:0000000008655671

INFOID:0000000008655670

AV COMMUNICATION SYSTEM


- Do not apply voltage of 7.0 V or higher to the measurement terminals.
- Use the tester with its open terminal voltage being 7.0 V or less.
- Be sure to turn ignition switch OFF and disconnect the battery cable from the negative terminal before checking the circuit.

EXCEPT FOR MEXICO: Precaution for Harness Repair


INFOID:0000000008655673

AV COMMUNICATION SYSTEM

 Solder the repaired parts, and wrap with tape. [Frays of twisted line must be within 110 mm (4.33 in).]

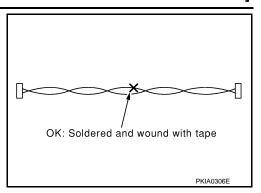

 Do not perform bypass wire connections for the repair parts. (The spliced wire will become separated and the characteristics of twisted line will be lost.)

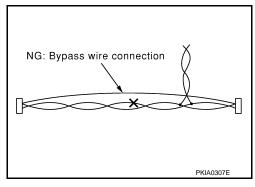

FOR MEXICO

FOR MEXICO: Precaution for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRE-TENSIONER" INFOID:00000000008655911

The Supplemental Restraint System such as "AIR BAG" and "SEAT BELT PRE-TENSIONER", used along with a front seat belt, helps to reduce the risk or severity of injury to the driver and front passenger for certain types of collision. Information necessary to service the system safely is included in the "SRS AIR BAG" and "SEAT BELT" of this Service Manual.

WARNING:

Always observe the following items for preventing accidental activation.

- To avoid rendering the SRS inoperative, which could increase the risk of personal injury or death in the event of a collision that would result in air bag inflation, all maintenance must be performed by an authorized NISSAN/INFINITI dealer.
- Improper maintenance, including incorrect removal and installation of the SRS, can lead to personal injury caused by unintentional activation of the system. For removal of Spiral Cable and Air Baq Module, see "SRS AIR BAG".
- Never use electrical test equipment on any circuit related to the SRS unless instructed to in this Service Manual. SRS wiring harnesses can be identified by yellow and/or orange harnesses or harness connectors.

PRECAUTIONS WHEN USING POWER TOOLS (AIR OR ELECTRIC) AND HAMMERS

WARNING:

Always observe the following items for preventing accidental activation.

- When working near the Air Bag Diagnosis Sensor Unit or other Air Bag System sensors with the ignition ON or engine running, never use air or electric power tools or strike near the sensor(s) with a hammer. Heavy vibration could activate the sensor(s) and deploy the air bag(s), possibly causing serious injury.
- When using air or electric power tools or hammers, always switch the ignition OFF, disconnect the battery, and wait at least 3 minutes before performing any service.

FOR MEXICO: Precaution for Battery Service

Before disconnecting the battery, lower both the driver and passenger windows. This will prevent any interference between the window edge and the vehicle when the door is opened/closed. During normal operation, the window slightly raises and lowers automatically to prevent any window to vehicle interference. The automatic window function will not work with the battery disconnected.

AV-103 Revision: 2012 August 2013 370Z

Α

Е

ΑV

INFOID:0000000008195280

[BOSE AUDIO WITHOUT NAVIGATION]

FOR MEXICO: Precaution for Trouble Diagnosis

INFOID:0000000008195281

AV COMMUNICATION SYSTEM


- Do not apply voltage of 7.0 V or higher to the measurement terminals.
- Use the tester with its open terminal voltage being 7.0 V or less.
- Be sure to turn ignition switch OFF and disconnect the battery cable from the negative terminal before checking the circuit.

FOR MEXICO: Precaution for Harness Repair


INFOID:0000000008195282

AV COMMUNICATION SYSTEM

• Solder the repaired parts, and wrap with tape. [Frays of twisted line must be within 110 mm (4.33 in).]

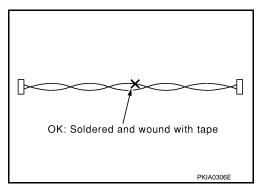

 Do not perform bypass wire connections for the repair parts. (The spliced wire will become separated and the characteristics of twisted line will be lost.)

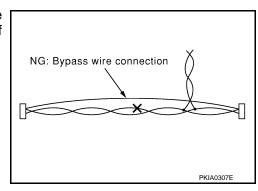

PREPARATION

< PREPARATION >

[BOSE AUDIO WITHOUT NAVIGATION]

PREPARATION

PREPARATION

Commercial Service Tools

Tool name		Description
Power tool	PBIC0191E	Loosening screws

F

Α

В

С

D

Е

INFOID:0000000008195283

G

Н

J

K

 $oxedsymbol{\mathbb{L}}$

M

ΑV

0


Р

REMOVAL AND INSTALLATION

AUDIO UNIT


Exploded View

REMOVAL

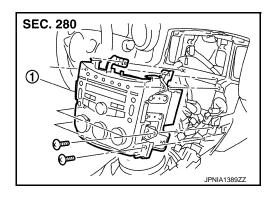

1. Audio unit

DISASSEMBLY

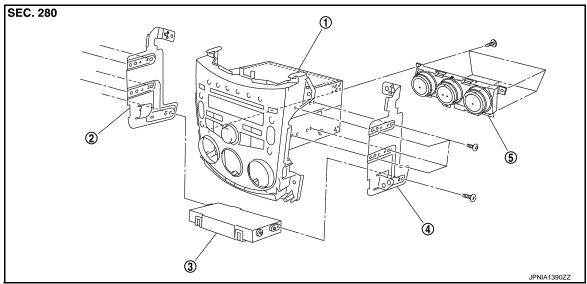

1. Audio unit

Bracket RH

- 2. Bracket LH
- 5. A/C control

3. A/C auto amp.

Removal and Installation

INFOID:0000000008195285

REMOVAL

- 1. Remove cluster lid C. Refer to IP-14, "Exploded View".
- 2. Remove audio unit with A/C auto amp. and A/C control as a single unit from the body.
- 3. Remove screws to remove A/C control.
- 4. Remove bracket screws to remove audio unit.

INSTALLATION

Install in the reverse order of removal.

FRONT DOOR SPEAKER


< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITHOUT NAVIGATION]

FRONT DOOR SPEAKER

Exploded View

INFOID:0000000008195286

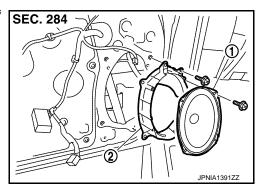

- 1. Front door speaker
- 2. Speaker bracket

Removal and Installation

INFOID:0000000008195287

REMOVAL

- 1. Remove door finisher. Refer to <u>INT-15, "Exploded View"</u> (coupe models) or <u>INT-47, "Exploded View"</u> (roadster models).
- 2. Remove front door speaker screws, then disconnect front door speaker connector and remove front door speaker.

INSTALLATION

Install in the reverse order of removal.

Α

В

D

Е

F

Н

Κ

L

M

ΑV

C


Р

[BOSE AUDIO WITHOUT NAVIGATION]

TWEETER

Exploded View

INFOID:0000000008195288

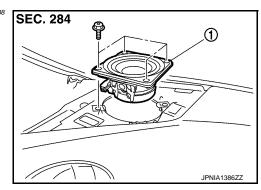

Tweeter

Removal and Installation

INFOID:0000000008195289

REMOVAL

- 1. Remove speaker grille. Refer to IP-14, "Exploded View".
- 2. Remove tweeter screws, then lift up tweeter, disconnect connector and remove tweeter.

INSTALLATION

Install in the reverse order of removal.


REAR SPEAKER

[BOSE AUDIO WITHOUT NAVIGATION]

REAR SPEAKER

Exploded View

INFOID:0000000008195290

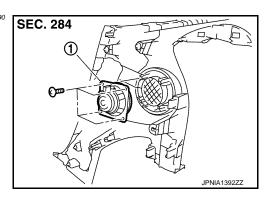

Rear speaker

Removal and Installation

REMOVAL

1. Remove rear side finisher. Refer to INT-18, "Exploded View" (coupe models) or INT-51, "Exploded View" (roadster models).

2. Remove rear speaker screws, then remove rear speaker.

INSTALLATION

Install in the reverse order of removal.

Н

Α

В

D

Е

INFOID:0000000008195291

J

Κ

L

M


ΑV

C

WOOFER

Exploded View

INFOID:0000000008195292

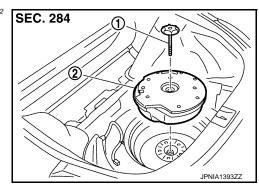

- 1. Clamp
- 2. Woofer

Removal and Installation

INFOID:0000000008195293

REMOVAL

- 1. Remove luggage spacer. Refer to INT-31, "Exploded View".
- 2. Remove clamp, then disconnect woofer connector and remove the woofer.

INSTALLATION

Install in the reverse order of removal.

REAR WOOFER

< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITHOUT NAVIGATION]

REAR WOOFER

Removal and Installation

INFOID:0000000008195294

REMOVAL

- 1. Remove the mounting clip on the front side of the storage room finisher and the soft top bumper rubber. Refer to RF-222, "STORAGE ROOM FINISHER: Removal and Installation".
- 2. Turn up the storage room finisher to obtain work space.
- 3. Remove rear woofer bracket.
- 4. Remove the screw and disconnect the connecter to remove the rear woofer.

INSTALLATION

Install in the reverse order of removal.

D

Е

Α

В

C

F

G

Н

ı

K

M

ΑV

0


BOSE AMP.

COUPE

COUPE: Exploded View


INFOID:0000000008195295

REMOVAL

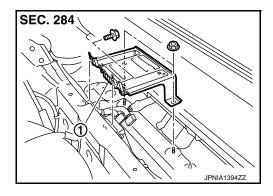

1. BOSE amp.

DISASSEMBLY

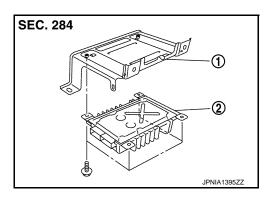

- 1. Bracket
- 2. BOSE amp.

COUPE: Removal and Installation

INFOID:0000000008195296

REMOVAL

- 1. Remove luggage floor spacer front. Refer to INT-31, "Exploded View".
- 2. Disconnect BOSE amp. connector, remove BOSE amp. with bracket as a single unit from body.
- 3. Remove BOSE amp. bracket screws to remove BOSE amp.

INSTALLATION

Install in the reverse order of removal.

ROADSTER

ROADSTER: Removal and Installation

INFOID:0000000008195297

REMOVAL

- 1. Remove luggage floor spacer front. Refer to INT-31, "Exploded View".
- 2. Disconnect BOSE amp. connector, remove BOSE amp. with bracket as a single unit from body.
- 3. Remove BOSE amp. bracket screws to remove BOSE amp.

INSTALLATION

Install in the reverse order of removal.

ANTENNA AMP.


< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITHOUT NAVIGATION]

ANTENNA AMP.

Exploded View

INFOID:0000000008195298

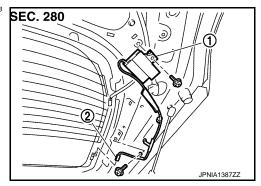

- Antenna amp.
- 2. Connector

Removal and Installation

INFOID:0000000008195299

REMOVAL

- 1. Remove back door finisher side. Refer to INT-33, "Exploded View".
- 2. Disconnect connector and remove screw, then remove antenna amp.

INSTALLATION

Install in the reverse order of removal.

Н

Α

В

D

Е

Κ

L

M

ΑV


C

F

ANTENNA BASE

Exploded View

INFOID:0000000008195300

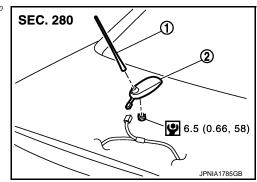

- 1. Antenna rod
- 2. Antenna base

Refer to GI-4, "Components" for symbols in the figure.

Removal and Installation

INFOID:0000000008195301

REMOVAL

- Remove trunk lid finisher inner. Refer to <u>INT-79</u>, "Exploded View".
- 2. Remove antenna base mounting nut, disconnect the antenna base connector.
- 3. Remove antenna base.

INSTALLATION

Installation is the reverse order of removal.


CAUTION:

Be careful about tightening torque. Antenna sensitivity becomes poor, and when it is excessive, trunk lid panel may be deformed, when antenna base mounting nut tightening torque is loose.

SATELLITE RADIO TUNER


Exploded View

REMOVAL

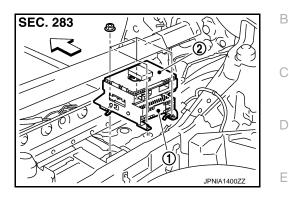

- 1. Satellite radio tuner
- 2. TEL adapter unit
 - : Vehicle front

DISASSEMBLY

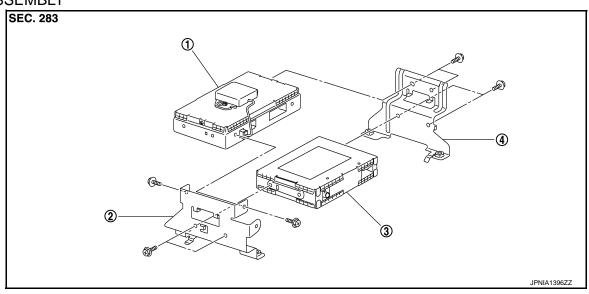

- TEL adapter unit
 Bracket RH
- 2. Bracket LH

3. Satellite radio tuner

Removal and Installation

REMOVAL

- 1. Remove Luggage spacer center front. Refer to INT-31, "Exploded View".
- 2. Disconnect TEL adapter unit connector and satellite radio tuner connector.
- 3. Remove satellite radio tuner with TEL adapter unit as a single unit from the body.
- 4. Remove bracket screws, and then remove satellite radio tuner.

INSTALLATION

Install in the reverse order of removal.

INFOID:0000000008195303

C

M

ΑV

Α

F

Н

INFOID:0000000008195302

SATELLITE RADIO ANTENNA


< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITHOUT NAVIGATION]

SATELLITE RADIO ANTENNA

Exploded View

INFOID:0000000008195304

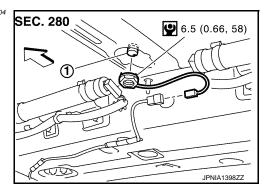

Satellite radio antenna

Refer to GI-4, "Components" for symbols in the figure.

Removal and Installation

INFOID:0000000008195305

REMOVAL

- 1. Remove rear pillar finisher (LH/RH). Refer to INT-18, "Exploded View".
- Pull down headlining (rear side) and obtain space for work between vehicle and headlining. Refer to INT-28, "Exploded View".
- 3. Disconnect satellite radio antenna connector.
- 4. Remove satellite radio antenna mounting nut, then remove satellite radio antenna from roof panel.

INSTALLATION

Install in the reverse order of removal.

CAUTION:

- Never bend headlining when pull down headlining (rear side).
- When satellite radio antenna mounting nut tightening torque is loose, be careful about tightening torque. Antenna sensitivity becomes poor, and when it is excessive, roof panel may become deformed.

STEERING SWITCH

< REMOVAL AND INSTALLATION > [BOSE AUDIO WITHOUT NAVIGATION]

STEERING SWITCH

Exploded View

Refer to SR-14, "Exploded View".

REMOVAL

Refer to SR-14, "Exploded View".

Removal and Installation

INSTALLATION

Install in the reverse order of removal.

K

J

Α

В

С

D

Е

F

G

Н

INFOID:0000000008195307

L

M


ΑV

0

TEL ADAPTER UNIT


Exploded View

REMOVAL

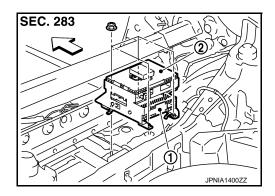

- 1. Satellite radio tuner
- 2. TEL adapter unit

DISASSEMBLY

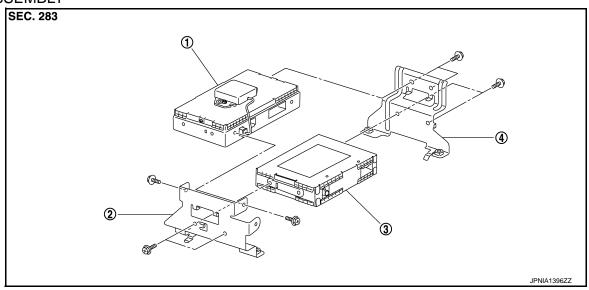

- TEL adapter unit
- Bracket LH

3. Satellite radio tuner

4. Bracket RH

Removal and Installation

INFOID:0000000008195309

REMOVAL

- 1. Remove luggage spacer center front. Refer to INT-31, "Exploded View".
- 2. Disconnect TEL adapter unit connector and satellite radio tuner connector.
- 3. Remove TEL adapter unit with satellite radio tuner as a single unit from the body.
- 4. Remove bracket screws, and then remove TEL adapter unit.

INSTALLATION

Install in the reverse order of removal.

MICROPHONE

< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITHOUT NAVIGATION]

MICROPHONE

Exploded View

INFOID:0000000008195310

Α

В

C


D

Е

REMOVAL

Refer to INL-38, "Exploded View" (Coupe models) or INL-84, "Exploded View" (Roadster models).

DISASSEMBLY

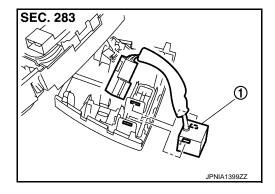

1. Microphone

Removal and Installation

INFOID:0000000008195311

REMOVAL

- 1. Remove map lamp. Refer to INL-38, "Exploded View" (coupe models), or INL-84, "Exploded View" (road-ster models).
- 2. Press the pawl to remove microphone from map lamp.

INSTALLATION

Install in the reverse order of removal.

1

Н

Κ

L

M

ΑV


C

ANTENNA FEEDER

COUPE

COUPE: Feeder Layout

INFOID:0000000008195312

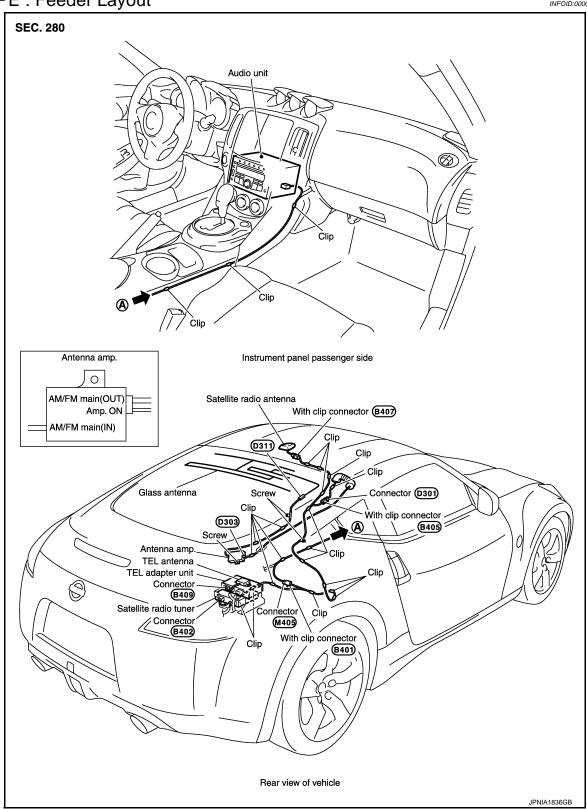

ROADSTER

ANTENNA FEEDER

JPNIA1838GB

Р

ROADSTER: Feeder Layout INFOID:0000000008195313 Α SEC. 280 В Audio unit D Е Clip Instrument panel passenger side Antenna base (antenna amp. and satellite antenna) > Connector (B408) Clip With clip connector **B425** Connector-TEL antena Clip With clip connector B429 B421 TEL (B431) (B433) adapter unit With clip connector (B427) (B420) Satellite radio tuner M ΑV Rear view of vehicle

Revision: 2012 August AV-121 2013 370Z

INFOID:0000000008655777

INFOID:0000000008655778

PRECAUTION

PRECAUTIONS EXCEPT FOR MEXICO

EXCEPT FOR MEXICO: Precaution for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRE-TENSIONER"

The Supplemental Restraint System such as "AIR BAG" and "SEAT BELT PRE-TENSIONER", used along with a front seat belt, helps to reduce the risk or severity of injury to the driver and front passenger for certain types of collision. This system includes seat belt switch inputs and dual stage front air bag modules. The SRS system uses the seat belt switches to determine the front air bag deployment, and may only deploy one front air bag, depending on the severity of a collision and whether the front occupants are belted or unbelted. Information necessary to service the system safely is included in the "SRS AIR BAG" and "SEAT BELT" of this Service Manual.

WARNING:

Always observe the following items for preventing accidental activation.

- To avoid rendering the SRS inoperative, which could increase the risk of personal injury or death in the event of a collision that would result in air bag inflation, all maintenance must be performed by an authorized NISSAN/INFINITI dealer.
- Improper maintenance, including incorrect removal and installation of the SRS, can lead to personal injury caused by unintentional activation of the system. For removal of Spiral Cable and Air Bag Module, see "SRS AIR BAG".
- Never use electrical test equipment on any circuit related to the SRS unless instructed to in this Service Manual. SRS wiring harnesses can be identified by yellow and/or orange harnesses or harness connectors.

PRECAUTIONS WHEN USING POWER TOOLS (AIR OR ELECTRIC) AND HAMMERS

WARNING:

Always observe the following items for preventing accidental activation.

- When working near the Air Bag Diagnosis Sensor Unit or other Air Bag System sensors with the
 ignition ON or engine running, never use air or electric power tools or strike near the sensor(s) with
 a hammer. Heavy vibration could activate the sensor(s) and deploy the air bag(s), possibly causing
 serious injury.
- When using air or electric power tools or hammers, always switch the ignition OFF, disconnect the battery, and wait at least 3 minutes before performing any service.

EXCEPT FOR MEXICO: Cautions in Removing Battery Terminal and AV Control Unit (Models with AV Control Unit)

CAUTION:

Remove battery terminal and AV control unit after a lapse of 30 seconds or more after turning the ignition switch OFF.

NOTE:

After the ignition switch is turned OFF, the AV control unit continues operating for approximately 30 seconds. Therefore, data corruption may occur if battery voltage is cut off within 30 seconds.

EXCEPT FOR MEXICO: Precaution for Battery Service

Before disconnecting the battery, lower both the driver and passenger windows. This will prevent any interference between the window edge and the vehicle when the door is opened/closed. During normal operation, the window slightly raises and lowers automatically to prevent any window to vehicle interference. The automatic window function will not work with the battery disconnected.

EXCEPT FOR MEXICO: Precaution for Trouble Diagnosis

AV COMMUNICATION SYSTEM

- Do not apply voltage of 7.0 V or higher to the measurement terminals.
- Use the tester with its open terminal voltage being 7.0 V or less.


• Be sure to turn ignition switch OFF and disconnect the battery cable from the negative terminal before checking the circuit.

EXCEPT FOR MEXICO: Precaution for Harness Repair


INFOID:0000000008655779

AV COMMUNICATION SYSTEM

 Solder the repaired parts, and wrap with tape. [Frays of twisted line must be within 110 mm (4.33 in).]

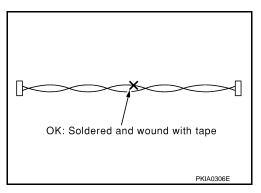

 Do not perform bypass wire connections for the repair parts. (The spliced wire will become separated and the characteristics of twisted line will be lost.)

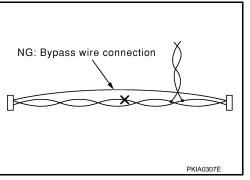

FOR MEXICO

FOR MEXICO: Precaution for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRE-TENSIONER"

The Supplemental Restraint System such as "AIR BAG" and "SEAT BELT PRE-TENSIONER", used along with a front seat belt, helps to reduce the risk or severity of injury to the driver and front passenger for certain types of collision. Information necessary to service the system safely is included in the "SRS AIR BAG" and "SEAT BELT" of this Service Manual.

WARNING:

Always observe the following items for preventing accidental activation.

- To avoid rendering the SRS inoperative, which could increase the risk of personal injury or death in the event of a collision that would result in air bag inflation, all maintenance must be performed by an authorized NISSAN/INFINITI dealer.
- Improper maintenance, including incorrect removal and installation of the SRS, can lead to personal injury caused by unintentional activation of the system. For removal of Spiral Cable and Air Bag Module, see "SRS AIR BAG".
- Never use electrical test equipment on any circuit related to the SRS unless instructed to in this Service Manual. SRS wiring harnesses can be identified by yellow and/or orange harnesses or harness connectors.

PRECAUTIONS WHEN USING POWER TOOLS (AIR OR ELECTRIC) AND HAMMERS

WARNING.

Always observe the following items for preventing accidental activation.

- When working near the Air Bag Diagnosis Sensor Unit or other Air Bag System sensors with the
 ignition ON or engine running, never use air or electric power tools or strike near the sensor(s) with
 a hammer. Heavy vibration could activate the sensor(s) and deploy the air bag(s), possibly causing
 serious injury.
- When using air or electric power tools or hammers, always switch the ignition OFF, disconnect the battery, and wait at least 3 minutes before performing any service.

Е

Α

В

Н

M

AV

0

FOR MEXICO: Cautions in Removing Battery Terminal and AV Control Unit (Models with AV Control Unit)

CAUTION:

Remove battery terminal and AV control unit after a lapse of 30 seconds or more after turning the ignition switch OFF.

NOTE:

After the ignition switch is turned OFF, the AV control unit continues operating for approximately 30 seconds. Therefore, data corruption may occur if battery voltage is cut off within 30 seconds.

FOR MEXICO: Precaution for Battery Service

INFOID:0000000008195317

Before disconnecting the battery, lower both the driver and passenger windows. This will prevent any interference between the window edge and the vehicle when the door is opened/closed. During normal operation, the window slightly raises and lowers automatically to prevent any window to vehicle interference. The automatic window function will not work with the battery disconnected.

FOR MEXICO: Precaution for Trouble Diagnosis

INFOID:0000000008195318

AV COMMUNICATION SYSTEM


- Do not apply voltage of 7.0 V or higher to the measurement terminals.
- Use the tester with its open terminal voltage being 7.0 V or less.
- Be sure to turn ignition switch OFF and disconnect the battery cable from the negative terminal before checking the circuit.

FOR MEXICO: Precaution for Harness Repair


INFOID:0000000008195319

AV COMMUNICATION SYSTEM

• Solder the repaired parts, and wrap with tape. [Frays of twisted line must be within 110 mm (4.33 in).]

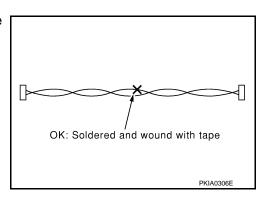

 Do not perform bypass wire connections for the repair parts. (The spliced wire will become separated and the characteristics of twisted line will be lost.)

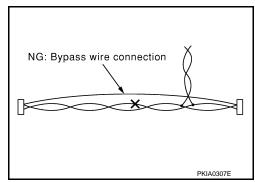

PREPARATION

< PREPARATION >

[BOSE AUDIO WITH NAVIGATION]

PREPARATION

PREPARATION

Commercial Service Tools

Tool name		Description	
Power tool	PBIC0191E	Loosening screws	

F

Α

В

С

D

Е

INFOID:0000000008195320

G

Н

1

J

Κ

L

M

ΑV

0


SYSTEM DESCRIPTION

COMPONENT PARTS

Component Parts Location

COUPE MODELS



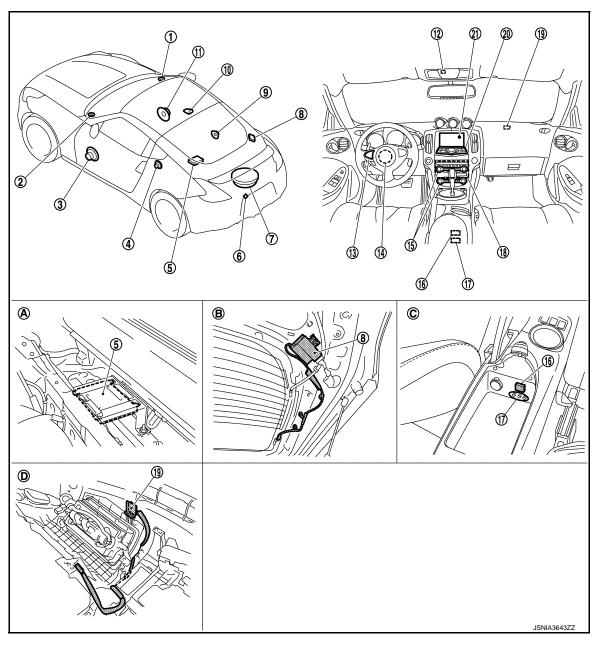


- Tweeter RH
- 4. Rear speaker LH
- 7. Woofer
- 10. Satellite radio antenna
- 13. Steering switch
- 16. USB connector
- 19. GPS antenna
- A. Luggage side LH
- D. Instrument panel remove condition

- 2. Tweeter LH
- 5. BOSE amp.
- 8. Antenna amp.
- 11. Front door speaker RH
- 14. Steering angle sensor
- 17. Auxiliary input jacks
- 20. Multifunction switch
- B. Back door side RH

- 3. Front door speaker LH
- 6. Rear view camera
- 9. Rear speaker RH
- 12. Microphone
- 15. Preset switch
- 18. AV control unit
- 21. Front display unit
- C. Consol box inner

ROADSTER MODELS

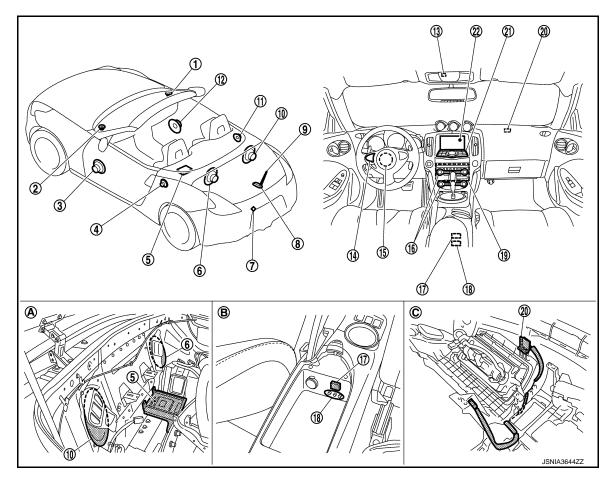

- 1. Tweeter RH
- 4. Rear speaker LH
- 7. Rear view camera
- 10. Rear woofer RH
- 13. Microphone
- 16. Preset switch
- 19. AV control unit
- 22. Front display unit
- A. Luggage side LH

- 2. Tweeter LH
- 5. BOSE amp.
- 8. Antenna base
- 11. Rear speaker RH
- 14. Steering switch
- 17. USB connector
- 20. GPS antenna
- B. Consol box inner

- 3. Front door speaker LH
- 6. Rear woofer LH
- 9. Antenna rod
- 12. Front door speaker RH
- 15. Steering angle sensor
- 18. Auxiliary input jacks
- 21. Multifunction switch
- C. Instrument panel remove condition

ΑV

Α

В

C

D

Е

F

Н

J

K

L

M

0

Component Description

INFOID:0000000008195322

Part name	Description
AV control unit	 Integrates hard disk drive (HDD) allowing map data and music data to be stored. It is the master unit of the MULTI AV system, and it is connected to each control unit by AV communication. It operates each system according to AV communication signals from the AV control unit. The AV control unit includes the audio, hands-free phone, voice control, navigation, USB connection, DVD play function and vehicle information functions. It is connected to ECM and combination meter via CAN communication to obtain necessary information for the vehicle information function. It inputs the illumination signals that are required for the display dimming control. It inputs the signals for driving status recognition (vehicle speed, reverse and parking brake). Update of map data is performed with the DVD-ROM. It includes the Bluetooth® module function.
Front display unit	 Front display image is controlled by the serial communication from AV control unit. RGB digital image signal is input from AV control unit. Composite image signal is input from AV control unit. Camera image signal is input from rear view camera. Touch panel function can be operated for each system by touching a display directly.
BOSE amp.	Coupe models Inputs power (BOSE amp. ON) and sound signal from AV control unit, and outputs sound signal to woofer and each speaker. Roadster models Inputs power (BOSE amp. ON) and sound signal from AV control unit, and outputs sound signal to each speaker. Inputs roof status signal from retractable soft top control unit.
Front door speaker	Outputs sound signal from BOSE amp.Outputs mid and low range sound.
Tweeter	Outputs sound signal from BOSE amp.Outputs high range sound.
Rear speaker	Outputs sound signal from BOSE amp.Outputs high, mid and low range sound.
Woofer (coupe models)	Outputs sound signal from BOSE amp.Outputs low range sound.
Rear woofer (roadster models)	Outputs sound signal from BOSE amp.Outputs low range sound.
Multifunction switch	 Operation panel is equipped with the centralized switch where audio, auxiliary input and navigation, etc. operations are integrated. Connected with preset switch via cable, and operation signal is transmitted to AV control unit via AV communication.
Preset switch	 Operation panel is equipped with the centralized switch where audio and air conditioner, etc. operations are integrated. Connected with multifunction switch via cable, and operation signal is transmitted to AV control unit via AV communication. The disk ejection operating signal is performed by wiring harness.
Steering switch	 Operations for audio, hands-free phone, vice control and navigation, etc. are possible. Steering switch signal (operation signal) is output to AV control unit.
Microphone	 Used for hands-free phone operation and voice recognition. Microphone signal is transmitted to AV control unit. Power (Microphone VCC) is supplied from AV control unit.
Auxiliary input jacks	Image signal and sound signal of auxiliary input is transmitted to AV control unit.

COMPONENT PARTS

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]

Part name	Description	
Rear view camera	 Camera power supply is input from AV control unit. The image of vehicle rear view is transmits to front display unit. 	
GPS antenna	GPS signal is received and transmitted to AV control unit.	
Antenna amp. (coupe models)	 Radio signal received by glass antenna is amplified and transmitted to AV control unit. Power (antenna amp. ON signal) is supplied from AV control unit. 	
Antenna base (roadster models)	An antenna base integrated with radio antenna amp. and satellite radio antenna are adopted. Radio antenna Radio signal received by rod antenna is amplified and transmitted to AV control unit. Power (antenna amp. ON signal) is supplied from AV control unit. Satellite radio antenna Receives the satellite radio wave and outputs it to the AV control unit.	
USB connector	Image signal* and sound signal of USB input are transmitted to AV control unit.	
Satellite radio antenna	Receives the satellite radio wave and outputs it to the AV control unit.	

^{*:} Image signals cannot be received from iPod $^{\!6}\!.$

G

Α

В

D

Е

F

Н

J

K

L

M

ΑV

0


SYSTEM

MULTI AV SYSTEM

MULTI AV SYSTEM: System Diagram

INFOID:0000000008195323


COUPE MODELS

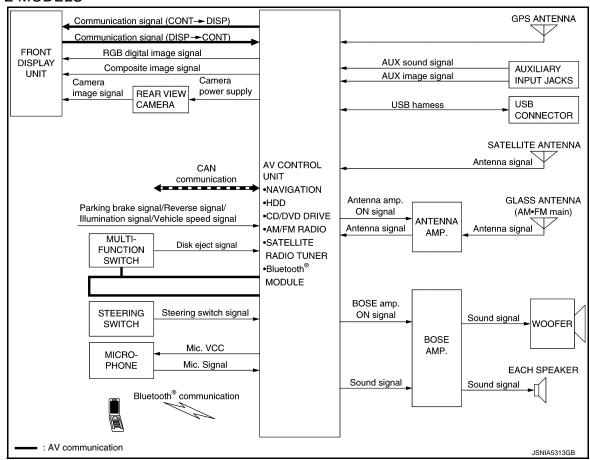

NOTE:


The name MULTIFUNCTION SWITCH indicates the integration of PRESET SWITCH and MULTIFUNCTION SWITCH virtually.

ROADSTER MODELS

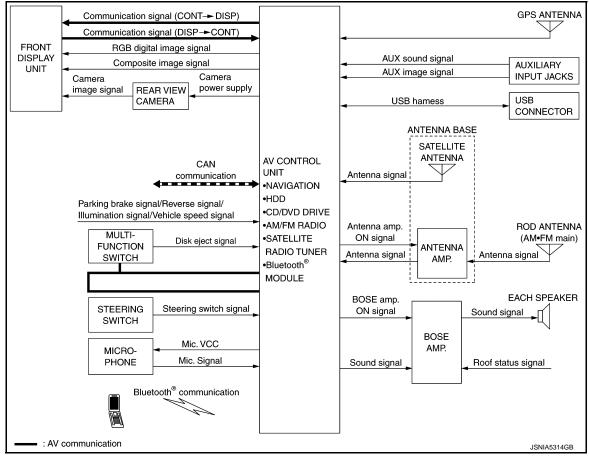

NOTE:

- The name MULTIFUNCTION SWITCH indicates the integration of PRESET SWITCH and MULTIFUNCTION SWITCH virtually.
- An antenna base integrated with antenna amp. and satellite antenna are adopted.

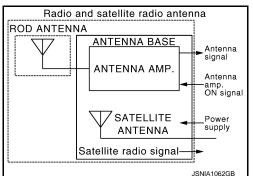

MULTI AV SYSTEM: System Description

Multi AV system means that the following systems are integrated.

FUNCTION NAME
Navigation system function
Audio function
Hands-free phone function
Auxiliary input function
Voice recognition function
Touch panel function
Vehicle information function

INFOID:0000000008195324

M

Α

В

D

Е

ΑV

FUNCTION NAME
USB connection function
DVD play function
Rear view monitor function

COMMUNICATION SIGNAL

- AV control unit function by transmitting/receiving data one by one with each unit (slave unit) that configures
 them completely as a master unit by connecting between units that configure MULTI AV system with two AV
 communication lines (H, L).
- Two AV communication lines (H, L) adopt a twisted pair line that is resistant to noise.
- AV control unit is connected by CAN communication, and it receives data signal from ECM, combination
 meter. It computes and displays fuel economy information value with the obtained information. Transmitting/
 receiving of data signal is performed by BCM. Also, it transmits the required signal of vehicle setting and
 receives the response signal.
- AV control unit is connected with front display unit and serial communication, and it transmits the required signal of display and display control and receives the response signal from front display unit.

NAVIGATION SYSTEM FUNCTION

Description

- The AV control unit controls navigation function while GPS tuner has built-in map data, GYRO (angle speed sensor), on the HDD (Hard Disk Drive).
- The AV control unit inputs operation signal with communication signal, through display (touch panel) and multifunction switch and steering switch.
- Guide sound is output to front speaker through BOSE amp. from AV control unit when operating navigation system.
- A vehicle position is calculated with the GYRO (angle speed sensor), vehicle sensor, signal from GPS satellite and map data stored on HDD (Hard Disk Drive), and transmits the map image signal (RGB digital image signal) to the front display unit.

Position Detection Principle

The navigation system periodically calculates the current vehicle position according to the following three types of signals.


- Travel distance of the vehicle as determined by the vehicle speed sensor
- Vehicle turning angle determined by the gyroscope (angular speed sensor)
- The travel direction of the vehicle determined by the GPS antenna (GPS information)


The current position of the vehicle is then identified by comparing the calculated vehicle position with map data, which is stored in the HDD (Hard Disk Drive) (map-matching), and indicated on the screen with a current location mark. More accurate data is used by comparing position detection results from GPS to the map-matching.

The current position is calculated by detecting the travel distance from the previous calculation point, and its direction change.

- Travel distance
 - The travel distance is generated from the vehicle speed sensor input signal. The automatic distance correction function is adopted for preventing a miss-detection of the travel distance because of tire wear etc.
- Travel direction

The gyroscope (angular velocity sensor) and GPS antenna (GPS information) generate the change of the travel direction. Both have advantages and disadvantages as per the following descriptions.

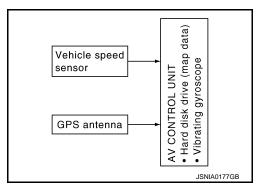

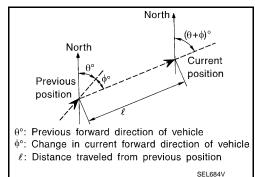


Туре	Advantage	Disadvantage	
Gyroscope (angular velocity sensor)	The turning angle is precisely detected.	Errors are accumulated when driving a long distance without stopping.	
GPS antenna (GPS information)	The travel direction (North/South/East/West) is detected.	The travel direction is not precisely detected when driving slowly.	

Input signals are prioritized in each situation. However, this order of priority may change in accordance with more detailed travel conditions so that the travel direction is detected more accurately.

Map-matching


Map-matching repositions the vehicle on the road map when a new location is judged to be more accurate. This is done by comparing the current vehicle position (calculated by the normal position detection method) from the map data stored in the HDD (Hard Disk Drive).

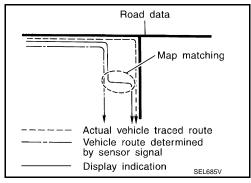

There is a possibility that the vehicle position may not be corrected in the following case, and when vehicle is driven over a certain distance or time in which GPS information is hard to receive. Correct manually the current location mark on the screen.

In map-matching, several alternative routes are prepared and prioritized in addition to the road judged as currently driving on.
 Therefore, due to errors in the distance and/or direction, an incorrect road may be prioritized, and the current location mark may be repositioned to the incorrect road.

If two roads are running in parallel, they are of the same priority. Therefore, the current location mark may appear on either of them alternately, depending on maneuvering of the steering wheel and configuration of the road, etc.

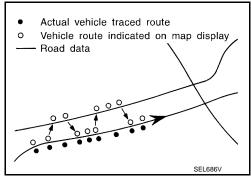


 Map-matching does not function correctly when road on which the vehicle is driving is new, etc. and not recorded in the map data. Also, map-matching does not function correctly when road pattern stored in the map data and the actual road pattern are different due to repair, etc.

Therefore, the map-matching function judges other road as a currently driving road if the road is not in the map, and displays the current location mark on it. Later, the current location mark may be repositioned to the road if the correct road is detected.

• Effective range for comparing the vehicle position and travel direction calculated by the distance and direction with the road data is limited. Therefore, correction by map-matching is not possible when there is an excessive gap between current vehicle position are

GPS (Global Positioning System)

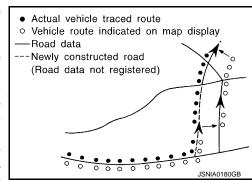

when there is an excessive gap between current vehicle position and the position on the map.

Revision: 2012 August AV-133 2013 370Z

D

А

Е

F

. .

.

K


M

AV

0

GPS (Global Positioning System) is developed for and is controlled by the US Department of Defense. The system utilizes GPS satellites (NAVSTAR), transmitting out radio waves while flying on an orbit around the earth at an altitude of approximately 21,000 km (13,049 mile).

The receiver calculates the travel position in three dimensions (latitude/longitude/altitude) according to the time lag of the radio waves that four or more GPS satellites transmit (three-dimensional positioning). The GPS receiver calculates the travel position in two dimensions (latitude/longitude) with the previous altitude data if the GPS receiver receives only three radio waves (two-dimensional positioning). GPS position correction is not performed while stopping the vehicle.

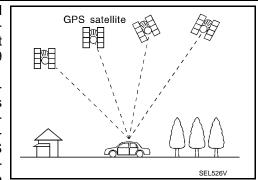

Accuracy of the GPS will deteriorate under the following conditions:

- In two-dimensional positioning, GPS accuracy will deteriorate when altitude of the vehicle position changes.
- The position of GPS satellite affects GPS detection precision. The position detection may not be precisely performed.
- The position detection is not performed if GPS receiver does not receive radio waves from GPS satellites.
 (Inside a tunnel, parking in a building, under an elevated highway etc.) GPS receiver may not receive radio waves from GPS satellites if any object is placed on the GPS antenna.

NOTE:

- The detection result has an error of approximately 10 m (32.81 ft) even with a high-precision three dimensional positioning.
- There may be cases when the accuracy is lowered and radio waves are stopped intentionally because the GPS satellite signal is controlled by the US trace control center.

AUDIO FUNCTION

The audio system is equipped with the following functions. Each function is operated with multifunction switch, preset switch, touch panel, steering switch or voice recognition. Operation status of audio is indicated at front display unit.

FUNCTION		
AM/FM radio		
Satellite radio		
CD		
Bluetooth [®] audio		
Music Box (Hard Disk Drive)*		
Sound equalizer automatic switching (Roadster models)		

^{*:} For Mexico

Operating Signal

Audio system operation can be performed with multifunction switch, preset switch, steering switch, touch panel function or voice recognition function.

- Operating signal is transmitted to AV control unit with AV communication when it is operated by multifunction switch or preset switch. The disk ejection operating signal is performed by wiring harness.
- Operating signal is transmitted to AV control unit with steering switch signal when it is operated by steering switch.
- Refer to the following system description ("VOICE RECOGNITION FUNCTION" and "TOUCH PANEL SYSTEM") for explanation of voice recognition function and touch panel function.

Screen Display

Switching of display is performed with serial communication between display unit and AV control unit.

AM/FM Radio Mode

- AM/FM radio tuner is built into AV control unit.
- Audio signal is received by glass antenna, next it is amplified by antenna amp., and finally it is input to AV
 control unit. Audio signal is input to BOSE amp., and BOSE amp. outputs to woofer and each speaker.
 (coupe models)

• Audio signal is received by rod antenna, next it is amplified by antenna amp., and finally it is input to AV control unit. Audio signal is input to BOSE amp., and BOSE amp. outputs to each speaker. (roadster models)

Satellite Radio Mode

- Satellite radio tuner is built into AV control unit.
- Audio wave (satellite radio) is received by satellite radio antenna, and it is input to AV control unit. AV control
 unit outputs audio signal to BOSE amp. The signal is also outputted from BOSE amp. to woofer and each
 speaker. (coupe models)
- Audio wave (satellite radio) is received by satellite radio antenna, and it is input to AV control unit. AV control
 unit outputs audio signal to BOSE amp. The signal is also outputted from BOSE amp. to each speaker.
 (roadster models)

CD Mode

- CD function is built into AV control unit.
- AV control unit outputs audio signal to BOSE amp., and BOSE amp. outputs to woofer and each speaker. (coupe models)
- AV control unit outputs audio signal to BOSE amp., and BOSE amp. outputs to each speaker. (roadster models)

Bluetooth® Audio

- Bluetooth[®] audio function is built into AV control unit.
- When the Bluetooth[®] audio is connected to the portable audio equipped with the Bluetooth[®] communication compliant profile via Bluetooth[®] communication, it can be play the music data in the portable audio.
- A maximum of five Bluetooth[®] devices including the audio devices and cellular phones can be registered in the AV control unit.

Music Box Mode (For Mexico)

- Music CD data is stored on HDD (Hard Disk Drive) that is built into AV control unit, and it can be played.
- AV control unit outputs music (sound signal) that is stored on HDD (Hard Disk Drive) to BOSE amp., and BOSE amp. outputs to woofer and each speaker.

Sound Equalizer Automatic Switching Function

Sound quality in a fully-open retractable soft top condition is improved by the correction for bringing the frequency characteristics in a fully-open retractable soft top condition closer to the characteristics in a fully-closed retractable soft top condition. When the retractable soft top is in a fully-open condition, sound pressure is reduced due to the absence of sound echo generated by sound reflection from the retractable soft top. BOSE amp. detects an open-close condition of the retractable soft top by receiving a roof status signal from the retractable soft top control unit and switches the equalizer to correct the frequency characteristics in a fully-open retractable soft top condition. During the switching of the equalizer, audio stops temporarily due to the temporary mute.

HANDS-FREE PHONE FUNCTION

- Hands-free communication can be operated by connecting using Bluetooth[®] with cellular phone.
- · Operation is performed by steering switch, and operating condition is indicated on front display unit.
- Guide sound that is heard during operation is input from AV control unit to BOSE amp. and output from front door speaker.

When A Call Is Originated

Spoken voice sound output from the microphone (Mic. Signal) is input to AV control unit. AV control unit outputs to cellular phone with Bluetooth[®] communication as a TEL voice signal. Voice sound is then heard at the other party.

When Receiving A Call

Voice sound is input to own cellular phone from the other party. TEL voice signal is output to front door speaker, and the signal is input to BOSE amp. via AV control unit by establishing Bluetooth[®] communication from cellular phone.

AUXILIARY INPUT FUNCTION

- Image and sound can be output from an external device by connecting a device with auxiliary input jacks.
- AUX image signals are transmitted to the display unit through AV control unit.
- AUX sound signals are transmitted to woofer and each speaker through AV control unit and BOSE amp. (coupe models)

Н

В

D

F

J

1

M

AV

0

Р

Revision: 2012 August AV-135 2013 370Z

< SYSTEM DESCRIPTION >

AUX sound signals are transmitted to each speaker through AV control unit and BOSE amp. (roadster models)

VOICE RECOGNITION FUNCTION

- Each operation of multi AV system can be performed by inputting sound to microphone.
- Start of voice recognition system can be performed by steering switch.
- AV control unit is connected by CAN communication, and it receives roof status signal from the soft top control unit, then system operation is available only when the retractable soft top is closed. (roadster models)

TOUCH PANEL SYSTEM

Each operation of multi AV system can be performed by directly touching a display.

VEHICLE INFORMATION FUNCTION

- Status of audio, climate control system, fuel economy, maintenance and navigation are displayed.
- AV control unit displays the fuel consumption status while receiving data signal through CAN communication from ECM, combination meter.

USB CONNECTION FUNCTION

- Connecting iPod[®] or USB memory allows the driver to play iPod[®] music files or USB memory-stored music files, video data, and image viewer data.
- Sound signals of music files stored in iPod[®] or USB memory are transmitted from the USB connector to the AV control unit. The AV control unit transmits the sound signals to the woofer and each speaker via BOSE amp. (coupe models)
- Sound signals of music files stored in iPod[®] or USB memory are transmitted from the USB connector to the AV control unit. The AV control unit transmits the sound signals to each speaker via BOSE amp. (roadster models)
- Video signals and image viewer file signals are transmitted from the USB connector to the AV control unit. The data and files are displayed on the front display unit screen.
- iPod[®] is recharged when connected to USB connector.
- Only files that meet the following conditions will be played.

	Music file	Video file	Image viewer file
File format	"MP3", "WMA", "AAC", "M4A"	"DivX", "MPEG4 (ASF)"	"JPEG"
File extension	".mp3", ".wma", ".aac", ".m4a"	".divx", ".afs", ".avi"	".jpg", ".jpeg"
Maximum file size	2 GB	2 GB	 2 MB Screen size*1: (H: 1536 x V: 2048 pixels) The number of directories*2: Up to 500

^{*1:} Images cannot be displayed if the screen size exceeds the upper limit.

NOTE

- iPod[®] is a trademark of Apple inc., registered in the U.S. and other countries.
- Image signals cannot be received from iPod[®].
- Use the enclosed USB harness when connecting iPod[®] to USB connector.

DVD PLAY FUNCTION

- DVD is played by inserting DVD into the AV control unit.
- DVD image signals are transmitted to the display unit and DVD sound signals are transmitted to each speaker via BOSE amp.

REAR VIEW MONITOR FUNCTION

- The AV control unit supplies power to the rear view camera when receiving a reverse signal.
- The rear view camera transmits camera images to the display unit when power is supplied from the AV control unit.
- The AV control unit transmits a warning message, fixed guide lines, and predictive course lines to the display
 unit by RGB digital image signal. Rear view monitor images are displayed by combining the RGB digital
 image signal and the camera image signals from the rear view camera.
- Predictive course lines are controlled by a steering angle sensor signal received the AV control unit via CAN communication.

^{*2:} The value of an image file storable in the same directory is up to 1024.

MULTI AV SYSTEM: Fail-Safe

INFOID:0000000008195325

Α

В

C

D

Е

F

Н

K

L

M

When the ambiance temperature becomes extremely low or extremely high, AV control unit displays the message and limits the AV control unit function.

FAIL-SAFE CONDITIONS

When the ambiance temperature is -20°C (-4°F) or lower, or when it is 70°C (158°F) or higher

Display

The messages displayed on fail-safe conditions are as shown below:

Fail-safe mode	Display (display of the fail-safe condition)	
When HDD temperature is low	HDD system is experiencing problems due to extreme low temperature. Normal operation will resume when temperature rises.	
When HDD temperature is high	HDD system is experiencing problems due to extreme high temperature. Normal operation will resume when temperature drops.	

DESCRIPTION OF CONTROLS

Function		When Fail-safe Function is activated	
	Operation	Only multifunction switch (preset switch) can be operated.	
Air conditioner	Display	 LED of multifunction switch (preset switch) illuminates. Aimed temperature, blow angle, and flow rate are displayed in simplified mode. 	
Audio	Operation	Only ON/OFF and volume control operations by multifunction switch (preset switch) are possib	
	Display	No display ("Fail-safe mode" is displayed)	
Hands-free phone	Operation	Cannot be operated.	
Navigation	Operation	Cannot be operated.	
Self diagnosis	1	The display in simplified mode of fail-safe condition	
CONSULT diagnosis Cannot be operated.		Cannot be operated.	

Ability Operation Mode

There is an ability operation mode for Fail-safes due to low or high ambiance temperature.

If HDD data can be read, fail-safe is shown, then normal displays are displayed only for functions which can be operated.

RELEASE CONDITIONS OF FAIL-SAFE

Fail-safe is released on following conditions and normal mode is restored.

When The Temperature of HDD Is Low or High

If the ambient temperature becomes out of fail-safe condition range, normal mode is restored.

ΑV

0

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]

DIAGNOSIS SYSTEM (AV CONTROL UNIT)

Description INFOID:000000008195326

 The AV control unit diagnosis function starts up with multifunction switch operation and the AV control unit performs a diagnosis for each unit in the system during the on board diagnosis.

Perform a CONSULT diagnosis if the on board diagnosis does not start, e.g., the screen does not display
anything, the multifunction switch does not function, etc.

On Board Diagnosis Function

INFOID:0000000008195327


MULTIFUNCTION SWITCH AND PRESET SWITCH SELF-DIAGNOSIS FUNCTION

The ON/OFF operation (continuity) of each switch in the multifunction switch and preset switch can be checked.

Self-diagnosis Mode

- Press the "BACK" switch and the "UP" switch of the 8-direction switches within 10 seconds after turning the ignition switch from OFF to ACC and hold them for 3 seconds or more. Then the buzzer sounds, all indicators of the preset switch illuminate, and the self-diagnosis mode starts.
- The continuity of each switch at the ON position can be checked by pressing the switch. The buzzer sounds if the switch is normal.
 NOTE:

The disk eject switch cannot be checked.

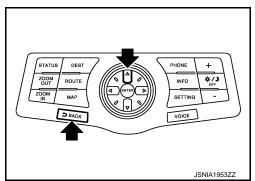

Finishing Self-diagnosis Mode

Self-diagnosis mode is canceled when turning the ignition switch OFF.

ON BOARD DIAGNOSIS

Description

- The trouble diagnosis function has a self-diagnosis mode for conducting trouble diagnosis automatically and a confirmation/adjustment mode for operating manually.
- The self-diagnosis mode performs diagnoses on the AV control unit, connections between system components as well as connections between AV control unit and GPS antenna. Then it displays the diagnosis results on the display.
- The confirmation/adjustment mode allows the technician to check, modify or adjust the vehicle signals and set values, as well as to monitor the system error records and system communication status. The checking, modifying or adjusting generally require human intervention and judgment (the system cannot make judgment automatically).

On Board Diagnosis Item

Mode	Description
Self Diagnosis	 AV control unit diagnosis. Diagnoses the connections across system components, between AV control unit and GPS antenna.


< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]

Mode			Description
	Display Diagnosis		The following check functions are available: color tone check by color bar display, light and shade check by gray scale display, touch panel calibration and response check, and color tone check by white display.
	Vehicle Signals		Diagnosis of signals can be performed for vehicle speed, parking brake, lights, ignition, reverse, side view switch and room lamp.
	Speaker Test		The connection of a speaker can be confirmed by test tone.
		Steering Angle Adjustment	When there is a difference between the actual turning angle and the vehicle mark turning angle, it can be adjusted.
	Navigation	Speed Calibration	When there is a difference between the current location mark and the actual location, it can be adjusted.
		XM SAT Subscription Status	The XM NavTraffic subscription status can be checked.
	Error History		The system malfunction and the frequency when occurring in the past are displayed. When the malfunctioning item is selected, the time and place that the selected malfunction last occurred are displayed.
	Synchronizer FES Clock		-
Confirmation/	Vehicle CAN Diagnosis		The transmitting/receiving of CAN communication can be monitored.
Adjustment	AV COMM Diagnosis		The communication condition of each unit of Multi AV system can be monitored.
	Hands-free Phone		The received volume adjustment of hands-free phone, microphone speaker check, and erase memory can be performed.
	Camera Cont.		The four functions of "Correct Draw Line of Rear view Camera", "Alter/Confirm Configuration", "Reset Configuration" and "Camera Syst Type" are available.
		XM Navi Trffic	Change Channel
		XM NavWeather	Any necessary channels required to receive traffic information from the satellite radio system can be set.
	XM	XM CGS	Change Application ID • Any application ID'-s required to receive traffic information from the satellite radio system can be set.
		Diag	Not used.
	Delete Unit Connection Log		Erase the connection history of unit and error history.
	Initialize Settings		Initializes the AV control unit memory.
	Version Information		Version information of the AV control unit is displayed.

STARTING PROCEDURE

- 1. Start the engine.
- 2. Turn the audio system OFF.
- 3. While pressing the "SETTING" button, turn the volume control dial clockwise or counterclockwise for 40 clicks or more. (When the self-diagnosis mode is started, a short beep will be heard.)
 - Shifting from current screen to previous screen is performed by pressing "BACK" button.

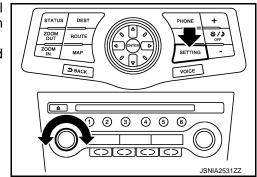

M


AV

0

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]


 The trouble diagnosis initial screen is displayed, and then the items of "Self Diagnosis" and "Confirmation/Adjustment" can be selected.

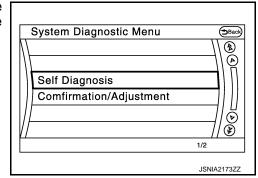

SELF-DIAGNOSIS MODE

- Start the self-diagnosis function and select "Self Diagnosis".
- Self-diagnosis subdivision screen is displayed, and the self-diagnosis mode starts.
- The bar graph visible on the center of the self-diagnosis subdivision screen indicates progress of the trouble diagnosis.
- Diagnosis results are displayed after the self-diagnosis is completed. The unit names and the connection lines are color-coded according to the diagnostic results.


Diagnosis results	Unit	Connec- tion line
Normal	Green	Green
Connection malfunction	Gray	Yellow
Unit malfunction Note	Red	Green

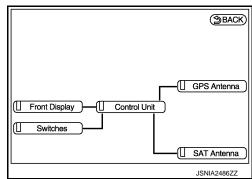

NOTE:

Control unit (AV control unit) is displayed in red.

- Replace AV control unit if "Self-Diagnosis did not run because of a control unit malfunction" is indicated. The symptom is AV control unit internal error. Refer to AV-243, "Exploded View".
- If multiple errors occur at the same time for a single unit, the screen switch colors are determined according to the following order
 of priority: red > gray.
- The comments of the self-diagnosis results can be viewed with a component in the diagnosis result screen.

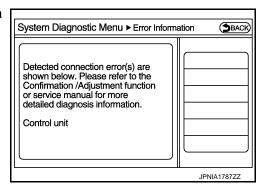

Detection Range of Self-diagnosis Mode

- The self-diagnosis mode allows the technician to diagnose the connection in the communication line between AV control unit and each unit and the internal operation of the AV control unit.
- Because the start condition of diagnosis function is a switch operation, the on board diagnosis function cannot be started up if any malfunction is detected in the communication circuit between AV control unit and multifunction switch.

SELF-DIAGNOSIS RESULTS

Check the applicable display at the following table, and then repair the malfunctioning parts.

Only Unit Part Is Displayed In Red.

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]


Screen switch	Description	Possible malfunction location / Action to take
Control unit	Malfunction is detected in AV control unit power supply and ground circuits.	Check AV control unit power supply and ground circuits. When detecting no malfunction in those components, replace AV control unit.

A Connecting Cable Between Units Is Displayed In Yellow.

Area with yellow connection lines	Description	Possible malfunction location / Action to take
Control unit ⇔ Front Display	Malfunction is detected in serial communication circuits between AV control unit and front display unit.	Serial communication circuits between AV control unit and front display unit.
Control unit ⇔ GPS Antenna	GPS antenna connection malfunctions detected.	GPS antenna
Control unit ⇔ SAT Antenna	Satellite radio antenna connection malfunctions detected.	Satellite radio antenna

CONFIRMATION/ADJUSTMENT MODE

- 1. Start the diagnosis function and select "Confirmation/Adjustment". The confirmation/adjustment mode indicates where each item can be checked or adjusted.
- Select each switch on the "Confirmation/Adjustment Mode" screen to display the relevant trouble diagnosis screen. Press the "Back" switch to return to the initial Confirmation/Adjustment Mode screen.

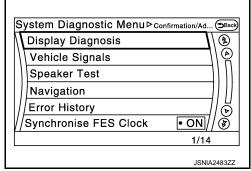

Н

Α

В

D

Е

F

Κ


_

ΑV

0


F

Display Diagnosis

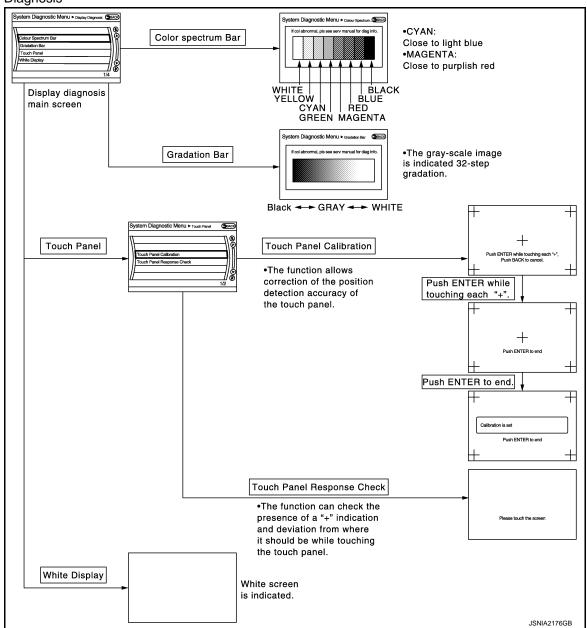

Vehicle Signals

A comparison check can be made of each actual vehicle signal and the signals recognized by the system.

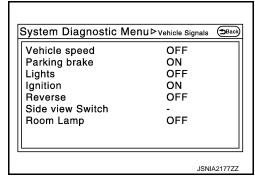

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]

Α

В

D

Е

F

K


M

ΑV

Diagnosis item	Display	Vehicle status	Remarks
Vehicle speed	ON	Vehicle speed > 0 km/h (0 MPH)	Changes in indication may be delayed. This is normal
	OFF	Vehicle speed = 0 km/h (0 MPH)	
Parking brake	ON	Parking brake is applied.	 Changes in indication may be delayed. This is norma
	OFF	Parking brake is released.	-
Lights	ON	Light switch ON	
	OFF	Light switch OFF	_
Ignition	ON	Ignition switch ON	
	OFF	Ignition switch in ACC position	_
Reverse	ON	Shift the selector lever to "R" position	Changes in indication may be delayed. This is normal.
	OFF	Shift the selector lever other than "R" position	
SIDE VIEW SW	_	_	This item is displayed, but cannot be monitored.
ROOM LAMP	OFF	-	This item is displayed, but not used.

Speaker Test


Select "SPEAKER DIAGNOSIS" to display the Speaker Diagnosis screen. Press "Start" to generate a test tone in a speaker. Press "Start" to generate a test tone in the next speaker. Press "Stop" to stop the test tones.

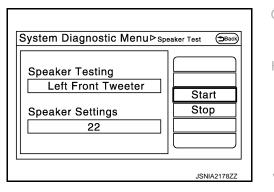

Navigation


STEERING ANGLE ADJUSTMENT

The steering angle output value detected with the gyroscope is adjusted.

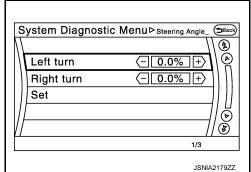

SPEED CALIBRATION

During normal driving, distance error caused by tire wear and tire pressure change is automatically adjusted for by the automatic distance correction function. This function, on the other hand, is for immediate adjustment, in cases such as driving with tire chain fitted on tires.

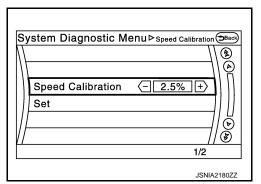

XM SAT SUBSCRIPTION STATUS

The XM NavTraffic subscription status can be checked.

Error History

The self-diagnosis results are judged depending on whether any error occurs from when "Self-diagnosis" is selected until the self-diagnosis results are displayed.

However, the diagnosis results are judged normal if an error has occurred before the ignition switch is turned ON and then no error has occurred until the self-diagnosis start. Check the "Error Record" to detect any error that may have occurred before the self-diagnosis start because of this situation.

The error record displays the time and place of the most recent occurrence of that error. However, take note of the following points.

- If there is a malfunction with the GPS antenna circuit board in the AV control unit, the correct date and time of occurrence may not be able to be displayed.
- Place of the error occurrence is represented by the position of the current location mark at the time an error occurred. If current location mark has deviated from the correct position, then the place of the error occurrence cannot be located correctly.
- The frequency of occurrence is displayed in a count up manner. The actual count up method differs depending on the error item.


Count up method A

- The counter resets to 0 if an error occurs when ignition switch is turned ON. The counter increases by 1 if the condition is normal at a next ignition ON cycle.
- The counter upper limit is 39. Any counts exceeding 39 are ignored." The counter can be reset (no error record display) with the "Delete log" switch or CONSULT.

Count up method B

- The counter increases by 1 if an error occurs when ignition switch is ON. The counter will not decrease even if the condition is normal at the next ignition ON cycle.
- The counter upper limit is 50. Any counts exceeding 50 are ignored. "The counter can be reset (no error record display) with the "Delete log" switch or CONSULT.

Display type of occur- rence frequency	Error history display item
Count up method A	CAN communication line, control unit (CAN), AV communication line, control unit (AV)
Count up method B	Other than the above

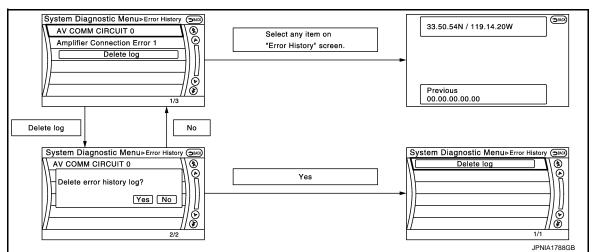

Error item

Some error items may be displayed simultaneously according to the cause. If some error items are displayed simultaneously, the detection of the cause can be performed by the combination of display items

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]

Error item	Description	Possible malfunction factor/Action to take
CAN COMM CIRCUIT	CAN communication malfunction is detected.	Perform diagnosis with CONSULT, and then repair the malfunctioning parts according to the diagnosis results. Refer to AV-149, "CONSULT Function (MULTI AV)".
CONTROL UNIT (CAN)	CAN initial diagnosis malfunction is detected.	
CONTROL UNIT (AV)	AV communication circuit initial diagnosis malfunction is detected.	
FLASH-ROM Error Of Control Unit		
Connection Of Gyro		
Connection of G Sensor		Replace the AV control unit if the malfunction occurs constantly.
CAN Controller Memory Error		
Bluetooth Module Connection Error	AV control unit malfunction is detected.	
Sub CPU Connection Error		
iPod authentification chip error		
Audio connection error		
DSP Connection Error		If a disc can be played, then there is a
DSP Communication Error	AV control unit malfunction is detected.	 possibility of the detection of a temporary malfunction. Replace the AV control unit if the malfunction occurs constantly.
HDD Connection Error		
HDD Read Error		If the music box function has no malfunctions, then there is a possibility of the detection of a temporary malfunction. Output Description:
HDD Write Error	AV control unit malfunction is detected.	
HDD Communication Error	Replace the AV control unit if t function occurs constantly.	
HDD Access Error		
GPS Communication Error		An intermittent error caused by strong radio
GPS ROM Error		interference may be detected unless any symptom (GPS reception error, etc.) oc-
GPS RAM Error	GPS malfunction is detected.	curs.
GPS RTC Error		Replace the AV control unit if the malfunction occurs constantly.
Unfinished configuration	The writing of configuration data is incomplete.	Write configuration data with CONSULT.
USB Controller Communication Error	USB connection malfunction is detected.	Check that the connection to the USB connector is normal.
DVD Mechanism Communication Error	AV control unit malfunction is detected.	 If DVD can be played, then there is a possibility of the detection of a temporary malfunction. Replace the AV control unit if the malfunction occurs constantly.
Steer. Angle Sensor Calibration	Predictive course line center position adjustment of the steering angle sensor is incomplete.	Adjust the predictive course line center position of the steering angle sensor.
When either one of the following items is detected: • front display unit power supply and ground circuits malfunction is detected. • malfunction is detected in communication.		 Front display unit power supply and ground circuits. Communication circuits between AV control unit and front display unit.

AV-145 Revision: 2012 August 2013 370Z

< SYSTEM DESCRIPTION >


[BOSE AUDIO WITH NAVIGATION]

Error item	Description	Possible malfunction factor/Action to take	
GPS Antenna Error	GPS antenna connection malfunction is detected.	Check the connection of the GPS antenna connector.	
XM Antenna Connection Error	Satellite radio antenna connection malfunction is detected.	Satellite radio antenna feeder. Satellite radio antenna.	
USB electric current Error	Detection of over current in USB connector.	Check USB harness between the AV control unit and USB connector.	
AM/FM antenna amplifier short to ground	Radio antenna amp. ON signal circuit mal-	Radio antenna amp. ON signal circuit be-	
AM/FM antenna amplifier open	function is detected.	tween AV control unit and radio antenna amp.	
Ext_Amp_ON output terminal short to ground	BOSE amp. ON signal circuit malfunction is detected.	BOSE amp. ON signal circuit between AV	
Ext_Amp_ON output terminal :open	detected.	control unit and BOSE amp.	
AV COMM CIRCUIT Switches Connection Error	When either one of the following items are detected: multifunction switch power supply and ground circuits are malfunctioning. AV communication circuits between AV control unit and multifunction switch are malfunctioning.	 Multifunction switch power supply and ground circuits. AV communication circuits between AV control unit and multifunction switch. 	

Vehicle CAN Diagnosis

- CAN communication status and error counter is displayed.
- The error counter displays "OK" if any malfunction was not detected in the past and displays "0" if a malfunction is detected. It increases by 1 if the condition is normal at the next ignition switch ON cycle. The upper limit of the counter is 39.
- The error counter is erased if "Reset" is pressed.

Display (Current)	Malfunction counter (Past)
OK / ???	OK / 0 – 39
OK / ???	OK / 0 – 39
OK / ???	OK / 0 – 39
OK / ???	OK / 0 – 39
OK / ???	OK / 0 – 39
OK / ???	OK / 0 – 39
OK / ???	OK / 0 – 39
	OK / ???

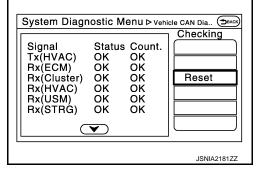

System Diagnostic Menu ⊳ AV COMM Diagn.. →BACK

Count.

OK

OK

Status

C Tx(ITM-PrimarySW) OK

C Rx(PrimarySW-ITM) OK

V

Checking

Reset

NNNIA0189ZZ

NOTE:

"???" indicates UNKWN

AV COMM Diagnosis

- Displays the communication status between AV control unit (master unit) and each unit.
- The error counter displays "OK" if any malfunction was not detected in the past and displays "0" if a malfunction is detected. It increases by 1 if the condition is normal at the next ignition switch ON cycle. The upper limit of the counter is 39.
- The error counter is erased if "Reset" is pressed.

Items	Status (Current)	Counter (Past)
C Tx(ITM-PrimarySW)	OK / ???	OK / 0 – 39
C Rx(PrimarySW–ITM)	OK / ???	OK / 0 - 39



NOTE:

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]

Α

D

Е

Н


M

ΑV

"???" indicates UNKWN


Hands-Free Phone

The hands-free phone reception volume adjustment and microphone and speaker test functions are also available.

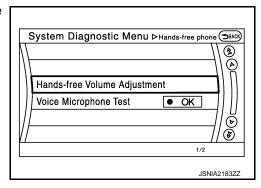


Camera Cont.

The four functions of "Correct Draw Line of Rear view Camera", "Alter/Confirm Configuration", "Reset Configuration" and "Camera Syst Type" are available.

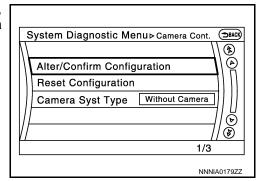

Correct Draw Line of Rear view Camera

 Use this mode to adjust the guide line display position of the rear view monitor if necessary after removing the rear view monitor camera.

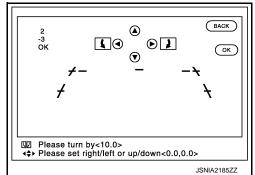

Alter/Confirm Configuration

• Configuration stored in the AV control unit can be checked and modified.

Configuration list

Setting item	Setting	Setting item	Setting
Predi. Course Lines	With	Wheelbase	2.5500000
Rear Coeff. K	-38009.06	Total Length	0.0000000
Rear Coeff. F	0.0014620	Steering Gear Ratio	15.192000
Rear Coeff. P1	0.0000062	Side Coeff. K	0.0000000
Rear Coeff. P2	0.0000056	Side Coeff. F	0.0000000
Rear Coeff. C1	823.00000	Side Coeff. P1	0.0000000
Rear Coeff. C2	480.00000	Side Coeff. P2	0.0000000
Rear Coeff. D1	800.00000	Side Coeff. C1	0.0000000
Rear Coeff. D2	494.00000	Side Coeff. C2	0.0000000
Car Width	1.8450000	Side Coeff. D1	0.0000000


< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]

Setting item	Setting	Setting item	Setting
Rear Offset	0.1900000	Side Coeff. D2	0.0000000
Rear Height	0.6886500	Side Offset	0.0000000
Rear L/R Angle	0.0000000	Overall Height	0.0000000
Rear Up/Dn Angle	47.900001	Side L/R Angle	0.0000000
Rear Roll Angle	0.0000000	Side Up/Dn Angle	0.0000000
Bumper Rear Dist.	0.0530000	Side Roll Angle	0.0000000
Bumper Rear Ax Dist	0.8630000	Side Front End Dist	0.0000000
Steer. Max Angle	492.75253	Total Width	0.0000000
Min. Turning Red.	5.0999999	_	_


Reset Configuration

Configuration stored in the AV control unit can be initialized.

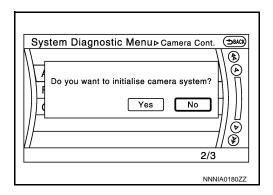


Camera Syst Type

Type of camera system is selectable.

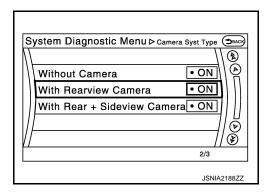

XM

- Change Channel
- Any necessary channels required to receive traffic information from the satellite radio system can be set.
- Change Application ID
- Any application ID'-s required to receive traffic information from the satellite radio system can be set.

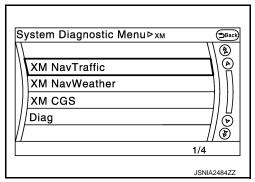

Delete Unit Connection Log

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]

Α

В

D

Е


F

Н

M

ΑV

Deletes any unit connection records and error records from the AV control unit memory. (Clear the records of the unit that has been removed.)

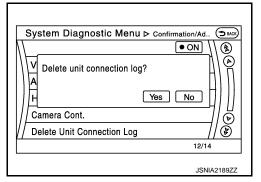


Initialize Settings

"User Data Initialization" and "Accessory Number Initialization" are possible.


CAUTION:

- Never perform Accessory Number Initialization except when configuration is unsuccessful.
- Accessory Number Initialization requires configuration. For details, refer to AV-176, "Description".

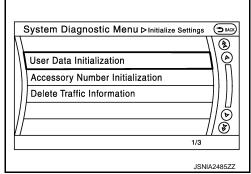

Version Information

Version information of the AV control unit is displayed.

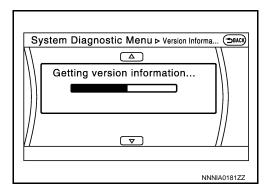

CONSULT Function (MULTI AV)

INFOID:0000000008195328

APPLICATION ITEMS

CONSULT performs the following functions via the communication with the AV control unit.

Diagnosis mode	Description	
Ecu Identification	The part number of AV control unit can be checked.	
Self Diagnostic Result	Performs a diagnosis on the AV control unit and a connection diagnosis for the communication circuit of the Multi AV system, and displays the current and past malfunctions collectively.	
Data Monitor	The diagnosis of vehicle signal that is input to the AV control unit can be performed.	
Work Support	Steering angle sensor can be adjusted.	
Configuration	 Read and save the vehicle specification. Write the vehicle specification when replacing AV control unit. 	

AV Communication

When "AV communication" of "CAN Diag Support Monitor" is selected, the following function will be performed.

AV communication	AV&NAVI C/U	Displays the communication status from AV control unit to each unit as well as the error counter.
	AUDIO	Displays the AV control unit communication status and the error counter.

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]

ECU IDENTIFICATION

The part number of AV control unit is displayed.

SELF DIAGNOSIS RESULT

- In CONSULT self-diagnosis, self-diagnosis results and error history are displayed collectively.
- The current malfunction indicates "CRNT". The past malfunction indicates "PAST".
- The timing is displayed as "0" if any of the error codes [U1000], [U1010], [U1300] and [U1310] is detected. The counter increases by 1 if the condition is normal at the next ignition switch ON cycle.

Self-diagnosis Results Display Item

Error item	Description	Possible malfunction factor/Action to take	
CAN COMM CIRCUIT [U1000]	CAN communication malfunction is detected.	Perform diagnosis with CONSULT, and then repair the malfunctioning parts according to the diagnosis results. Refer to AV-178, "Diagnosis Procedure"	
CONTROL UNIT (CAN) [U1010]	CAN initial diagnosis malfunction is detected.		
CONTROL UNIT (AV) [U1310]	AV communication circuit initial diagnosis malfunction is detected.		
Cont Unit [U1200]			
GYRO NO CONN [U1201]		Penlace the AV central unit if the malfune	
G-SENSOR NO CONN [U1202]		Replace the AV control unit if the malfunction occurs constantly.	
CAN CONT [U1216]	AV	-	
BLUETOOTH MODULE [U1217]	AV control unit malfunction is detected.		
SUB CPU CONN [U1228]			
iPod CERTIFICATION [U1229]			
Built-in AUDIO CONN [U122E]			
HDD CONN [U1218]		If the music box function has no mal-	
HDD READ [U1219]		 If the music box function has no mal- functions, then there is a possibility of the detection of a temporary malfunc- tion. 	
HDD WRITE [U121A]	AV control unit malfunction is detected.		
HDD COMM [U121B]		Replace the AV control unit if the mal-	
HDD ACCESS [U121C]		function occurs constantly.	
GPS COMM [U1204]		An intermittent error caused by strong ra- dio interference may be detected unless any symptom (GPS reception error, etc.) occurs.	
GPS ROM [U1205]			
GPS RAM [U1206]	GPS malfunction is detected.		
GPS RTC [U1207]		Replace the AV control unit if the malfunction occurs constantly.	
USB CONTROLLER [U1225]	USB connection malfunction is detected.	Check that the connection to the USB connector is normal.	
DSP CONN [U121D]		If a disc can be played, then there is a	
DSP COMM [U121E]	AV control unit malfunction is detected.	possibility of the detection of a temporary malfunction. Replace the AV control unit if the malfunction occurs constantly.	
DVD COMM [U1227]	AV control unit malfunction is detected.	 If DVD can be played, then there is a possibility of the detection of a temporary malfunction. Replace the AV control unit if the malfunction occurs constantly. 	
CONFIG UNFINISH [U122A]	The writing of configuration data is incomplete.	Write configuration data with CONSULT.	
ST ANGLE SEN CALIB [U1232]	Predictive course line center position adjustment of the steering angle sensor is incomplete.	Adjust the predictive course line center position of the steering angle sensor.	

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]

J

K

M

ΑV

Р

Error item	Description	Possible malfunction factor/Action to take
FRONT DISP CONN [U1243]	When either one of the following items are detected: • front display unit power supply and ground circuits malfunction is detected. • communication circuits between AV control unit and front display unit.	Front display unit power supply and ground circuits. Communication circuits between AV control unit and AV front display unit.
GPS ANTENNA CONN [U1244]	GPS antenna connection malfunction is detected.	Check the connection of the GPS antenna connector.
XM ANTENNA CONN [U1258]	Satellite radio antenna connection mal- function is detected.	Satellite radio antenna feeder. Satellite radio antenna.
USB OVERCURRENT [U1263]	Detection of over current in USB connecter.	Check USB harness between the AV control unit and USB connector.
ANTENNA AMP TERMINAL [U1264]	Radio antenna amp. ON signal circuit mal- function is detected.	Radio antenna amp. ON signal circuit between AV control unit and radio antenna amp.
AMP ON TERMINAL [U1265]	BOSE amp. ON signal circuit malfunction is detected.	BOSE amp. ON signal circuit between AV control unit and BOSE amp.
AV COMM CIRCUIT [U1300] SWITCH CONN [U1240]	 When either one of the following items are detected: multifunction switch power supply and ground circuits are malfunctioning. AV communication circuits between AV control unit and multifunction switch are malfunctioning. 	Multifunction switch power supply and ground circuits. AV communication circuits between AV control unit and multifunction switch.

DATA MONITOR

NOTE:

The following table includes information (items) inapplicable to this vehicle. For information (items) applicable to this vehicle, refer to CONSULT display items.

ALL SIGNALS

- Displays the status of the following vehicle signals inputted into the AV control unit.
- For each signal, actual signal can be compared with the condition recognized on the system.

Display Item	Display	Vehicle status	Remarks	
VHCL SPD SIG	On	Vehicle speed >0 km/h (0 MPH)		
VHCL 3FD 3IG	Off Vehicle speed =0 km/h (0 MPH)		Changes in indication may be delayed. This is	
PKB SIG	On	Parking brake is applied.	normal.	
PND SIG	Off	Parking brake is released.		
ILLUM SIG	On	Block the light beam from the auto light optical sensor when the light SW is ON.		
Off		Expose the auto light optical sensor to light when the light SW is OFF or ON.	_	
IGN SIG On Ignition switch ON				
IGN SIG	Off	Ignition switch in ACC position		
	On	Selector lever in R position	Changes in indication may be deleved. This is	
REV SIG	Off	Selector lever in any position other than R	Changes in indication may be delayed. This is normal.	
SIDE VIEW SW	Off	This item is displayed, but cannot be monitored.	_	
ROOM LAMP	Off	This item is displayed, but not used.	_	

SELECTION FROM MENU

< SYSTEM DESCRIPTION >

[BOSE AUDIO WITH NAVIGATION]

Allows the technician to select which vehicle signals should be displayed and displays the status of the selected vehicle signals.

Item to be selected	Description
VHCL SPD SIG	
PKB SIG	
ILLUM SIG	
IGN SIG	The same as when "ALL SIGNAL is selected.
REV SIG	
SIDE VIEW SW	
ROOM LAMP	

WORK SUPPORT

Adjusts the neutral position of the steering angle sensor.

CAUTION:

For vehicles with VDC, adjust the steering angle sensor neutral position on the ABS actuator control unit side. Refer to BRC-8, "ADJUSTMENT OF STEERING ANGLE SENSOR NEUTRAL POSITION: Special Repair Requirement".

ltem	Description
ST ANGLE SENSOR ADJUSTMENT	Adjusts the neutral position of the steering angle sensor.

CONFIGURATION

Configuration has three functions as follows.

Fu	nction	Description	
Read/Write Configuration	Before Replace ECU	Allows the reading of vehicle specification written in AV control unit to store the specification in CONSULT.	
Read/Write Corniguration	After Replace ECU	Allows the writing of the vehicle information stored in CONSULT into the AV control unit.	
Manual Configuration		Allows the writing of the vehicle specification into the AV control unit by hand.	

Α

D

Е

F

Н

K

M

ΑV

ECU DIAGNOSIS INFORMATION

AV CONTROL UNIT

Reference Value

VALUES ON THE DIAGNOSIS TOOL

NOTE:


The following table includes information (items) inapplicable to this vehicle. For information (items) applicable to this vehicle, refer to CONSULT display items.

CONSULT MONITOR ITEM

Monitor Item		Condition	Value/Status
VHCL SPD SIG	Ignition switch	Vehicle speed > 0 km/h (0 MPH)	On
VHCL SPD SIG	ON	Vehicle speed = 0 km/h (0 MPH)	Off
PKB SIG	Ignition switch	Parking brake is applied.	On
	ON	Parking brake is released.	Off
ILLUM SIG	Ignition switch	Light switch ON	On
ILLUW SIG	ON	Light switch OFF	Off
101.010	Ignition switch ON	_	On
IGN SIG	Ignition switch ACC	_	Off
REV SIG	Ignition switch	Selector lever in R position	On
KEV SIG	ON	Selector lever in any position other than R	Off
SIDE VIEW SW*	Ignition switch ON	_	Off
ROOM LAMP*	Ignition switch ON	_	Off

^{*:} This item is displayed, but cannot be monitored.

TERMINAL LAYOUT

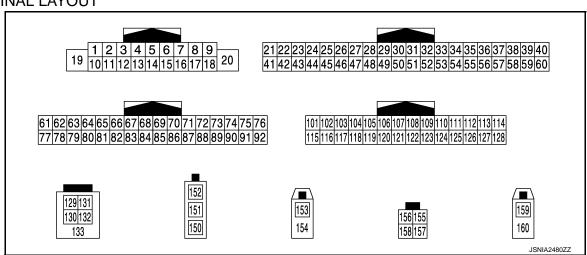

PHYSICAL VALUES

	minal e color)	Description			Condition	Reference value
+	_	Signal name	Input/ Output	Condition		(Approx.)
1 (V)	Ground	BOSE amp. ON signal	Output	Ignition switch ON	_	12.0 V
2 (LG)	3 (V)	Sound signal front LH	Output	Ignition switch ON	Sound output	(V) 1 0 -1 2ms SKIB3609E
4 (L)	5 (R)	Sound signal rear LH	Output	Ignition switch ON	Sound output	(V) 1 0 -1 + 2ms SKIB3609E
					Keep pressing SOURCE switch.	0 V
		Steering switch signal A	Input	Ignition switch ON	Keep pressing MENU UP switch.	1.0 V
6 (P)	15 (B)				Keep pressing MENU DOWN switch.	2.0 V
(1)	(D)				Keep pressing √ switch	3.0 V
					Keep pressing ENTER switch.	4.0 V
					Except for above.	5.0 V
7 (L)	Ground	ACC power supply	Input	Ignition switch ACC	_	Battery voltage
10	_	Shield	_	_	_	_
11 (L)	12 (P)	Sound signal front RH	Output	Ignition switch ON	Sound output	(V) 1 0 -1 + 2ms SKIB3609E
13 (R)	14 (G)	Sound signal rear RH	Output	Ignition switch ON	Sound output	(V) 1 0 -1 + 2ms SKIB3609E

< ECU DIAGNOSIS INFORMATION >

[BOSE AUDIO WITH NAVIGATION]

Α

В

D

Е

F

G

Κ

	minal e color)	Description			Condition	Reference value	
+	_	Signal name	Input/ Output		Condition	(Approx.)	
					Keep pressing VOL DOWN switch.	0 V	
16	15	Steering switch signal B	Input	Ignition switch	Keep pressing VOL UP switch.	1.0 V	
(L)	(B)	Steering Switch Signal B	input	ON	Keep pressing switch.	2.0 V	
					Keep pressing 5 switch.	3.0 V	
					Except for above.	5.0 V	
19 (Y)	Ground	Battery power supply	Input	Ignition switch OFF	_	Battery voltage	
20 (B)	Ground	Ground	_	Ignition switch ON	_	0 V	
22	Ground	Camera power supply	Output	Ignition switch	At rear view camera image is displayed.	6.0 V	
(R)				ON	Except for above.	0 V	
26 (LG)	Ground	AUX image signal	Input	Ignition switch ON	At AUX image is displayed.	(V) 0. 4 -0. 4 -0. 4 -0. 8 SKIB2251J	
29	Ground	Disk eject signal	Input	Ignition switch	Pressing the eject switch.	0 V	
(SB)	Cround	Diok ojoot digital	mpat	ON	Except for above.	5.0 V	
42 (B)	Ground	Camera ground	_	Ignition switch ON	_	0 V	
46 (V)	Ground	AUX image signal ground	_	Ignition switch ON	_	0 V	
47	_	Shield	_	_	_	_	
49 (BR)	Ground	Switch ground	_	Ignition switch ON	_	0 V	
65 (O)	Ground	Parking brake signal	Input	Ignition switch ON	Parking brake is ON. Parking brake is OFF.	5.0 V 0 V	
67 (L)	Ground	Composite image ground	_	Ignition switch ON	_	0 V	
68 (G)	Ground	Composite image signal	Output	Ignition switch ON	At DVD image is displayed.	(V) 0. 4 0 -0. 4 -0. 4 -0. 4	

		OIO INI OINIMATION >		ı			
	minal e color)	Description			Condition	Reference value	
+	_	Signal name	Input/ Output			(Approx.)	
72 (R)	Ground	Microphone VCC	Output	Ignition switch ON	_	5.0 V	
73 (G)	Ground	Communication signal (CONT→DISP)	Output	Ignition switch ON	When adjusting display brightness.	(V) 6 4 2 0	
74 (P)	_	CAN-L	Input/ Output	_	_	_	
75 (LG) ^{*1} (Y) ^{*2}	_	AV communication signal (L)	Input/ Output	_	_	_	
76 (LG)*1 (Y)*2	_	AV communication signal (L)	Input/ Output	_	_	_	
79				Ignition	Lighting switch is OFF.	0 V	
(R)	Ground	Illumination signal	Input	switch OFF	Lighting switch is ON.	12.0 V	
80 (G)	Ground	Ignition signal	Input	Ignition switch ON	_	Battery voltage	
81 (O)	Ground	Reverse signal	Input	Ignition switch ON	R position Other than R position	12.0 V 0 V	
82 (Y)	Ground	Vehicle speed signal (8-pulse)	Input	Ignition switch ON	When vehicle speed is approx. 40 km/h (25 MPH)	NOTE: Maximum voltage may be 12.0 V due to specifications (connected units).	
83	_	Shield	_	_	_	_	
84 (Y)	_	_	_	_	_	_	
87 (G)	71	Microphone signal	Input	Ignition switch ON	Give a voice	(V) 2.5 2.0 1.5 1.0 0.5 0	

< ECU DIAGNOSIS INFORMATION >

[BOSE AUDIO WITH NAVIGATION]

Α

В

С

D

Е

F

G

Н

Κ

L

 \mathbb{N}

0

Р

	minal color)	Description			Condition	Reference value	
+	_	Signal name	Input/ Output	Condition		(Approx.)	
89 (R)	Ground	Communication signal (DISP→CONT)	Input	Ignition switch ON	When adjusting display brightness.	(V) 6 4 2 0 ++1ms PKIB5039J	
90 (L)	_	CAN-H	Input/ Output	_	_		
91 (Y) ^{*1} (LG) ^{*2}	_	AV communication signal (H)	Input/ Output	_	_	_	
92 (Y) ^{*1} (LG) ^{*2}	_	AV communication signal (H)	Input/ Output	_	_	_	
104 (Y)	119 (L)	AUX sound signal LH	Input	Ignition switch ON	When AUX mode is selected.	(V) 1 0 -1 → 2ms SKIB3609E	
117	_	Shield	_	_	_	_	
118 (G)	119 (L)	AUX sound signal RH	Input	Ignition switch ON	When AUX mode is selected.	(V) 1 0 -1 + 2ms SKIB3609E	
129 (O)	_	USB ground	_	_	_	_	
130 (L)	_	USB D- signal	_	_	_		
131 (BR)	_	V BUS signal	_	_	_	_	
132 (R)	_	USB D+ signal	_	_	_	_	
133	_	Shield	_		_	_	
150		FM sub	Input		_	_	
151	_	AM-FM main	Input	_	_		
152	Ground	Antenna amp. ON signal	Input	Ignition switch ON	_	12.0 V	
153	Ground	GPS antenna signal	Input	Ignition switch ON	Not connected GPS antenna connector.	5.0 V	
154	_	Shield	_		_	_	

< ECU DIAGNOSIS INFORMATION >

[BOSE AUDIO WITH NAVIGATION]

	minal e color)	Description			Condition	Reference value
+	_	Signal name	Input/ Output		Condition	(Approx.)
157	Ground	RGB digital image signal (–)	Output	Ignition switch ON	Not connected connector.	1.3 V
158	Ground	RGB digital image signal (+)	Output	Ignition switch ON	Not connected connector.	1.3 V
159	Ground	Satellite radio antenna sig- nal	Input	Ignition switch ON	Not connected to satellite radio antenna connector.	5.0 V
160	_	Shield	_		_	_

^{*1:} Coupe models

Fail-Safe

When the ambiance temperature becomes extremely low or extremely high, AV control unit displays the message and limits the AV control unit function.

FAIL-SAFE CONDITIONS

When the ambiance temperature is -20°C (-4°F) or lower, or when it is 70°C (158°F) or higher

Display

The messages displayed on fail-safe conditions are as shown below:

Fail-safe mode	Display (display of the fail-safe condition)
When HDD temperature is low	HDD system is experiencing problems due to extreme low temperature. Normal operation will resume when temperature rises.
When HDD temperature is high	HDD system is experiencing problems due to extreme high temperature. Normal operation will resume when temperature drops.

DESCRIPTION OF CONTROLS

Function	1	When Fail-safe Function is activated					
Oper		Only multifunction switch (preset switch) can be operated.					
Air conditioner	Display	 LED of multifunction switch (preset switch) illuminates. Aimed temperature, blow angle, and flow rate are displayed in simplified mode. 					
Audio	Operation	only ON/OFF and volume control operations by multifunction switch (preset switch) are possible.					
Audio	Display	No display ("Fail-safe mode" is displayed)					
Hands-free phone	Operation	Cannot be operated.					
Navigation	Operation	Cannot be operated.					
Self diagnosis		The display in simplified mode of fail-safe condition					
CONSULT diagnosis	1	Cannot be operated.					

Ability Operation Mode

There is an ability operation mode for Fail-safes due to low or high ambiance temperature.

If HDD data can be read, fail-safe is shown, then normal displays are displayed only for functions which can be operated.

RELEASE CONDITIONS OF FAIL-SAFE

Fail-safe is released on following conditions and normal mode is restored.

When The Temperature of HDD Is Low or High

If the ambient temperature becomes out of fail-safe condition range, normal mode is restored.

^{*2:} Roadster models

[BOSE AUDIO WITH NAVIGATION]

Α

DTC Index


SELF-DIAGNOSIS RESULTS DISPLAY ITEM

DTC	Display item	Refer to	В
U1000	CAN COMM CIRCUIT [U1000]	AV-178, "Diagnosis Procedure"	
U1010	CONTROL UNIT (CAN) [1010]	AV-179, "DTC Logic"	0
U1200	Cont Unit [U1200]	AV-180, "DTC Logic"	
U1201	GYRO NO CONN [U1201]	AV-181, "DTC Logic"	
U1202	G-SENSOR NO CONN [U1202]	AV-182, "DTC Logic"	D
U1204	GPS COMM [U1204]	AV-183, "Diagnosis Procedure"	
U1205	GPS ROM [U1205]	AV-184, "Diagnosis Procedure"	_
U1206	GPS RAM [U1206]	AV-185, "Diagnosis Procedure"	Е
U1207	GPS RTC [U1207]	AV-186, "Diagnosis Procedure"	
U1216	CAN CONT [U1216]	AV-187, "DTC Logic"	F
U1217	BLUETOOTH MODULE [U1217]	AV-188, "DTC Logic"	
U1218	HDD CONN [U1218]	AV-189, "Diagnosis Procedure"	
U1219	HDD READ [U1219]	AV-190, "Diagnosis Procedure"	G
U121A	HDD WRITE [U121A]	AV-191, "Diagnosis Procedure"	
U121B	HDD COMM [U121B]	AV-192, "Diagnosis Procedure"	Н
U121C	HDD ACCESS [U121C]	AV-193, "Diagnosis Procedure"	
U121D	DSP CONN [U121D]	AV-194, "Diagnosis Procedure"	
U121E	DSP COMM [U121E]	AV-195, "Diagnosis Procedure"	
U1225	USB CONTROLLER [U1225]	AV-196, "DTC Logic"	
U1227	DVD COMM [U1227]	AV-197, "Diagnosis Procedure"	ı
U1228	SUB CPU CONN [U1228]	AV-198, "DTC Logic"	J
U1229	iPod CERTIFICATION [U1229]	AV-199, "DTC Logic"	
U122A	CONFIG UNFINISH [U122A]	AV-200, "Diagnosis Procedure"	K
U122E	Built-in AUDIO CONN [U122E]	AV-201, "DTC Logic"	
U1232	ST ANGLE SEN CALIB [1232]	AV-202, "Diagnosis Procedure"	
U1243	FRONT DISP CONN [U1243]	AV-203, "Diagnosis Procedure"	L
U1244	GPS ANTENNA CONN [U1244]	AV-205, "Diagnosis Procedure"	
U1258	XM ANTENNA CONN [U1258]	AV-206, "DTC Logic"	M
U1263	USB OVERCURRENT [U1263]	AV-207, "Diagnosis Procedure"	
U1264	ANTENNA AMP TERMINAL [U1264]	*AV-208, "COUPE : Diagnosis Procedure" (coupe models) *AV-208, "ROADSTER : Diagnosis Procedure" (roadster models) **Tourne of the coupe models of the coupe	AV
U1265	AMP ON TERMINAL [U1265]	AV-210, "Diagnosis Procedure"	0
U1310	CONTROL UNIT (AV) [U1310]	AV-212, "DTC Logic"	
U1300 U1240	AV COMM CIRCUIT [U1300] SWITCH CONN [U1240]	AV-211, "Description"	Р

FRONT DISPLAY UNIT

Reference Value

TERMINAL LAYOUT

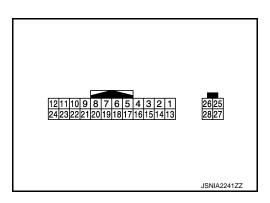

PHYSICAL VALUES

	minal color)	Description			Condition	Reference value	
+	_	Signal name	Input/ Output	Condition		(Approx.)	
6 (B)	_	Shield	_	_	_	_	
7	_	Shield	_	_	_	_	
8 (L)	Ground	Camera image signal	Input	Ignition switch ON	At rear view camera image is displayed.	(V) 0. 4 0 -0. 4 SKIB2251J	
9 (R)	Ground	Communication signal (DISP→CONT)	Output	Ignition switch ON	When adjusting display brightness.	(V) 6 4 2 0 	
10 (G)	Ground	Communication signal (CONT→DISP)	Input	Ignition switch ON	When adjusting display brightness.	(V) 4 2 0 +-1ms PKIB5039J	
11 (Y)	Ground	Battery power supply	Input	Ignition switch OFF	_	Battery voltage	
12 (B)	Ground	Ground	_	Ignition switch ON	_	0 V	

FRONT DISPLAY UNIT

< ECU DIAGNOSIS INFORMATION >

[BOSE AUDIO WITH NAVIGATION]

Terminal (Wire color)		Description			Condition	Reference value	
+	_	Signal name	Input/ Output		Condition	(Approx.)	
18 (G)	Ground	Composite image signal	Input	Ignition switch ON	At DVD image is displayed.	(V) 0. 4 0 -0. 4 SKIB2251J	
19 (L)	Ground	Composite image signal ground	_	Ignition switch ON	_	0 V	
20 (Y)	_	_	_	_	_	_	
23 (L)	Ground	ACC power supply	Input	_	_	_	
27	_	RGB digital image signal (–)	Input	_	_	_	
28	_	RGB digital image signal (+)	Input	_	_	_	

Н

Α

В

С

D

Е

F

G

|

K

L

 \mathbb{N}

ΑV

0


Р

COUPE

COUPE: Reference Value

INFOID:0000000008195333

TERMINAL LAYOUT

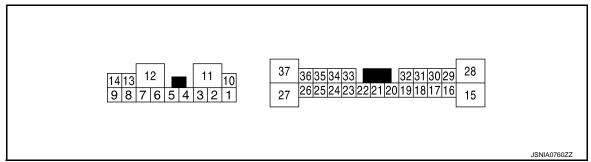

PHYSICAL VALUES

	minal color)	Description			Condition	Reference value (Approx.)	
+	_	Signal name	Input/ Output	Condition			
1 (L)	10 (V)	Sound signal front door speaker LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E	
2 (BG)	3 (G)	Sound signal front door speaker RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E	
4 (SB)	5 (V)	Sound signal woofer	Output	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKiB3609E	
6 (LG)	7 (GR)	Sound signal tweeter LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E	

-00	01/10110	ISIS INFORMATION >			[DIO WITH NAVIGATION]
	minal e color)	Description			Condition	Reference value
+	_	Signal name	Input/ Output		Condition	(Approx.)
9 (R)	14 (BR)	Sound signal rear speaker RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E
11 (Y)	Ground	Battery power supply	Input	Ignition switch OFF	_	Battery voltage
12 (B)	Ground	Ground	_	Ignition switch ON	_	0 V
15 (L)	28 (P)	Sound signal rear speaker LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 * * 2ms SKIB3609E
18 (P)	32 (L)	Sound signal front LH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 + + 2ms SKIB3609E
19 (R)	20 (G)	Sound signal front RH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E
21 (V)	22 (SB)	Sound signal rear LH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E
23 (BR)	33 (Y)	Sound signal rear RH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E

< ECU DIAGNOSIS INFORMATION >

[BOSE AUDIO WITH NAVIGATION]


	minal color)	Description		Condition		Reference value
+	_	Signal name	Input/ Output	Condition		(Approx.)
31 (W)	Ground	BOSE amp. ON signal	Input	Ignition switch ACC	_	12.0 V
37 (B)	27 (W)	Sound signal tweeter RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E

ROADSTER

ROADSTER: Reference Value

INFOID:0000000008195334

TERMINAL LAYOUT

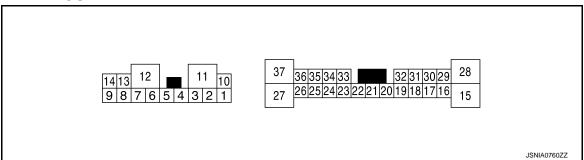

PHYSICAL VALUES

	minal color)	Description		Condition		Reference value
+	_	Signal name	Input/ Output		Condition	(Approx.)
1 (L)	10 (V)	Sound signal rear woofer LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 2ms SKIB3609E
2 (LG)	3 (Y)	Sound signal rear woofer RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E

	Terminal Description			Condition	Reference value	
+	_	Signal name	Input/ Output		Condition	(Approx.)
4 (L)	5 (V)	Sound signal front door speaker LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E
6 (LG)	7 (GR)	Sound signal tweeter LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E
8 (BG)	13 (G)	Sound signal front door speaker RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 → 2ms SKIB3609E
9 (LG)	14 (Y)	Sound signal rear speaker RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E
11 (Y)	Ground	Battery power supply	Input	Ignition switch OFF	_	Battery voltage
12 (B)	Ground	Ground	_	Ignition switch ON	_	0 V
15 (L)	28 (P)	Sound signal rear speaker LH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 ** 2ms SKIB3609E
17 (R)	Ground	Roof status signal (AUDIO)	Input	Ignition switch	Retractable soft top fully open	Battery voltage
(11)				ON	Retractable soft top other than above	0 V

	minal color)	Description			Condition	Reference value
+	_	Signal name	Input/ Output	Condition		(Approx.)
18 (P)	32 (L)	Sound signal front LH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E
19 (R)	20 (G)	Sound signal front RH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E
21 (V)	22 (SB)	Sound signal rear LH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E
23 (BR)	33 (Y)	Sound signal rear RH	Input	Ignition switch ON	Voice output	(V) 1 0 -1 + 2ms SKIB3609E
31 (W)	Ground	BOSE amp. ON signal	Input	Ignition switch ACC	_	12.0 V
37 (B)	27 (W)	Sound signal tweeter RH	Output	Ignition switch ON	Voice output	(V) 1 0 -1 → + 2ms SKIB3609E

BOSE AUDIO WITH NAVIGATION SYSTEM

< WIRING DIAGRAM >

[BOSE AUDIO WITH NAVIGATION]

WIRING DIAGRAM

BOSE AUDIO WITH NAVIGATION SYSTEM

Wiring Diagram

NOTE:

The name MULTIFUNCTION SWITCH indicates the integration of PRESET SWITCH and MULTIFUNCTION SWITCH virtually.

D

C

Α

Ε

F

Н

J

K

L

M

ΑV

0


Р


BOSE AUDIO WITH NAVIGATION SYSTEM


< WIRING DIAGRAM >

[BOSE AUDIO WITH NAVIGATION]

For connector terminal arrangements, harness layouts, and alphabets in a (option abbreviation; if not described in wiring diagram), refer to GI-12, "Connector Information".

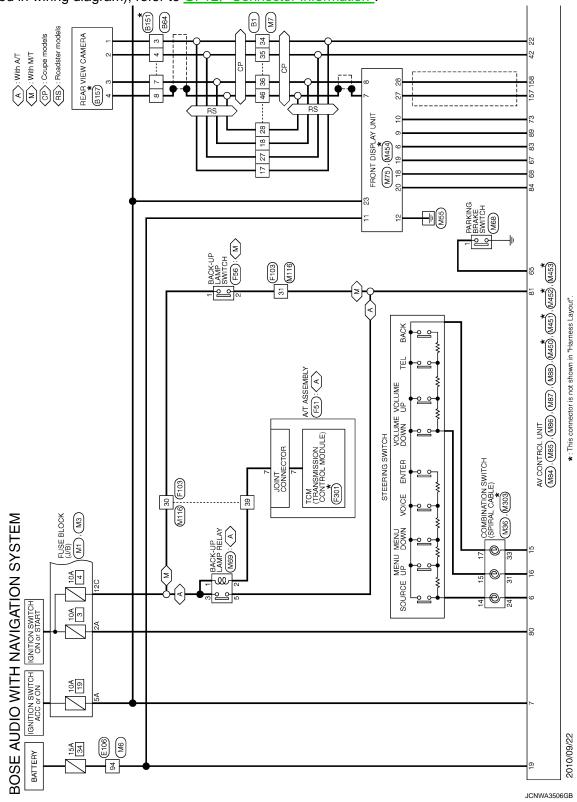


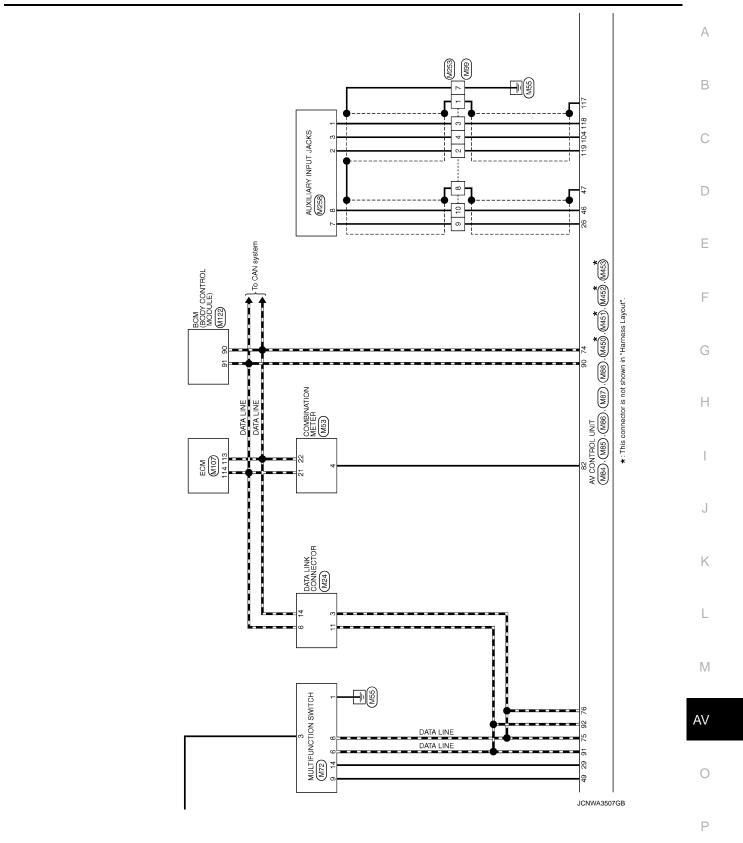


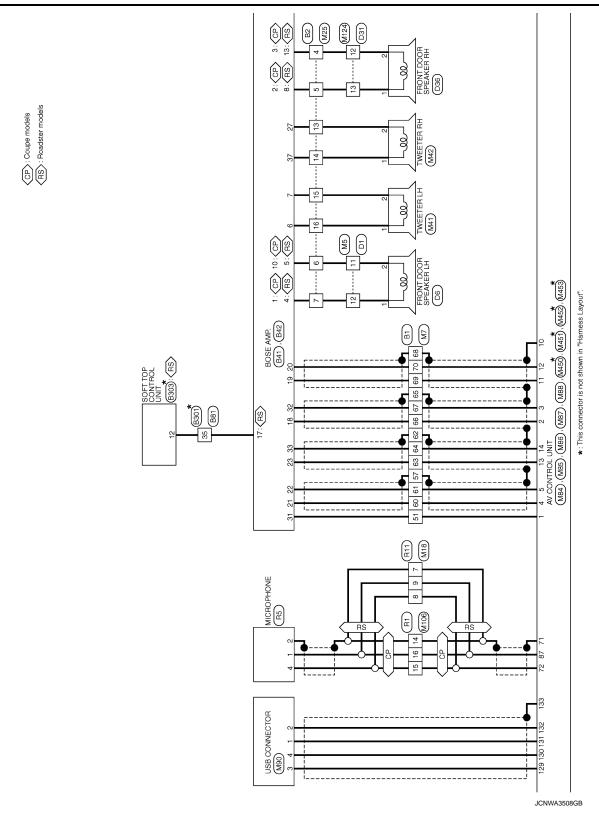

BOSE AUDIO WITH NAVIGATION SYSTEM

< WIRING DIAGRAM >

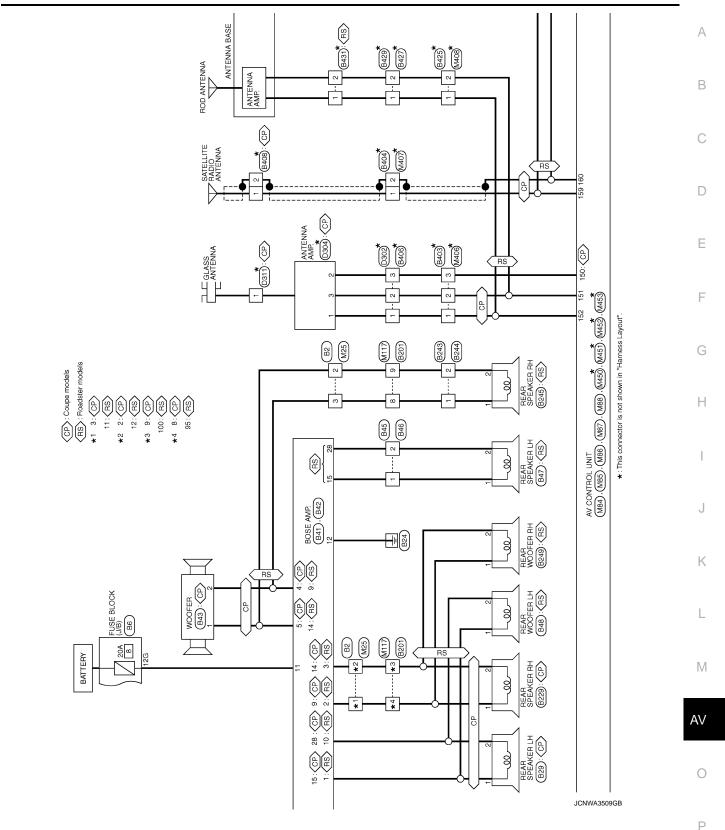

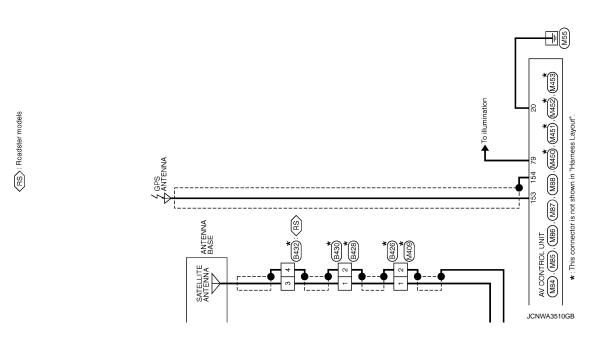

Α


D

BASIC INSPECTION

DIAGNOSIS AND REPAIR WORK FLOW

Work Flow

OVERALL SEQUENCE

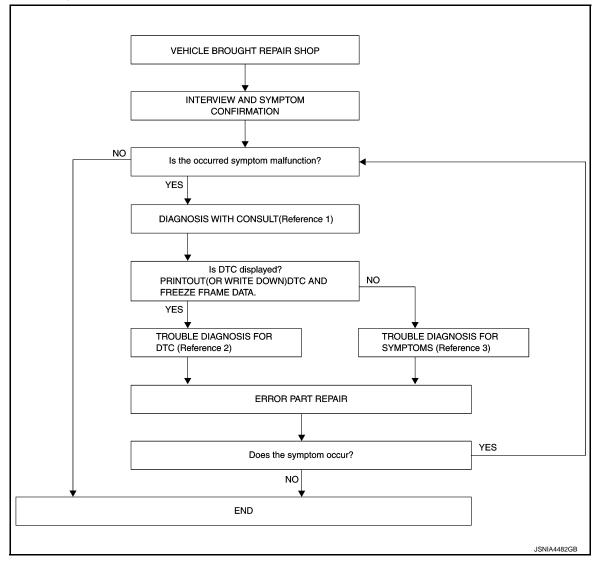

- Reference 1... Refer to <u>AV-149</u>, "CONSULT Function (MULTI AV)".
- Reference 2··· Refer to <u>AV-159</u>, "<u>DTC Index</u>".
- Reference 3... Refer to AV-229, "Symptom Table".

DETAILED FLOW

1.INTERVIEW AND SYMPTOM CONFIRMATION

Check the malfunction symptoms by performing the following items.

- Interview the customer to obtain the malfunction information (conditions and environment when the malfunction occurred).
- Check the symptom.

Is the occurred symptom malfunction?

YES >> GO TO 2.

NO >> INSPECTION END

2.DIAGNOSIS WITH CONSULT

DIAGNOSIS AND REPAIR WORK FLOW

< BASIC INSPECTION >

[BOSE AUDIO WITH NAVIGATION]

Connect CONSULT and perform a self-diagnosis for "MULTI AV". Refer to <u>AV-149</u>, "CONSULT Function (<u>MULTI AV</u>)".

NOTE:

Skip to step 4 of the diagnosis procedure if "MULTI AV" is not displayed.

- 2. When DTC is detected, follow the instructions below:
- Record DTC and Freeze Frame Data.

Is DTC displayed?

YES >> GO TO 3. NO >> GO TO 4.

3.trouble diagnosis for dtc

- 1. Check the DTC indicated in the self-diagnosis results.
- 2. Perform the relevant diagnosis referring to the DTC Index. Refer to AV-159, "DTC Index".

>> GO TO 5.

4. TROUBLE DIAGNOSIS FOR SYMPTOMS

Perform the relevant diagnosis referring to the diagnosis chart by symptom. Refer to <u>AV-229, "Symptom Table"</u>.

>> GO TO 5.

5. ERROR PART REPAIR

- 1. Repair or replace the identified malfunctioning parts.
- Perform a self-diagnosis for "MULTI AV" with CONSULT.

NOTE:

Erase the stored self-diagnosis results after repairing or replacing the relevant components if any DTC has been indicated in the self-diagnosis results.

3. Check that the symptom does not occur.

Does the symptom occur?

YES >> GO TO 1.

NO >> INSPECTION END

ADDITIONAL SERVICE WHEN REPLACING CONTROL UNIT

< BASIC INSPECTION >

[BOSE AUDIO WITH NAVIGATION]

ADDITIONAL SERVICE WHEN REPLACING CONTROL UNIT

Description INFOID:0000000008195337

BEFORE REPLACEMENT

When replacing AV control unit, save or print current vehicle specification with CONSULT configuration before replacement.

AFTER REPLACEMENT

CAUTION:

When replacing AV control unit, you must perform "After Replace ECU" or "Manual Configuration" with CONSULT.

- Complete the procedure of "After Replace ECU" or "Manual Configuration" in order.
- If you set incorrect "After Replace ECU" or "Manual Configuration", incidents might occur.
- Configuration is different for each vehicle model. Confirm configuration of each vehicle model.

Work Procedure

1. SAVING VEHICLE SPECIFICATION

CONSULT Configuration

Perform "Before Replace ECU" to save or print current vehicle specification. Refer to AV-176, "Description".

If "Before Replace ECU" can not be used, use the "Manual Configuration".

>> GO TO 2.

2.REPLACE AV CONTROL UNIT

Replace AV control unit. Refer to AV-243, "Removal and Installation".

>> GO TO 3.

3. WRITING VEHICLE SPECIFICATION

(P)CONSULT Configuration

Perform "After Replace ECU" or "Manual Configuration" to write vehicle specification. Refer to AV-176, "Work Procedure".

>> GO TO 4.

4. OPERATION CHECK

Check that the operation of the AV control unit and camera images (fixed guide lines and predictive course lines) are normal.

>> WORK END

ΑV

L

M

Α

В

C

D

Е

F

Н

0

Р

CONFIGURATION (AV CONTROL UNIT)

Description INFOID.000000008195339

• Since vehicle specifications are not included in the AV control unit after replacement, it is required to write vehicle specifications with CONSULT.

• The AV control unit configuration includes functions as follows.

Fu	inction	Description	
Read/Write Configuration	Before Replace ECU	Allows the reading of vehicle specification written in AV control unit o store the specification in CONSULT.	
Read/Write Corniguration	After Replace ECU	Allows the writing of the vehicle information stored in CONSULT into the AV control unit.	
Manual Configuration		Allows the writing of the vehicle specification into the AV control unit by hand.	

Work Procedure

1. WRITE VEHICLE SPECIFICATION

(P)CONSULT Configuration

Write vehicle specification into AV control unit.

To write vehicle specification stored in CONSULT into the AV control unit>>GO TO 2.

To write vehicle specification into the AV control unit by hand>>GO TO 3.

2. WRITE STORED DATA

©CONSULT Configuration

Select "After Replace ECU" in "Read/Write Configuration." Write data stored in CONSULT with the "Before Replace ECU" function into the AV control unit.

>> GO TO 4.

3. MANUALLY WRITE VEHICLE SPECIFICATION

(P)CONSULT Configuration

Perform "Manual Configuration." Refer to the Configuration List to write vehicle specification into the AV control unit. Refer to AV-176, "Configuration List".

NOTE:

If selection items are not displayed on the CONSULT screen, touch "NEXT."

>> GO TO 4.

4. OPERATION CHECK

Check that the operation of the AV control unit and camera images (fixed guide lines and predictive course lines) are normal.

>> WORK END

Configuration List

INFOID:0000000008195341

CAUTION:

Grasp vehicle specifications precisely. The control of ECU may not function normally if the specifications are normal.

NOTE:

- The items shown in this list depend on vehicle specifications.
- The config list may not be displayed depending on vehicle specifications. This is not a malfunction.

CONFIGURATION (AV CONTROL UNIT)

< BASIC INSPECTION >

[BOSE AUDIO WITH NAVIGATION]

MANUAL	SETTING ITEM
Items	Setting value
STEERING	LHD
STEERING	RHD
SOUND SYSTEM	BASE
200ND 2121EM	BOSE
	NONE/AVM
CAMERA SYSTEM	REAR
	REAR+SIDE

- AVM: Around view monitor
- Some manual setting items may not be displayed, depending on the vehicle specifications.

F

Α

В

D

Е

G

Н

-

J

K

L

M

ΑV

C

Р

U1000 CAN COMM CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

DTC/CIRCUIT DIAGNOSIS

U1000 CAN COMM CIRCUIT

Description INFOID:000000008195342

CAN (Controller Area Network) is a serial communication line for real-time application. It is an on-vehicle multiplex communication line with high data communication speed and excellent error detection ability. Many electronic control units are equipped onto a vehicle, and each control unit shares information and links with other control units during operation (not independently). In CAN communication, control units are connected with 2 communication lines (CAN-H, CAN-L) allowing a high rate of information transmission with less wiring. Each control unit transmits/receives data but selectively reads required data only.

CAN Communication Signal Chart. Refer to LAN-25, "CAN Communication Signal Chart".

DTC Logic

DTC DETECTION LOGIC

DTC	Display contents of CON- SULT	DTC detection condition	Probable malfunction location
U1000	CAN COMM CIRCUIT [U1000]	AV control unit is not transmitting or receiving CAN communication signal for 2 seconds or more.	CAN communication system.

Diagnosis Procedure

INFOID:0000000008195344

1. PERFORM SELF-DIAGNOSTIC

- 1. Turn ignition switch ON and wait for 2 seconds or more.
- 2. Check "Self Diagnostic Result" of "MULTI AV".

Is "CAN COMM CIRCUIT" displayed?

YES >> Refer to "LAN system". Refer to LAN-15, "Trouble Diagnosis Flow Chart".

NO >> Refer to GI section. Refer to GI-45, "Intermittent Incident".

U1010 CONTROL UNIT (CAN)

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1010 CONTROL UNIT (CAN)

DTC Logic

DTC DETECTION LOGIC

DTC	Display contents of CON- SULT	DTC detection condition	Probable malfunction factor
U1010	CONTROL UNIT (CAN) [U1010]	CAN initial diagnosis malfunction is detected.	Replace the AV control unit if the malfunction occurs constantly.

Е

D

Α

В

C

F

G

Н

1

J

Κ

L

M

ΑV

0

Р

U1200 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1200 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1200	Cont Unit [U1200]	AV control unit malfunction is detected.	Replace the AV control unit if the mal- function occurs constantly.

U1201 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1201 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1201	GYRO NO CONN [U1201]	AV control unit malfunction is detected.	Replace the AV control unit if the mal- function occurs constantly.

D

Α

В

С

Е

F

G

Н

J

Κ

L

M

ΑV

0

U1202 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1202 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1202	G-SENSOR NO CONN [U1202]	AV control unit malfunction is detected.	Replace the AV control unit if the mal- function occurs constantly.

U1204 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1204 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1204	GPS CONN [U1204]	GPS malfunction is detected.	An intermittent error caused by strong radio interference may be detected unless any symptom (GPS reception error, etc.) occurs. Replace the AV control unit if the malfunction occurs constantly.

Diagnosis Procedure

INFOID:0000000008195350

1. PERFORM THE SELF-DIAGNOSIS

- 1. Delete the "self-diagnosis" results of "MULTI AV". Turn ignition switch OFF.
- 2. Turn ignition switch ON. Perform the self-diagnosis again.
- 3. Check that the DTC is detected again.

Is any DTC detected?

YES >> Replace AV control unit.

NO >> An intermittent error caused by strong radio interference may be detected unless any symptom (GPS reception error, etc.) occurs.

Н

Α

В

D

Е

F

r\

L

M

ΑV

0

F

U1205 AV CONTROL UNIT

[BOSE AUDIO WITH NAVIGATION]

U1205 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1205	GPS ROM [U1205]	GPS malfunction is detected.	An intermittent error caused by strong radio interference may be detected unless any symptom (GPS reception error, etc.) occurs. Replace the AV control unit if the malfunction occurs constantly.

Diagnosis Procedure

INFOID:0000000008195352

1.PERFORM THE SELF-DIAGNOSIS

- 1. Delete the "self-diagnosis" results of "MULTI AV". Turn ignition switch OFF.
- 2. Turn ignition switch ON. Perform the self-diagnosis again.
- 3. Check that the DTC is detected again.

Is any DTC detected?

- YES >> Replace AV control unit.
- NO >> An intermittent error caused by strong radio interference may be detected unless any symptom (GPS reception error, etc.) occurs.

U1206 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1206 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1206	GPS RAM [U1206]	GPS malfunction is detected.	An intermittent error caused by strong radio interference may be detected unless any symptom (GPS reception error, etc.) occurs. Replace the AV control unit if the malfunction occurs constantly.

Diagnosis Procedure

INFOID:0000000008195354

1. PERFORM THE SELF-DIAGNOSIS

- 1. Delete the "self-diagnosis" results of "MULTI AV". Turn ignition switch OFF.
- 2. Turn ignition switch ON. Perform the self-diagnosis again.
- 3. Check that the DTC is detected again.

Is any DTC detected?

YES >> Replace AV control unit.

NO >> An intermittent error caused by strong radio interference may be detected unless any symptom (GPS reception error, etc.) occurs.

Н

Α

В

D

Е

F

r\

L

M

ΑV

F

U1207 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1207 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1207	GPS RTC [U1207]	GPS malfunction is detected.	An intermittent error caused by strong radio interference may be detected unless any symptom (GPS reception error, etc.) occurs. Replace the AV control unit if the malfunction occurs constantly.

Diagnosis Procedure

INFOID:0000000008195356

1. PERFORM THE SELF-DIAGNOSIS

- 1. Delete the "self-diagnosis" results of "MULTI AV". Turn ignition switch OFF.
- 2. Turn ignition switch ON. Perform the self-diagnosis again.
- 3. Check that the DTC is detected again.

Is any DTC detected?

- YES >> Replace AV control unit.
- NO >> An intermittent error caused by strong radio interference may be detected unless any symptom (GPS reception error, etc.) occurs.

U1216 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1216 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1216	CAN CONT [U1216]	AV control unit malfunction is detected.	Replace the AV control unit if the mal- function occurs constantly.

D

Α

В

С

Е

F

G

Н

|

J

Κ

L

M

ΑV

0

U1217 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1217 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1217	BLUETOOTH MODULE [U1217]	AV control unit malfunction is detected.	Replace the AV control unit if the mal- function occurs constantly.

U1218 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1218 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1218	HDD CONN [U1218]	AV control unit malfunction is detected.	 If the music box function has no malfunctions, then there is a possibility of the detection of a temporary malfunction. Replace the AV control unit if the malfunction occurs constantly.

Diagnosis Procedure

INFOID:0000000008195360

1. CHECK MUSIC BOX FUNCTION

Is music box function normal?

YES >> Malfunction may be detected transitory.

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

G

Α

В

D

Е

F

Н

Κ

L

M

AV

0

U1219 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1219 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1219	HDD READ [U1219]	AV control unit malfunction is detected.	 If the music box function has no malfunctions, then there is a possibility of the detection of a temporary malfunction. Replace the AV control unit if the malfunction occurs constantly.

Diagnosis Procedure

INFOID:0000000008195362

1. CHECK MUSIC BOX FUNCTION

Is music box function normal?

YES >> Malfunction may be detected transitory.

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

U121A AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U121A AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U121A	HDD WRITE [U121A]	AV control unit malfunction is detected.	 If the music box function has no malfunctions, then there is a possibility of the detection of a temporary malfunction. Replace the AV control unit if the malfunction occurs constantly.

Diagnosis Procedure

INFOID:0000000008195364

1. CHECK MUSIC BOX FUNCTION

Is music box function normal?

YES >> Malfunction may be detected transitory.

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

G

Α

В

D

Е

F

Н

Κ

L

M

ΑV

0

U121B AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U121B AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U121B	HDD COMM [U121B]	AV control unit malfunction is detected.	 If the music box function has no malfunctions, then there is a possibility of the detection of a temporary malfunction. Replace the AV control unit if the malfunction occurs constantly.

Diagnosis Procedure

INFOID:0000000008195366

1. CHECK MUSIC BOX FUNCTION

Is music box function normal?

YES >> Malfunction may be detected transitory.

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

U121C AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U121C AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U121C	HDD ACCESS [U121C]	AV control unit malfunction is detected.	 If the music box function has no malfunctions, then there is a possibility of the detection of a temporary malfunction. Replace the AV control unit if the malfunction occurs constantly.

Diagnosis Procedure

INFOID:0000000008195368

1. CHECK MUSIC BOX FUNCTION

Is music box function normal?

YES >> Malfunction may be detected transitory.

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

G

Α

В

D

Е

F

Н

J

K

L

M

ΑV

0

U121D AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U121D AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U121D	DSP CONN [U121D]	AV control unit malfunction is detected.	 If a disc can be played, then there is a possibility of the detection of a temporary malfunction. Replace the AV control unit if the malfunction occurs constantly.

Diagnosis Procedure

INFOID:0000000008195370

1. CHECK PLAYBACK OF A DISK (CD)

Can a disk (CD) be played?

YES >> Malfunction may be detected transitory.

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

U121E AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U121E AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U121E	DSP COMM [U121E]	AV control unit malfunction is detected.	 If a disc can be played, then there is a possibility of the detection of a temporary malfunction. Replace the AV control unit if the malfunction occurs constantly.

Diagnosis Procedure

INFOID:0000000008195372

1. CHECK PLAYBACK OF A DISK (CD)

Can a disk (CD) be played?

YES >> Malfunction may be detected transitory.

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

G

Α

В

C

D

Е

F

Н

K

-

M

ΑV

U1225 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1225 AV CONTROL UNIT

DTC Logic

DTC DETECTION LOGIC

DTC	Display contents of CON- SULT	DTC detection condition	Possible malfunction factor
U1225	USB CONTROLLER [U1225]	USB connection malfunction is detected.	Check that the connection to the USB connector is normal.

U1227 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1227 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1227	DVD COMM [U1227]	AV control unit malfunction is detected.	 If DVD can be played, then there is a possibility of the detection of a temporary malfunction. Replace the AV control unit if the malfunction occurs constantly.

Diagnosis Procedure

INFOID:0000000008195375

1. CHECK PLAYBACK OF A DISK (DVD)

Can a disc (DVD) be played?

YES >> Malfunction may be detected transitory.

NO >> Replace AV control unit. Refer to AV-243. "Removal and Installation".

G

Α

В

C

D

Е

F

Н

K

L

M

ΑV

0

U1228 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1228 AV CONTROL UNIT

DTC Logic

DTC DETECTION LOGIC

DTC	Display contents of CON- SULT	DTC detection condition	Possible malfunction factor
U1228	SUB CPU CONN [U1228]	AV control unit malfunction is detected.	Replace the AV control unit if the malfunction occurs constantly.

U1229 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1229 AV CONTROL UNIT

DTC Logic

DTC DETECTION LOGIC

DTC	Display contents of CON- SULT	DTC detection condition	Possible malfunction factor
U1229	iPod CERTIFICATION [U1229]	AV control unit malfunction is detected.	Replace the AV control unit if the malfunction occurs constantly.

D

Α

В

С

Е

F

G

Н

K

L

M

ΑV

0

U122A AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U122A AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Action to take
U122A	CONFIG UNFINISH [U122A]	The writing of configuration data is incomplete.	Write configuration data with "MULTI AV" of CONSULT.

Diagnosis Procedure

INFOID:0000000008195379

1.PERFORM THE SELF-DIAGNOSIS

When U122A is detected, write configuration data with "MULTI AV" of CONSULT.

>> Write configuration data with "MULTI AV" of CONSULT. Refer to AV-176, "Work Procedure".

U122E AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U122E AV CONTROL UNIT

DTC Logic

DTC DETECTION LOGIC

DTC	Display contents of CON- SULT	DTC detection condition	Possible malfunction factor
U122E	Built-in AUDIO CONN [U122E]	AV control unit malfunction is detected.	Replace the AV control unit if the malfunction occurs constantly.

D

Е

Α

В

С

F

G

Н

ı

K

L

 \mathbb{N}

ΑV

0

U1232 STEERING ANGLE SENSOR

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1232 STEERING ANGLE SENSOR

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1232	ST ANGLE SEN CALIB [1232]	Predictive course line center position adjustment of the steering angle sensor is incomplete.	Adjust the predictive course line center position of the steering angle sensor.

Diagnosis Procedure

INFOID:0000000008195382

1.adjust the predictive course line center position of the steering angle sensor

When U1232 is detected, adjust the predictive course line center position of the steering angle sensor.

>> Adjusts the steering angle sensor neutral position on ABS actuator and electrical unit (control unit) side. Refer to BRC-8, "ADJUSTMENT OF STEERING ANGLE SENSOR NEUTRAL POSITION: Special Repair Requirement".

U1243 DISPLAY UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1243 DISPLAY UNIT

DTC Logic INFOID:0000000008195383

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1243	FRONT DISP CONN [U1243]	When either one of the following items are detected: display unit power supply and ground circuit malfunction is detected. communication circuit between AV control unit and display unit.	 Display unit power supply and ground circuit. Communication circuit between AV control unit and display unit.

Diagnosis Procedure

INFOID:0000000008195384

Α

В

D

Е

F

Н

1. CHECK FRONT DISPLAY UNIT POWER SUPPLY AND GROUND CIRCUIT

Check front display unit power supply and ground circuit. Refer to AV-213, "FRONT DISPLAY UNIT: Diagnosis Procedure".

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair malfunctioning parts.

2.check continuity communication circuit

- 1. Turn ignition switch OFF.
- Disconnect front display unit connector and AV control unit connector. 2.
- Check continuity between front display unit harness connector and AV control unit harness connector.

Front display unit		AV control unit		Continuity	
Connector	Terminals	Connector Terminals		Continuity	
M75	9	M86	89	Existed	
IVITS	10	IVIOO	73		

Check continuity between front display unit harness connector and ground.

Front display unit			Continuity
Connector	Terminals	Ground	Continuity
MZE	M75	Giodila	Not existed
M75	10		Not existed

Is the inspection result normal?

YES >> GO TO 3.

NO >> Repair harness or connector.

3.CHECK COMMUNICATION SIGNAL

- Connect front display unit connector and AV control unit connector. 1.
- 2. Turn ignition switch ON.
- Check signal between front display unit harness connector and ground.

AV-203 Revision: 2012 August 2013 370Z

ΑV

Р

M

U1243 DISPLAY UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

(+) Front display unit		(-)	Condition	Reference value	
Connector	Terminal				
M75	9	Ground	When adjusting display brightness.	(V) 6 4 2 0 • • • 1ms	

Is the inspection result normal?

YES >> GO TO 4.

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

4. CHECK COMMUNICATION SIGNAL

Check signal between front display unit harness connector and ground.

(+) Front display unit		(-)	Condition	Reference value	
Connector	nector Terminal				
M75	10	Ground	When adjusting display brightness.	(V) 6 4 2 0 + 1ms PKIB5039J	

Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace front display unit. Refer to AV-245, "Removal and Installation".

U1244 GPS ANTENNA

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1244 GPS ANTENNA

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1244	GPS ANTENNA CONN [U1244]	GPS antenna connection malfunction is detected.	Check the connection of the GPS antenna connector.

Diagnosis Procedure

INFOID:0000000008195386

Α

В

C

D

Е

F

Н

1.GPS ANTENNA CHECK

Visually check GPS antenna and antenna feeder.

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair malfunctioning parts.

2. CHECK AV CONTROL UNIT VOLTAGE

- 1. Disconnect GPS antenna connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between AV control unit and ground.

(+) AV control unit Terminal	(-)	Voltage (Approx.)
153	Ground	5.0 V

Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

ΑV

M

K

(

U1258 SATELLITE RADIO ANTENNA

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1258 SATELLITE RADIO ANTENNA

DTC Logic

DTC	Display contents of CONSULT	DTC Detection Condition	Possible causes
U1258	XM ANTENNA CONN [U1258]	Satellite radio antenna connection malfunction is detected.	Satellite radio antenna feeder.Satellite radio antenna.

Diagnosis Procedure

INFOID:0000000008195388

1. SATELLITE RADIO ANTENNA CHECK

Visually check satellite radio antenna and antenna feeder.

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair malfunctioning parts.

2. CHECK AV CONTROL UNIT VOLTAGE

- 1. Disconnect satellite radio antenna connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between AV control unit terminal and ground.

(+)		V 16	
AV control unit	(–)	Voltage (Approx.)	
Terminal	()	(11 -)	
160	Ground	5.0 V	

Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

U1263 USB

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1263 USB

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1263	USB OVERCURRENT [U1263]	Detection of over current in USB connector.	Check USB harness between the AV control unit and USB connector.

Diagnosis Procedure

INFOID:0000000008195390

1. CHECK USB HARNESS

Visually check USB harness.

Is the inspection result normal?

YES >> Replace AV control unit. Refer to AV-243, "Removal and Installation"

NO >> Replace USB harness.

F

Α

В

C

D

Е

G

Н

ı

J

K

L

M

ΑV

0

U1264 ANTENNA AMP.

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1264	ANTENNA AMP TER- MINAL [U1264]	Radio antenna amp. ON circuit is open or shorted.	 Check antenna amp. ON signal circuit between the AV control unit and radio antenna amp. (coupe models) Check antenna amp. ON signal circuit between the AV control unit and antenna base. (roadster models)

COUPE

COUPE: Diagnosis Procedure

INFOID:0000000008195392

- 1. CHECK CONTINUITY BETWEEN AV CONTROL UNIT AND ANTENNA AMP.
- 1. Turn ignition switch OFF.
- 2. Disconnect antenna amp. connector and AV control unit connector.
- 3. Check continuity between AV control unit harness connector and antenna amp. harness connector.

AV control unit		Antenna amp.		Continuity
Connector	Terminals	Connector	Terminals	Continuity
M450	152	D304	1	Existed

4. Check continuity between AV control unit harness connector and ground.

AV control unit			Continuity
Connector	Terminals	Ground	Continuity
M450	152		Not existed

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK VOLTAGE AV CONTROL UNIT

- Connect AV control unit connector.
- Turn ignition switch ON.
- 3. Check voltage between AV control unit harness connector and ground.

(+)			Voltage (Approx.)
AV control unit		(–)	
Connector	Terminals		(11 /
M450	152	Ground	12.0 V

Is the inspection result normal?

YES >> Replace antenna amp. Refer to AV-253, "Removal and Installation".

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

ROADSTER

ROADSTER: Diagnosis Procedure

INFOID:0000000008195393

1. CHECK CONTINUITY BETWEEN AV CONTROL UNIT AND ANTENNA BASE

U1264 ANTENNA AMP.

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

- 1. Turn ignition switch OFF.
- 2. Disconnect antenna base connector and AV control unit connector.
- 3. Check continuity between AV control unit harness connector and antenna base harness connector.

AV control unit		Antenna base		Continuity	
Connector	Terminals	Connector	Terminals	Continuity	
M450	152	B431	1	Existed	

4. Check continuity between AV control unit harness connector and ground.

AV control unit Connector Terminals			Continuity	
		Ground		
M450	152		Not existed	

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK VOLTAGE AV CONTROL UNIT

- 1. Connect AV control unit connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between AV control unit harness connector and ground.

AV control unit		(-)	Voltage	
Connector	Terminals	()	(Approx.)	
M450	152	Ground	12.0 V	

Is the inspection result normal?

YES >> Replace antenna base Refer to AV-254, "Removal and Installation".

NO >> Replace AV control unit. Refer to <u>AV-243, "Removal and Installation"</u>.

L

K

Α

В

D

Е

F

Н

 \mathbb{N}

ΑV

0

U1265 BOSE AMP.

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1265	AMP ON TERMINAL [U1265]	BOSE amp. ON circuit is open or shorted.	Check BOSE amp. ON signal circuit between the AV control unit and BOSE amp.

Diagnosis Procedure

INFOID:0000000008195395

1. CHECK CONTINUITY BETWEEN AV CONTROL UNIT AND BOSE AMP.

- 1. Turn ignition switch OFF.
- 2. Disconnect BOSE amp. connector and AV control unit connector.
- 3. Check continuity between AV control unit harness connector and BOSE amp. harness connector.

AV control unit		BOSE amp.		Continuity
Connector	Terminals	Connector	Terminals	Continuity
M84	1	B41	31	Existed

4. Check continuity between AV control unit harness connector and ground.

AV control unit			Continuity	
Connector	Terminals	Ground	Continuity	
M84	1		Not existed	

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK VOLTAGE AV CONTROL UNIT

- 1. Connect AV control unit connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between AV control unit harness connector and ground.

(+)			Voltage (Approx.)	
AV control unit		(–)		
Connector	Terminals		(11 -)	
M84	1	Ground	12.0 V	

Is the inspection result normal?

YES >> Replace BOSE amp. Refer to <u>AV-251, "COUPE: Removal and Installation"</u> (coupe type), or <u>AV-251, "ROADSTER: Removal and Installation"</u> (roadster models).

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

U1300 AV COMM CIRCUIT

[BOSE AUDIO WITH NAVIGATION]

U1300 AV COMM CIRCUIT

Description INFOID:0000000008195396

U1300 is indicated when malfunction occurs in communication signal of multi AV system. Indicated simultaneously, without fail, with the malfunction of control units connected to AV control unit with communication line. Determine the possible malfunction cause from the table below.

SELF-DIAGNOSIS RESULTS DISPLAY ITEM

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1300 U1240	AV COMM CIRCUIT [U1300] SWITCH CONN [U1240]	 When either one of the following items are detected: Multifunction switch power supply and ground circuits are malfunctioning. AV communication circuits between AV control unit and multifunction switch are malfunctioning. 	 Multifunction switch power supply and ground circuits. AV communication circuits between AV control unit and multifunction switch.

F

Α

C

D

Е

G

Н

1

J

K

L

M

ΑV

0

U1310 AV CONTROL UNIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

U1310 AV CONTROL UNIT

DTC Logic

DTC	Display contents of CONSULT	DTC detection condition	Possible malfunction factor
U1310	CONTROL UNIT (AV) [U1310]	An initial diagnosis error is detected in AV communication circuit.	Replace AV control unit. If the mal- function occurs constantly.

POWER SUPPLY AND GROUND CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

POWER SUPPLY AND GROUND CIRCUIT AV CONTROL UNIT

INFOID:0000000008195398

Α

В

D

Е

AV CONTROL UNIT: Diagnosis Procedure

1.CHECK FUSE

Check for blown fuses.

Power source	Fuse No.
Battery	34
Ignition switch ACC or ON	19

Is the inspection result normal?

YES >> GO TO 2.

NO >> Be sure to eliminate cause of malfunction before installing new fuse.

2 CHECK POWER SUPPLY CIRCUIT

Check voltage between AV control unit harness connectors and ground.

Signal name	Connector No.	Terminal No.	Ignition switch position	Value (Approx.)
Battery power supply	M84	19	OFF	Battery voltage
ACC power supply	10104	7	ACC	Battery voltage

Is the inspection result normal?

YES >> GO TO 3.

>> Check harness between AV control unit and fuse. NO

3. CHECK GROUND CIRCUIT

Turn ignition switch OFF.

- Disconnect AV control unit connectors.
- Check continuity between AV control unit harness connectors and ground.

Signal name	Connector No.	Terminal No.	Ignition switch position	Continuity
Ground	M84	20	OFF	Existed

Is the inspection result normal?

>> INSPECTION END YES

NO >> Repair harness or connector.

FRONT DISPLAY UNIT

FRONT DISPLAY UNIT: Diagnosis Procedure

INFOID:0000000008195399

1.CHECK FUSE

Check for blown fuses.

Power source	Fuse No.
Battery	34
Ignition switch ACC or ON	19

Is the inspection result normal?

YES >> GO TO 2.

NO >> Be sure to eliminate cause of malfunction before installing new fuse.

2. CHECK POWER SUPPLY CIRCUIT

Check voltage between front display unit harness connector and ground.

AV-213 Revision: 2012 August 2013 370Z

M

POWER SUPPLY AND GROUND CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Signal name	Connector No.	Terminal No.	Ignition switch position	Value (Approx.)
Battery power supply	M75	11	OFF	Battery voltage
ACC power supply	IVI7 5	23	ACC	Dattery Voltage

Is the inspection result normal?

YES >> GO TO 3.

NO >> Check harness between front display unit and fuse.

3.CHECK GROUND CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect front display unit connector.
- 3. Check continuity between front display unit harness connector and ground.

Signal name	Connector No.	Terminal No.	Ignition switch position	Continuity
Ground	M75	12	OFF	Existed

Is the inspection result normal?

YES >> INSPECTION END

NO >> Repair harness or connector.

BOSE AMP.

BOSE AMP.: Diagnosis Procedure

INFOID:0000000008195400

1. CHECK FUSE

Check for blown fuses.

Power source	Fuse No.
Battery	8

Is the inspection result normal?

YES >> GO TO 2.

NO >> Be sure to eliminate the cause of malfunction before installing new fuse.

2.CHECK POWER SUPPLY CIRCUIT

Check voltage between BOSE amp. harness connector and ground.

Signal name	Connector No.	Terminal No.	Ignition switch position	Voltage (Approx.)
Battery power supply	B42	11	OFF	Battery voltage

Is the inspection result normal?

YES >> GO TO 3.

NO >> Check harness between BOSE amp. and fuse.

3. CHECK GROUND CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect BOSE amp. connector.
- 3. Check continuity between BOSE amp. harness connector and ground.

Signal name	Connector No.	Terminal No.	Ignition switch position	Continuity
Ground	B42	12	OFF	Existed

Is the inspection result normal?

YES >> INSPECTION END

NO >> Repair harness or connector.

RGB DIGITAL IMAGE SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

RGB DIGITAL IMAGE SIGNAL CIRCUIT

Description INFOID:000000008195401

Transmit the image displayed with AV control unit with RGB digital image signal to the front display unit.

Diagnosis Procedure

1. CHECK CONTINUITY RGB DIGITAL IMAGE SIGNAL CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect front display unit connector and AV control unit connector.
- 3. Check continuity between front display unit harness connector and AV control unit harness connector.

Front dis	Front display unit		trol unit	Continuity
Connector	Terminals	Connector	Terminals	Continuity
M454	27	M452	157	Existed
IVI 4 54	28	101452	158	Existed

4. Check continuity between front display unit harness connector and ground.

Front dis	splay unit		Continuity
Connector	Terminals	Ground	Continuity
M454	27	Giodila	Not existed
IVI454	28		Not existed

Is the inspection result normal?

YES >> GO TO 2

NO >> Repair harness or connector.

2.CHECK RGB DIGITAL IMAGE SIGNAL

- 1. Connect AV control unit connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between front display unit harness connector and ground.

(-	+)			V 16
Front dis	splay unit	(–)	Condition	Voltage (Approx.)
Connector	Terminal			('FF'')
M454	27	Ground	Not connected connector.	1.3 V
141414	28	Giouria	not connected connector.	1.3 V

Is the inspection result normal?

YES >> Replace front display unit. Refer to AV-245, "Removal and Installation".

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

A\/

M

K

Α

В

D

Е

F

INFOID:0000000008195402

COMPOSITE IMAGE SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

COMPOSITE IMAGE SIGNAL CIRCUIT

Description INFOID:000000008195403

AV control unit transmits the playback DVD image signal and AUX image signal to the front display unit.

Diagnosis Procedure

INFOID:0000000008195404

1. CHECK CONTINUITY COMPOSITE IMAGE SIGNAL CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect AV control unit connector and front display unit connector.
- 3. Check continuity between AV control unit harness connector and front display unit harness connector.

AV control unit		Front display unit		Continuity
Connector	Terminal	Connector Terminal		Continuity
M86	68	M75	18	Existed

4. Check continuity between AV control unit harness connector and ground.

AV cor	trol unit		Continuity
Connector	Terminal	Ground	Continuity
M86	68		Not existed

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2. CHECK AUX COMPOSITE SIGNAL

- 1. Connect AV control unit connector and front display unit connector.
- 2. Turn ignition switch ON.
- 3. Check signal between auxiliary input jacks harness connector and ground.

	+) atrol unit	(–)	Condition	Reference value
Connector	Terminal			
M86	68	Ground	At DVD image is displayed.	(V) 0. 4 0 -0. 4 → 40µs SKiB2251J

Is the inspection result normal?

YES >> Replace front display unit. Refer to AV-245. "Removal and Installation".

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

AUX IMAGE SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

AUX IMAGE SIGNAL CIRCUIT

Description INFOID:000000008195405

- Transmits the image signal of AUX device from auxiliary input jacks to AV control unit.
- AV control unit transmits the image signal that is input to the front display unit.

Diagnosis Procedure

INFOID:0000000008195406

Α

В

D

Е

F

1. CHECK CONTINUITY AUX IMAGE SIGNAL CIRCUIT

- Turn ignition switch OFF.
- 2. Disconnect auxiliary input jacks connector and AV control unit connector.
- 3. Check continuity between auxiliary input jacks harness connector and AV control unit harness connector.

Auxiliary	input jacks	AV control unit		Continuity
Connector	Terminal	Connector Terminal		Continuity
M258	7	M85	26	Existed

4. Check continuity between auxiliary input jacks harness connector and ground.

Auxiliary	input jacks		Continuity
Connector	Terminal	Ground	Continuity
M258	7		Not existed

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK AUX IMAGE SIGNAL

- Connect auxiliary input jacks connector and AV control unit connector.
- 2. Turn ignition switch ON.
- 3. Check signal between auxiliary input jacks harness connector and ground.

Auxiliary i	nput jacks	(-)	Condition	Reference value
Connector	Terminal			
M258	7	Ground	At AUX image is displayed.	(V) 0. 4 -0. 4 -0. 4 -0. 4 -0. 4 -0. 4 -0. 4 -0. 4

Is the inspection result normal?

YES >> Replace AV control unit. Refer to AV-243, "Exploded View".

NO >> Check that there is no malfunction in the external device.

Δ\/

Р

M

2013 370Z

DISK EJECT SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

DISK EJECT SIGNAL CIRCUIT

Description INFOID:000000008195407

The eject signal is output to AV control unit when the eject switch of multifunction switch is pressed.

Diagnosis Procedure

INFOID:0000000008195408

1. CHECK CONTINUITY DISK EJECT SIGNAL CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect multifunction switch connector and AV control unit connector.
- 3. Check continuity between multifunction switch harness connector and AV control unit harness connector.

Multifunction switch		AV control unit		Continuity
Connector	Terminal	Connector Terminal		Continuity
M72	14	M85	29	Existed

4. Check continuity between multifunction switch harness connector and ground.

Multifunc	tion switch		Continuity
Connector	Terminal	Ground	Continuity
M72	14		Not existed

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK AV CONTROL UNIT VOLTAGE

- Connect multifunction switch connector and AV control unit connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between AV control unit harness connector and ground.

	(+) AV control unit (-)		Condition	Voltage (Approx.)	
Connector	Terminal			(11 -)	
M85	29	Ground	Pressing the eject switch	0 V	
LOOJ	29	Ground	Except for above	5.0 V	

Is the inspection result normal?

YES >> Replace preset switch. Refer to AV-256, "Exploded View".

NO >> Replace AV control unit. Refer to AV-243, "Exploded View".

MICROPHONE SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

MICROPHONE SIGNAL CIRCUIT

Description INFOID:0000000008195409

Supply power from AV control unit to microphone. The microphone transmits the sound/voice to the AV control unit.

Diagnosis Procedure

INFOID:0000000008195410

Α

D

Е

1. CHECK CONTINUITY BETWEEN AV CONTROL UNIT AND MICROPHONE CIRCUIT

- Turn ignition switch OFF.
- 2. Disconnect AV control unit connector and microphone connector.
- 3. Check continuity between AV control unit harness connector and microphone harness connector.

AV control unit		Microphone		Continuity
Connector	Terminals	Connector	Terminals	Continuity
	71		2	
M86	72	R5	4	Existed
	87		1	

4. Check continuity between AV control unit harness connector and ground.

AV control unit			Continuity
Connector	Terminals	Ground	Continuity
M86	72	Ground	Not existed
	87		Not existed

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK VOLTAGE MICROPHONE VCC

- 1. Connect AV control unit connector.
- 2. Turn ignition switch ON.
- 3. Check voltage between AV control unit harness connector.

((+)		–)	
AV cor	ntrol unit	AV control unit		Voltage (Approx.)
Connector	Terminal	Connector Terminal		, , ,
M86	72	M86	71	5.0 V

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

3. CHECK MICROPHONE SIGNAL

- 1. Connect microphone connector.
- 2. Check signal between AV control unit harness connector.

ΑV

K

MICROPHONE SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

(-	+)	(–)				
AV con	trol unit	AV con	itrol unit	Condition	Reference value	
Connector	Terminal	Connector	Terminal			
M86	87	M86	71	Give a voice.	(V) 2. 5 2. 0 1. 5 1. 0 0. 5 0	

Is the inspection result normal?

>> Replace AV control unit. Refer to <u>AV-243, "Removal and Installation"</u>. >> Replace microphone. Refer to <u>AV-260, "Removal and Installation"</u>. YES

NO

CAMERA IMAGE SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

CAMERA IMAGE SIGNAL CIRCUIT

Description INFOID:000000008195411

- The AV control unit supplies power to the rear view camera when receiving a reverse signal.
- The rear view camera transmits camera images to the front display unit when power is supplied from the AV control unit.

Diagnosis Procedure

1. CHECK CONTINUITY CAMERA POWER SUPPLY CIRCUIT

- 1. Turn ignition switch OFF.
- 2. Disconnect AV control unit connector and rear view camera connector.
- Check continuity between AV control unit harness connector and rear view camera harness connector.

AV cor	AV control unit		unit Rear view camera	
Connector	Terminal	Connector Terminal		Continuity
M85	22	B157	1	Existed

4. Check continuity between AV control unit harness connector and ground.

AV control unit			Continuity
Connector	Terminal	Ground	Continuity
M85	22		Not existed

Is inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK VOLTAGE CAMERA POWER SUPPLY

- Connect AV control unit connector and rear view camera connector.
- Turn ignition switch ON.
- Shift the selector lever to "R".
- Check voltage between AV control unit harness connector and ground.

	+) itrol unit	(–)	Condition	Voltage (Approx.)
Connector	Terminal			, , ,
M85	22	Ground	Shift position is "R".	6.0 V

Is inspection result normal?

YES >> GO TO 3.

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

3.CHECK CONTINUITY CAMERA IMAGE SIGNAL CIRCUIT

- Turn ignition switch OFF.
- 2. Disconnect display unit connector and rear view camera connector.
- Check continuity between front display unit harness connector and rear view camera harness connector.

Front display unit		Rear view camera		Continuity
Connector	Terminal	Connector	Terminal	Continuity
M75	8	B157	3	Existed

4. Check continuity between front display unit harness connector and ground.

ΑV

Р

M

Α

D

Е

INFOID:0000000008195412

CAMERA IMAGE SIGNAL CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Front dis	splay unit		Continuity
Connector	Terminal	Ground	Continuity
M75	8		Not existed

Is inspection result normal?

YES >> GO TO 4.

NO >> Repair harness or connector.

4. CHECK CAMERA IMAGE SIGNAL

- 1. Connect front display unit connector and rear view camera connector.
- 2. Turn ignition switch ON.
- 3. Shift the selector lever to "R".
- 4. Check signal between display unit harness connector and ground.

	+) splay unit Terminal	(-)	Condition	Reference value
M75	8	Ground	At rear view camera image is displayed.	(V) 0. 4 0 -0. 4 → 40µs SKIB2251J

Is inspection result normal?

YES >> Replace front display unit. Refer to AV-245, "Removal and Installation".

NO >> Replace rear view camera. Refer to AV-265, "Removal and Installation".

STEERING SWITCH SIGNAL A CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

STEERING SWITCH SIGNAL A CIRCUIT

Description INFOID:0000000008195413

Transmits the steering switch signal to AV control unit.

Diagnosis Procedure

INFOID:0000000008195414

Α

В

D

Е

F

1. CHECK STEERING SWITCH SIGNAL A CIRCUIT

- Disconnect AV control unit connector and spiral cable connector.
- Check continuity between AV control unit harness connector and spiral cable harness connector.

AV control unit		Spiral cable		Continuity
Connector	Terminal	Connector	Terminal	Continuity
M84	6	M36	24	Existed

Check continuity between AV control unit harness connector and ground.

AV control unit			Continuity
Connector	Terminal	Ground	Continuity
M84	6		Not existed

Is the inspection result normal?

>> GO TO 2. YES

NO >> Repair harness or connector.

2.CHECK SPIRAL CABLE

Check spiral cable.

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace spiral cable. Refer to SR-17, "Removal and Installation".

3.CHECK AV CONTROL UNIT VOLTAGE

- Connect AV control unit connector and spiral cable connector.
- 2. Turn ignition switch ON.
- Check voltage between AV control unit harness connector.

(+)		(–)		
AV control unit		AV control unit		Voltage (Approx.)
Connector	Terminal	Connector	Terminal	(11 - 7
M84	6	M84	15	5.0 V

Is the inspection result normal?

>> GO TO 4. YES

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

4.CHECK STEERING SWITCH

- Turn ignition switch OFF.
- Check steering switch. Refer to AV-223, "Component Inspection".

Is the inspection result normal?

YFS >> INSPECTION END

>> Replace steering switch. Refer to AV-257, "Removal and Installation". NO

Component Inspection

INFOID:0000000008195415

Measure the resistance between the steering switch connector terminals 14 to 17 and 15 to 17.

AV-223 Revision: 2012 August 2013 370Z

STEERING SWITCH SIGNAL A CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Standard


Between terminals 14 and 17

ENTER switch ON : $2003 - 2043 \Omega$: 716 – 730 Ω w≨ switch ON MENU DOWN switch ON : $318 - 324 \Omega$ MENU UP switch ON : 120 - 122 Ω : 0 Ω

SOURCE switch ON

Between terminals 15 and 17

: $716 - 730 \Omega$ switch ON : $318 - 324 \Omega$ switch ON VOL UP switch ON : $120 - 122 \Omega$ VOL DOWN switch ON : 0 Ω

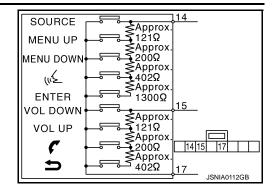

STEERING SWITCH SIGNAL B CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

STEERING SWITCH SIGNAL B CIRCUIT

Description INFOID:0000000008195416

Transmits the steering switch signal to AV control unit.

Diagnosis Procedure

INFOID:0000000008195417

Α

В

D

Е

F

1. CHECK STEERING SWITCH SIGNAL B CIRCUIT

- Disconnect AV control unit connector and spiral cable connector.
- Check continuity between AV control unit harness connector and spiral cable harness connector.

AV control unit		Spira	l cable	Continuity
Connector	Terminal	Connector	Terminal	Continuity
M84	16	M36	31	Existed

Check continuity between AV control unit harness connector and ground.

AV control unit			Continuity
Connector	Terminal	Ground	Continuity
M84	16		Not existed

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2.CHECK SPIRAL CABLE

Check spiral cable.

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace spiral cable. Refer to SR-17, "Removal and Installation".

3.CHECK AV CONTROL UNIT VOLTAGE

- Connect AV control unit connector and spiral cable connector.
- 2. Turn ignition switch ON.
- Check voltage between AV control unit harness connector.

(+)		(–)	
AV control unit		AV control unit		Voltage (Approx.)
Connector	Terminal	Connector	Terminal	(
M84	16	M84	15	5.0 V

Is the inspection result normal?

>> GO TO 4. YES

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

4.CHECK STEERING SWITCH

- Turn ignition switch OFF.
- Check steering switch. Refer to AV-225, "Component Inspection".

Is the inspection result normal?

YFS >> INSPECTION END

>> Replace steering switch. Refer to AV-257, "Removal and Installation". NO

Component Inspection

INFOID:0000000008195418

Measure the resistance between the steering switch connector terminals 14 to 17 and 15 to 17.

AV-225 Revision: 2012 August 2013 370Z

STEERING SWITCH SIGNAL B CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]


Standard

Between terminals 14 and 17

 $\begin{array}{lll} \text{ENTER switch ON} & : 2003 - 2043 \ \Omega \\ \\ \text{w} \not \leq \text{ switch ON} & : 716 - 730 \ \Omega \\ \\ \text{MENU DOWN switch ON} & : 318 - 324 \ \Omega \\ \\ \text{MENU UP switch ON} & : 120 - 122 \ \Omega \\ \\ \text{SOURCE switch ON} & : 0 \ \Omega \\ \\ \end{array}$

Between terminals 15 and 17

Switch ON : $716 - 730 \Omega$ **Switch ON** : $318 - 324 \Omega$ **VOL UP switch ON** : $120 - 122 \Omega$ **VOL DOWN switch ON** : 0Ω

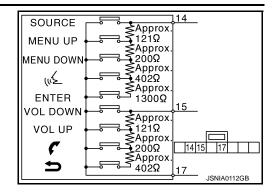

STEERING SWITCH GROUND CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

STEERING SWITCH GROUND CIRCUIT

Description INFOID:0000000008195419

Transmits the steering switch signal to AV control unit.

Diagnosis Procedure

INFOID:0000000008195420

Α

В

D

Е

F

1. CHECK STEERING SWITCH SIGNAL GND CIRCUIT

- 1. Disconnect AV control unit connector and spiral cable connector.
- 2. Check continuity between AV control unit harness connector and spiral cable harness connector.

AV control unit		Spiral	l cable	Continuity
Connector	Terminal	Connector	Terminal	Continuity
M84	15	M36	33	Existed

3. Connect AV control unit connector.

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair harness or connector.

2. CHECK SPIRAL CABLE

Check spiral cable.

Is the inspection result normal?

YES >> GO TO 3.

NO >> Replace spiral cable. Refer to <u>SR-17, "Removal and Installation"</u>.

3.CHECK GROUND CIRCUIT

- 1. Connect AV control unit connector.
- 2. Check continuity between AV control unit harness connector and ground.

AV cor	trol unit		Continuity
Connector	Terminal	Ground	Continuity
M84	15		Existed

Is the inspection result normal?

YES >> GO TO 4.

NO >> Replace AV control unit. Refer to AV-243, "Removal and Installation".

4.CHECK STEERING SWITCH

- 1. Turn ignition switch OFF.
- 2. Check steering switch. Refer to AV-227, "Component Inspection".

Is the inspection result normal?

YES >> INSPECTION END

NO >> Replace steering switch. Refer to AV-257, "Removal and Installation".

Component Inspection

Measure the resistance between the steering switch connector terminals 14 to 17 and 15 to 17.

INFOID:0000000008195421

Р

Revision: 2012 August **AV-227** 2013 370Z

ΑV

STEERING SWITCH GROUND CIRCUIT

< DTC/CIRCUIT DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Standard

Between terminals 14 and 17


 $\begin{array}{lll} \text{ENTER switch ON} & : 2003 - 2043 \ \Omega \\ \\ \text{w} \not \leq \text{ switch ON} & : 716 - 730 \ \Omega \\ \\ \text{MENU DOWN switch ON} & : 318 - 324 \ \Omega \\ \\ \text{MENU UP switch ON} & : 120 - 122 \ \Omega \\ \end{array}$

SOURCE switch ON : 0Ω

Between terminals 15 and 17

Switch ON : $716 - 730 \Omega$ **Switch ON** : $318 - 324 \Omega$ **VOL UP switch ON** : $120 - 122 \Omega$

VOL DOWN switch ON $: 0 \Omega$

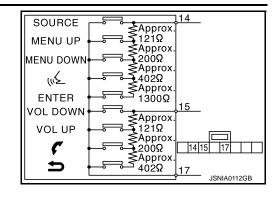

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

SYMPTOM DIAGNOSIS

MULTI AV SYSTEM SYMPTOMS

Symptom Table INFOID:0000000008195422

RELATED TO NAVIGATION

Trouble Diagnosis Chart by Symptom

Symptoms	Check items Probable malfunction location	
	All switches cannot be operated. "MULTI AV" is displayed on system selection screen when the CONSULT is started.	Multifunction switch power supply and ground circuit. AV communication circuit between AV control unit and multifunction switch. Perform CONSULT self-diagnosis. Refer to AV-149. "CONSULT Function (MULTI AV)".
Multifunction switch and preset switch operation does not work.	All switches cannot be operated. "MULTI AV" is not displayed on system selection screen when the CONSULT is initialized.	AV control unit power supply and ground circuit malfunction. Refer to AV-213, "AV CONTROL UNIT : Diagnosis Procedure".
	Only specified switch cannot be operated.	Multifunction switch or preset switch malfunction. Perform multifunction switch and preset switch self-diagnosis function. Refer to AV-138, "On Board Diagnosis Function".
Fuel economy display is abnor	There is malfunction in the CONSULT self-diagnosis result.	Perform detected DTC self-diagnosis. Refer to AV-149, "CONSULT Function (MULTI AV)".
Fuel economy display is abnormal.	There is no malfunction in the self-diagnosis results.	Ignition signal circuit malfunction. Refer to AV-213, "AV CONTROL UNIT : Diagnosis Procedure".
Guide sound is not heard or too low.	On the setting display select "system sound (guide sound volume, etc.)," and confirm that guide sound is ON.	Voice guidance signal circuit malfunction.

RELATED TO HANDS-FREE PHONE (EXCEPT FOR MEXICO)

- Before performing diagnosis, confirm that the cellular phone being used by the customer is compatible with the vehicle.
- It is possible that a malfunction is occurring due to a version change of the phone even though the phone is a compatible type. This can be confirmed by changing the cellular phone to another compatible type, and checking that it operates normally. It is important to determine whether the cause of the malfunction is the vehicle or the cellular phone.

Check Compatibility

- Make sure the customer's Bluetooth® related concern is understood.
- 2. Verify the customer's concern.

NOTE:

The customer's phone may be required, depending upon their concern.

3. Write down the customer's phone brand, model, and service provider.

NOTE:

It is necessary to know the service provider. On occasion, a given phone may be on the approved list with one provider, but may not be on the approved list with other providers.

- Go to "www.nissanusa.com/bluetooth/".
- Using the website's search engine, find out if the customer's phone is on the approved list.
- If the customer's phone is NOT on the approved list: Stop diagnosis here. The customer needs to obtain a Bluetooth® phone that is on the approved list before any further action.
- If the feature related to the customer's concern shows as "N" (not compatible): Stop diagnosis here. If the customer still wants the feature to function, they will need to get an approved phone showing the feature as "Y" (compatible) in the "Basic Features" list.

ΑV

M

Α

D

Е

F

[BOSE AUDIO WITH NAVIGATION]

d. If the feature related to the customer's concern shows as "Y" (compatible): Perform diagnosis as per the following table.

Symptoms	Check items	Probable malfunction location	
Does not recognize cellular phone connection. (no connection is displayed on the display at the guide.)	Repeat the registration of cellular phone.	AV control unit malfunction. Replace AV control unit. Refer to AV-243, "Removal and Installation".	
Hands-free phone cannot be established.	 Hands-free phone operation can be made, but the communication cannot be established. Hands-free phone operation can be performed, however, voice between each other cannot be heard during the conversation. 	AV control unit malfunction. Replace AV control unit. Refer to AV-243, "Removal and Installation".	
The other party's voice cannot be heard by hands-free phone.	Check the "microphone speaker" in Inspection & Adjustment Mode if sound is heard.	AV control unit malfunction. Replace AV control unit. Refer to AV-243, "Removal and Installation".	
Originating sound is not heard by the other party with hands-	Sound operation function is normal.	AV control unit malfunction. Replace AV control unit. Refer to AV-243, "Removal and Installation".	
free phone communication.	Sound operation function does not work.	Microphone signal circuit malfunction. Refer to AV-219, "Diagnosis Procedure".	
	Coupe models The voice recognition can be controlled. Steering switch's "VOL UP", "VOL DOWN", """ switch works, but """ it does not work. Roadster models The retractable soft top is fully closed. The voice recognition can be controlled. Steering switch's "VOL UP", "VOL DOWN", """ switch works, but """ it does not work.	Steering switch malfunction.	
The system cannot be operated.	Coupe models The retractable soft top is fully closed. The voice recognition can be controlled. Steering switch's "("", "VOL UP", "VOL DOWN", ")" switches do not work. Roadster models The retractable soft top is fully closed. The voice recognition can be controlled. Steering switch's "("", "VOL UP", "VOL DOWN", ")" switches do not work.	Steering switch signal B circuit malfunction. Refer to AV-225, "Diagnosis Procedure".	
	All steering switches do not work.	Steering switch ground circuit malfunction. Refer to AV-227, "Diagnosis Procedure".	

RELATED TO HANDS-FREE PHONE (FOR MEXICO)

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Symptoms	Check items	Probable malfunction location
Does not recognize cellular phone connection. (no connection is displayed on the display at the guide.)	Repeat the registration of cellular phone.	AV control unit malfunction. Replace AV control unit. Refer to AV-243, "Removal and Installation".
Hands-free phone cannot be established.	 Hands-free phone operation can be made, but the communication cannot be established. Hands-free phone operation can be performed, however, voice between each other cannot be heard during the conversation. 	AV control unit malfunction. Replace AV control unit. Refer to AV-243, "Removal and Installation".
The other party's voice cannot be heard by hands-free phone.	Check the "microphone speaker" in Inspection & Adjustment Mode if sound is heard.	AV control unit malfunction. Replace AV control unit. Refer to AV-243, "Removal and Installation".
Originating sound is not heard by the other party with hands-	Sound operation function is normal.	AV control unit malfunction. Replace AV control unit. Refer to AV-243, "Removal and Installation".
free phone communication.	Sound operation function does not work.	Microphone signal circuit malfunction. Refer to AV-219, "Diagnosis Procedure".
The system cannot be operated.	Coupe models The voice recognition can be controlled. Steering switch's "VOL UP", "VOL DOWN", "" switch works, but "" it does not work. Roadster models The retractable soft top is fully closed. The voice recognition can be controlled. Steering switch's "VOL UP", "VOL DOWN", "" switch works, but "" it does not work.	Steering switch malfunction.
	Coupe models The retractable soft top is fully closed. The voice recognition can be controlled. Steering switch's "("", "VOL UP", "VOL DOWN", ")" switches do not work. Roadster models The retractable soft top is fully closed. The voice recognition can be controlled. Steering switch's "("", "VOL UP", "VOL DOWN", ")" switches do not work.	Steering switch signal B circuit malfunction. Refer to AV-225, "Diagnosis Procedure".
	All steering switches do not work.	Steering switch ground circuit malfunction. Refer to AV-227, "Diagnosis Procedure".

RELATED TO RGB IMAGE

Trouble Diagnosis Chart by Symptom

Symptoms	Check items	Probable malfunction location
RGB image is not shown.	_	RGB digital image signal circuit malfunction.

RELATED TO VOICE CONTROL

Trouble Diagnosis Chart by Symptom

ΑV

Р

0

[BOSE AUDIO WITH NAVIGATION]

Symptoms	Check items	Probable malfunction location
The voice cannot be controlled even if the voice control screen	Voice sounds at "Voice Microphone Test" of Confirmation/Adjustment mode.	AV control unit malfunction. Replace AV control unit. Refer to AV-243, "Removal and Installation".
is displayed.	Voice does not sound at "Voice Micro- phone Test" of Confirmation/Adjustment mode.	Microphone circuit malfunction. Refer to AV-219, "Diagnosis Procedure".
The voice cannot be controlled (Voice control screen is not displayed).	 Steering switch's "SOURCE", "MENU UP", "MENU DOWN", "ENTER" switch works, but "√2" it does not work. Hands-free phone system cannot be operated. 	Roof status signal circuit malfunction.
	 Steering switch's "SOURCE", "MENU UP", "MENU DOWN", "ENTER" switch works, but "ó" it does not work. Hands-free phone system can be operated. 	Steering switch malfunction.
	Steering switch's "SOURCE", "MENU UP", "MENU DOWN", " " "ENTER" switches do not work.	Steering switch signal A circuit malfunction. Refer to AV-223, "Diagnosis Procedure".
	All steering switches do not work.	Steering switch ground circuit malfunction. Refer to AV-227, "Diagnosis Procedure".

RELATED TO AUDIO

Coupe Models

Symptoms	Check items	Probable malfunction location
The disk cannot be removed.	_	Disk eject signal circuit malfunction. Refer to AV-218, "Diagnosis Procedure".
	No sound from all speakers.	BOSE amp. ON signal circuit malfunction. BOSE amp. power supply and ground circuits malfunction. Refer to AV-214, "BOSE AMP.: Diagnosis Procedure".
	Sound is not heard from woofer.	Sound signal (woofer) circuit malfunction.
No sound comes out or the level of the sound is low.	Only a certain speaker (front right, front left, rear right, or rear left) does not output sound.	 Poor connector connection of speaker. Sound signal circuit malfunction between AV control unit and BOSE amp. Sound signal circuit malfunction between BOSE amp. and speaker. Malfunction in speaker. Malfunction in AV control unit. Malfunction in BOSE amp.
	Noise comes out from all speaker.	Malfunction in AV control unit. Malfunction in BOSE amp.
Noise is mixed with audio.	Noise comes out only from a certain speaker (front right, front left, rear right, or rear left).	 Poor connector connection of speaker. Sound signal circuit malfunction between AV control unit and BOSE amp. Sound signal circuit malfunction between BOSE amp. and speaker. Malfunction in speaker. Poor installation of speaker (e.g. backlash and looseness) Malfunction in AV control unit. Malfunction in BOSE amp.
	Noise is mixed with radio only (when the car hits a bump or while driving over bad roads).	Poor connector connection of antenna or antenna feeder.

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Symptoms	Check items	Probable malfunction location
Radio is not received or poor reception.	Other audio sounds are normal. Any radio cannot be received or poor reception is caused even after moving to a service area with good reception (e.g. a place with clear view and no obstacles generating external noises).	Antenna amp. ON signal circuit malfunction. Poor connector connection of antenna or antenna feeder.
Satellite radio is not received.	There is malfunction in the CONSULT self-diagnosis result. Refer to AV-149, "CONSULT Function (MULTI AV)".	 Malfunction in antenna, antenna feeder, or AV control unit. Perform DTC diagnosis. Refer to AV-159, "DTC Index". Poor continuity in antenna feeder. Poor connector connection of antenna or antenna feeder.
	There is no malfunction in the CONSULT self-diagnosis result. Refer to AV-149, "CONSULT Function (MULTI AV)".	 Poor continuity in antenna feeder. Poor connector connection of antenna or antenna feeder. Loose satellite radio antenna mounting nut. Refer to <u>AV-264, "Exploded View"</u>.
Roadster Models		
Symptoms	Check items	Probable malfunction location
The disk cannot be removed.	_	Disk eject signal circuit malfunction. Refer to AV-218, "Diagnosis Procedure".
	No sound from all speakers.	BOSE amp. ON signal circuit malfunction. BOSE amp. power supply and ground circuits malfunction. Refer to AV-214, "BOSE AMP.: Diagnosis Procedure".
	Sound is not heard from rear woofer.	Sound signal (woofer) circuit malfunction.
No sound comes out or the level of the sound is low.	Only a certain speaker (front right, front left, rear right, or rear left) does not output sound.	 Poor connector connection of speaker. Sound signal circuit malfunction between AV control unit and BOSE amp. Sound signal circuit malfunction between BOSE amp. and speaker. Malfunction in speaker. Malfunction in AV control unit. Malfunction in BOSE amp.
	Noise comes out from all speaker.	Malfunction in AV control unit. Malfunction in BOSE amp.
Noise is mixed with audio.	Noise comes out only from a certain speaker (front right, front left, rear right, or rear left).	 Poor connector connection of speaker. Sound signal circuit malfunction between AV control unit and BOSE amp. Sound signal circuit malfunction between BOSE amp. and speaker. Malfunction in speaker. Poor installation of speaker (e.g. backlash and looseness) Malfunction in AV control unit. Malfunction in BOSE amp.
	Noise is mixed with radio only (when the car hits a bump or while driving over bad roads).	 Poor connector connection of antenna or antenna feeder. Loose antenna base mounting nut. Refer to <u>AV-254</u>, "<u>Exploded View</u>".
Radio is not received or poor reception.	Other audio sounds are normal. Any radio cannot be received or poor reception is caused even after moving to a service area with good reception (e.g. a place with clear view and no obstacles generating external noises).	 Antenna amp. ON signal circuit malfunction. Poor connector connection of antenna or antenna feeder. Loose antenna base mounting nut. Refer to <u>AV-254</u>, "<u>Exploded View</u>".

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Symptoms	Check items	Probable malfunction location
Satellite radio is not received.	There is malfunction in the CONSULT self-diagnosis result. Refer to AV-149, "CONSULT Function (MULTI AV)".	 Malfunction in antenna, antenna feeder, or AV control unit. Perform DTC diagnosis. Refer to AV-159, "DTC Index". Poor continuity in antenna feeder. Poor connector connection of antenna or antenna feeder.
	There is no malfunction in the CONSULT self-diagnosis result. Refer to AV-149, "CONSULT Function (MULTI AV)".	 Poor continuity in antenna feeder. Poor connector connection of antenna or antenna feeder. Loose antenna base mounting nut. Refer to <u>AV-254</u>, "<u>Exploded View</u>".

RELATED TO USB

NOTE:

Check that there is no malfunction of USB equipment main body before performing a diagnosis.

Trouble Diagnosis Chart by Symptom

Symptoms	Check items	Possible malfunction location / Action to take
iPod [®] or USB memory can not be recognized.	_	USB harness malfunction. USB connector malfunction.

iPod® is a trademark of Apple inc., registered in the U.S. and other countries.

RELATED TO DVD MODE

Symptoms	Check items	Probable malfunction location
The DVD cannot be removed.	_	Disk eject signal circuit malfunction between AV control unit and preset switch. Refer to AV-218, "Diagnosis Procedure".
DVD image is not displayed.	_	Perform CONSULT self-diagnosis. Refer to AV-149, "CONSULT Function (MULTI AV)". When detecting no malfunction in those components, the following items are a possible cause. • Composite image signal circuits malfunction. Refer to AV-216. "Diagnosis Procedure".
Audio sound is not heard.	No sound from all speakers.	BOSE amp. ON signal circuit. BOSE amp. power supply and ground circuit. Refer to AV-214, "BOSE AMP.: Diagnosis Procedure".
	Sound is heard only from specific places.	Sound signal circuit of suspect system.

RELATED TO CAMERA

Symptoms	Check items	Probable malfunction location
Camera image is not shown. (Vehicle width and predictive course line are displayed.)	_	Camera image signal circuit. Refer to AV-221, "Diagnosis Procedure".
Camera image does not switch.	Select "Camera Cont." of Confirmation/ Adjustment mode, Reverse Sensor is not turned ON at "Connection Confirmation".	Reverse signal circuit malfunction.
	Select "Camera Cont." of Confirmation/ Adjustment mode, Reverse Sensor is turned ON at "Connection Confirmation".	AV control unit malfunction. Replace AV control unit. Refer to AV-243, "Removal and Installation".

RELATED TO STEERING SWITCH

Trouble Diagnosis Chart by Symptom

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Symptoms	Probable malfunction location	
None of the steering switch operations work.	Steering switch ground circuit malfunction. Refer to AV-227, "Diagnosis Procedure".	
Only specified switch cannot be operated.	Steering switch malfunction.	
Steering switch's "SOURCE", "MENU UP", "MENU DOWN", " "\subseteq", "ENTER" switches do not work.	Steering switch signal A circuit malfunction. Refer to AV-223, "Diagnosis Procedure".	
Steering switch's "">", "VOL UP", "VOL DOWN", "" "" switches do not work.	Steering switch signal B circuit malfunction. Refer to AV-225, "Diagnosis Procedure".	

RELATED TO AUXILIARY INPUT

NOTE:

Check that there is no malfunction of AUX equipment main body before performing a diagnosis.

Trouble	diagnos	sis cha	rt hv	symptom

Symptoms	Check items	Probable malfunction location
No voice sound is heard when AUX mode is selected.	Voice sound is heard when other modes are selected.	AUX sound signal circuit.
Image is not displayed when	DVD image is displayed.	AUX image signal circuit malfunction. Refer to AV-217, "Diagnosis Procedure".
AUX mode is selected.	DVD image is not displayed.	Composite image signal circuit malfunction. Refer to AV-216, "Diagnosis Procedure".

Н

Α

В

C

D

Е

F

G

1

J

K

L

M

ΑV

0

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

NORMAL OPERATING CONDITION

Description INFOID:000000008195423

NOTE:

For Navigation system operation information, refer to Navigation system Owner's Manual.

BASIC OPERATIONS

Symptom	Possible cause	Possible solution
	The brightness is at the lowest setting.	Adjust the brightness of the display.
	The systems in the video mode.	Press "DISC-AUX" to change the mode.
No image is displayed.	The display is turned off.	Press "☀/→" to turn on the display.
	The interior of the vehicle becomes the a little less than 80°C (176°F) or high temperature, and the protection of the display acts, and a display is turned off.	Wait until the interior of the vehicle has cooled down.
Screen not clear.	Contrast setting is not appropriate.	Adjust the contrast of the display.
No voice guidance is available Or	The volume is not set correctly, or it is turned off.	Adjust the volume of voice guidance.
No voice guidance is available. Or The volume is too high or too low.	Voice guidance is not provided for certain streets (roads displayed in gray).	This is not a malfunction.
No map is displayed on the screen.	A screen other than map screen is displayed.	Press "MAP".
The screen is too dim. The movement is slow.	The temperature in the interior of the vehicle is high.	Wait until the interior of the vehicle has cooled down.
Some pixels in the display are darker or brighter than others.	This condition is an inherent characteristic of liquid crystal displays.	This is not a malfunction.
Some menu items cannot be selected.	Some menu items become unavailable while the vehicle is driven.	Park the vehicle in a safe location, and then operate the navigation system.

NOTE:

Locations stored in the Address Book and other memory functions may be lost if the vehicle's battery is disconnected or becomes discharged. If this occurs, service the vehicle's battery as necessary and re-enter the information in the Address Book.

RELATED TO VOICE RECOGNITION

Related to Basic Operation

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Symptom	Possible cause	Possible solution
	The interior of the vehicle is too noisy.	Close the windows or have other occupants quiet.
	The volume of your voice is too low.	Speak louder.
	The volume if your voice is too loud.	Speak softer.
	Your pronunciation is unclear.	Speak clearly.
The system does not recognize your command. or The system recognizes your command incorrectly	You are speaking before the voice recognition is ready	Press and release " " switch on the steering switch, and speak a command after the tone sounds.
	8 seconds or more have passed after you pressed and released "v\sumset " switch on the steering switch.	Make sure to speak a command within 8 seconds after you press and release "√∠" switch on the steering switch.
	Only a limited range of voice commands is usable for each screen.	Use a correct voice command appropriate for the current screen.
	The fan of the air conditioner is too loud.	Lower the fan speed as necessary as voice commands can be recognized more easily.
The system cannot be operated. (roadster models)	The retractable soft top is not closed properly.	 Close the retractable soft top. Open and close the retractable soft top before operating the system. Check if the retractable soft top warning lamp is lit in combination meter.

Related to Item Choice

The system should respond correctly to all voice commands without difficulty. If problems are encountered, follow the solutions given in this guide for the appropriate error.

Where the solutions are listed by number, try each solution in turn, starting with number one, until the problem is resolved.

Symptom/ error message	Solution	
	Ensure that the command format is valid.	
D:	2. Speak clearly without pausing between words and at a level appropriate to the ambient noise level.	
Displays "COMMAND NOT REC- OGNIZED" or the system fails to in- terpret the command correctly.	3. Ensure that the ambient noise level is not excessive, for example, windows open or defrost on. NOTE: If it is too noisy to use the phone, it is likely that voice commands will not be recognized.	
	4. If optional words of the command have been omitted, then command should be tried with these in place.	
The system consistently selects the wrong voicetag	1. Ensure that the voicetag requested matches what was originally stored. This can be confirmed by giving the "Addressbook" Directory or Phone Directory command.	
the wrong voicetag	2. Replace one of the voicetags being confused with a different voicetag.	

Related to Telephone

The system should respond correctly to all voice commands without difficulty. If problems are encountered, try the following solutions.

Where the solutions are listed by number, try each solution in turn, starting with number 1, until the problem is resolved.

AV

M

Α

В

D

Е

F

J

Р

0

[BOSE AUDIO WITH NAVIGATION]

Symptom	Solution	
System fails to interpret the command correctly.	Ensure that the command is valid.	
	2. Ensure that the command is spoken after the tone.	
	3. Speak clearly without pausing between words and at level appropriate to the ambient noise level in the vehicle.	
	Ensure that the ambient noise level is not excessive (for example, windows open or defroster on). NOTE:	
	If it is too noisy to use the phone, it is likely that the voice commands will not be recognized.	
	5. If more than one command was said at a time, try saying the commands separately.	
	6. If the system consistently fails to recognize commands, the voice training procedure should be carried out to improve the recognition response for the speaker. See "Speaker adaptation (SA) mode" earlier in this section. Refer to "OWNER'S MANUAL".	
The system consistently selects the wrong voicetag	Ensure that the phone book entry name requested matches what was originally stored. This can be confirmed by using the "List Names" command.	
	2. Replace one of the names being confused with a new name.	

RELATED TO AUDIO

- The majority of the audio malfunctions are the result of outside causes (bad CD, electromagnetic interference, etc.). Check the symptoms below to diagnose the malfunction.
- The vehicle itself can be a source of noise if noise prevention parts or electrical equipment is malfunctioning.
 Check if noise is caused and/or changed by engine speed, ignition switch turned to each position, and operation of each piece of electrical equipment, and then determine the cause.

NOTE:

- CD-R is not guaranteed to play because they can contain compressed audio (MP3, WMA, AAC, M4A) or could be incorrectly mastered by the customer on a computer.
- Check if the CDs carry the Compact Disc Logo. If not, the disc is not mastered to the "red book" Compact Disc Standard and may not play.

Symptom	Cause and Counter measure	
	Check if the CD was inserted correctly.	
	Check if the CD is scratched or dirty.	
	Check if there is condensation inside the player, and if there is, wait until the condensation is gone (about 1 hour) before using the player.	
	If there is a temperature increase error, the player will play correctly after it returns to the normal temperature.	
Cannot play	If there is a mixture of music CD files (CD-DA data) and MP3/WMA/AAC/M4A files on a CD, only the music CD files (CD-DA data) will be played.	
	Files with extensions other than ".MP3", ".WMA", ".AAC", ".M4A", ".mp3", ".wma", ".aac" or ".m4a" cannot be played. In addition, the character codes and number of characters for folder names and file names should be in compliance with the specifications.	
	Check if the disc or the file is generated in an irregular format, This may occur depending on the variation or the setting of MP3/WMA/AAC/M4A writing applications or other text editing applications.	
Check if the finalization process, such as session close and disc close, is do		
	Check if the CD is protected by copyright.	
Poor sound quality	Check if the CD is scratched or dirty.	
It takes a relatively long time before the music starts playing.	If there are many folder or file levels on the MP3/WMA/AAC/M4A CD, or if it is a multisession disc, some time may be required before the music starts playing.	
Music cuts off or skips	The writing software and hardware combination might not match, or the writing speed, writing depth, writing width might not match the specifications. Try using the slowest writing speed.	
Skipping with high bit rate files	Skipping may occur with large quantities if data such as for high bit rate data.	

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Α

В

D

Е

F

Р

Symptom	Cause and Counter measure	
Move immediately to the next song when playing	When a non-MP3/WMA/AAC file has been given an extension of ".MP3", ".WMA", ".AAC", "M4A" ".mp3", ".wma", ".aac"or ".m4a" or when play is prohibited by copyright protection, the player will skip to the next song.	
The songs do not play back in the desired order.	The playback order is the order in which the files were written by the software, so the files might not play in the desired order.	
Poor reception only from a certain radio broadcast station.	Check incoming radio wave signal strength of applicable broadcast station.	
Buzz/rattle sound from speaker	The majority of rattle sounds are not indicative of an issue with the speaker, usually something nearby the speaker is causing the rattle.	

Noise resulting from variations in field strength, such as fading noise and multi-path noise, or external noise from trains and other sources, is not a malfunction.

NOTE:

- Fading noise: This noise occurs because of variations in the field strength in a narrow range due to mountains or buildings blocking the signal.
- Multi-path noise: This noise results from a time difference between the broadcast waves directly from the station arriving at the antenna and the waves reflected by mountains or buildings.

RELATED TO DVD

Symptom	Possible cause	Possible solution	
Not working as operated	Some operations may be rejected or may not function as intended because of the manufacturer's intent, depending on DVD.	This is not a malfunction.	
Operation not accepted	If a requested operation is prohibited, then a message is displayed on the screen. (Message display depends on DVD.)	This is not a malfunction.	
	Check that the DVD is inserted in the right place.	Upturn the DVD (facing the title upward).	
	Check if there is condensation inside the player.	wait until the condensation is gone (about 1 hour) before using the player.	
DVD can not be played	DVD menu is displayed.	Select item to touch "ENTER"	
2 12 can not so prayer	Insertion of a DVD with a different region code.	DVDs with a different region code can not be played. Check DVD.	
	Some DVD softwares may not be played because not all DVD softwares fully comply in the standard.	This is not a malfunction.	
DVD-AUDIO can not be played	DVD-AUDIO may not be playable depending on the vehicle specifications	This is not a malfunction.	
Interruption during play- back or flicker in the dis- play	Check that the DVD has no scratches and dirt.	Errors may not be corrected depending on the size of scratches.	
Low sound quality		Wipe and clean the dirt on the disc.	
Distortion in picture	In the process of fast-forward or fast-reverse.	This is not a malfunction.	
Subtitles not shown	Subtitle setting is OFF.	Set subtitle.	
Subtitles not snown	Subtitle is not included in the software.	Check DVD.	
Not played in set language	If a language is not included in the DVD, then the DVD is played in a recommended language.	Check DVD.	
Not played with set subtitle	If a set subtitle is not included in the DVD, then the DVD is played with a recommended subtitle.	Check DVD.	
Subtitle and language not selectable (not played with set subtitle or in set language)	The DVD is not multilanguage-capable.	The inclusion of the number of languages depends on DVD. Languages may be selectable on the Menu screen. Check DVD.	
	The DVD has a priority language or setting.	If the DVD has a priority language or settings, then settings changed with this device are not reflected.	
Angle unchangeable	Plural angles are not recorded in the software.	Check if the DVD is multi-angle-capable.	

Revision: 2012 August AV-239 2013 370Z

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Symptom	Possible cause	Possible solution
Unusual screen display	Display mode to the output aspect ratio for the DVD software is inappropriate.	Switch to the appropriate display mode.
Playback time is indicated, but no sound comes out.	Playback of Mix mode Truck 1. (Mix mode: Format including Truck 1 with data other than music and Trucks from Truck 2 with music data.)	Play music data included in trucks from Truck 2.

RELATED TO VEHICLE ICON

Symptom	Possible cause	Possible solution
Names of roads differ between Plan View and Birdview [™] .	This is because the quantity of the displayed information is reduced so that the screen does not become too crowded. There is also a chance that names of the roads may be displayed multiple times, and the names appearing on the screen may be different because of a processing procedure.	This is not a malfunction.
The vehicle icon is not displayed in	The vehicle was transported after the ignition switch was pressed off, for example, by a ferry or car transporter.	Drive the vehicle for a while on a road where GPS signals can be received.
the correct position.	The position and direction of the vehicle icon may be incorrect depending on the driving environments and the levels of positioning accuracy of the navigation system.	This is not a malfunction. Drive the vehicle for a while to automatically correct the position and direction of the vehicle icon.
When the vehicle is traveling on a new road, the vehicle icon is located on another road nearby.	Because the new road is not stored in the map data, the system automatically places the vehicle icon on the nearest road available.	Updated road information will be included in the next version of the map data.
The screen does not switch to the night screen even after turning on the headlights.	The daytime screen was set the last time the headlights were turned on.	Set the screen to the night screen mode using <day night=""> when you turn on the headlights.</day>
The map does not scroll even when the vehicle is moving.	The current location map screen is not displayed.	Press "MAP".
The vehicle icon is not displayed.	The current location map screen is not displayed.	Press "MAP".
The location of the vehicle icon is misaligned from the actual position.	When using tire chains or replacing the tires, speed calculations based on the speed sensor may be incorrect.	Drive the vehicle for a while [at approximately 30 km/h (19 MPH) for about 30 minutes] to automatically correct the vehicle icon position. If this does not correct the vehicle icon position, contact an NISSAN (INFINITI) dealer.
	The map data has a mistake or is incomplete (the vehicle icon position is always misaligned in the same area).	Updated road information will be included in the next version of the map data.

RELATED TO ROUTE CALCULATION AND VISUAL GUIDANCE

Symptom	Possible cause	Possible solution
Waypoints are not included in the auto reroute calculation.	Waypoints that you have already passed are not included in the auto reroute calculation.	If you want to go to that waypoint again, you need to edit the route.
Route information is not displayed.	Route calculation has not yet been performed.	Set the destination and perform route calculation.
	You are not driving on the suggested route.	Drive on the suggested route.
	Route guidance is set to off.	Turn on route guidance.
	Route information is not provided for certain types of roads (roads displayed in gray).	This is not a malfunction.

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Symptom	Possible cause	Possible solution
The auto reroute calculation (or detour calculation) suggests the same route as the one previously suggested.	Route calculations took priority conditions into consideration, but the same route was calculated.	This is not a malfunction.
A waypoint cannot be added.	Five waypoints are already set on the route, including ones that you have already passed.	A maximum of 5 waypoints can be set on the route. If you want to go to 6 or more waypoints, perform route calcu- lations multiple times as necessary.
The suggested route is not displayed.	Roads near the destination cannot be calculated.	Reset the destination to a main or ordinary road, and recalculate the route.
	The starting point and destination are too close.	Set a more distant destination.
	The starting point and destination are too far away.	Divide your trip by selecting one or two intermediate destinations, and perform route calculations multiple times.
	There are time restricted roads (by the day of the week, by time) near the current vehicle location or destination.	Set [Use Time Restricted Roads] to off.
The part of the route that you have already passed is deleted.	A route is managed by sections between waypoints. If you passed the first waypoint, the section between the starting point and the waypoint is deleted. (It may not be deleted depending on the area.)	This is not a malfunction.
An indirect route is suggested.	If there are restrictions (such as one-way streets) on roads close to the starting point or destination, the system may suggest an indirect route.	Adjust the location of the starting of the starting point or destination.
	The system may suggest an indirect route because route calculation does not take into consideration some areas such as narrow streets (gray roads.)	Reset the destination to a main or ordinary road, and recalculate the route.
The landmark information does not correspond to the actual information.	This may be caused by insufficient or incorrect map data.	Updated information will be included in the next version of the data.
The suggested route does not exactly connect to the starting point, waypoints, or destination.	There is no data for route calculation closes to these locations.	Set the starting point, waypoints and destination on a main road, and perform route calculation.

RELATED TO VOICE GUIDANCE

Symptom	Possible cause	Possible solution
Voice guidance is not available	Voice guidance is only available at certain intersections marked with? In some case, voice guidance is not available even when the vehicle should make a turn.	This is not a malfunction.
	The vehicle has deviated from the suggested route.	Go back to the suggested route or request route calculation again
	Voice guide is set to off.	Turn on voice guidance.
	Route guidance is set to off.	Turn on voice guidance.
The guidance contact does not correspond to the actual condition.	The contact of voice guidance may vary, depending on the types of intersections at which turn are made.	Follow all traffic rules and regulations.

RELATED TO HANDS-FREE PHONE (EXCEPT FOR MEXICO)

Revision: 2012 August AV-241 2013 370Z

0

< SYMPTOM DIAGNOSIS >

[BOSE AUDIO WITH NAVIGATION]

Symptom	Cause and Counter measure	
Does not recognize cellular phone connection. (No connection is displayed on the display at the guide.)	Some Bluetooth [®] enabled cellular phones may not be recognized by the in-vehicle phone module. Refer to "RELATED TO HANDS-FREE PHONE (Check Compatibility)" of MULTI AV SYSTEM SYMPTOM.	
Cannot use hands-free phone	Customer will not be able to use a hands-free phone under the following conditions. The vehicle is outside of the telephone service area. The vehicle is in an area where it is difficult to receive radio waves; such as in a tunnel, in an underground parking garage, near a tall building or in a mountainous area. The cellular phone is locked to prevent it from being dialed. NOTE: While a cellular phone is connected through the Bluetooth® wireless connection, the battery power of the cellular phone may discharge quicker than usual. The Bluetooth® Hands-Free Phone System cannot charge cellular phones.	
The other party's voice cannot be heard by hands-free phone.	When the radio wave condition is not ideal or ambient sound is too loud, it may be difficult to hear the other person's voice during a call.	
Poor sound quality	Do not place the cellular phone in an area surrounded by metal or far away from the in-vehicle phone module to prevent tone quality degradation and wireless connection disruption.	

RELATED TO HANDS-FREE PHONE (FOR MEXICO)

Symptom	Cause and Counter measure	
Cannot use hands-free phone	Customer will not be able to use a hands-free phone under the following conditions. • The vehicle is outside of the telephone service area. • The vehicle is in an area where it is difficult to receive radio waves; such as in a tunnel, in an underground parking garage, near a tall building or in a mountainous area. • The cellular phone is locked to prevent it from being dialed. NOTE: While a cellular phone is connected through the Bluetooth® wireless connection, the battery power of the cellular phone may discharge quicker than usual. The Bluetooth® Hands-Free Phone System cannot charge cellular phones.	
The other party's voice cannot be heard by hands-free phone.	When the radio wave condition is not ideal or ambient sound is too loud, it may be difficult to hear the other person's voice during a call.	
Poor sound quality	Do not place the cellular phone in an area surrounded by metal or far away from the in-vehicle phone module to prevent tone quality degradation and wireless connection disruption.	

[BOSE AUDIO WITH NAVIGATION]

REMOVAL AND INSTALLATION

AV CONTROL UNIT

Exploded View

CAUTION:

- Before replacing AV control unit, perform "Read/Write Configuration" to save or print current vehicle specification. For details, refer to AV-176, "Work Procedure".
- Remove battery terminal and AV control unit after a lapse of 30 seconds or more after turning the ignition switch OFF.


NOTE:

After the ignition switch is turned OFF, the AV control unit continues operating for approximately 30 seconds. Therefore, data corruption may occur if battery voltage is cut off within 30 seconds.

REMOVAL

Refer to IP-14, "Exploded View".

DISASSEMBLY

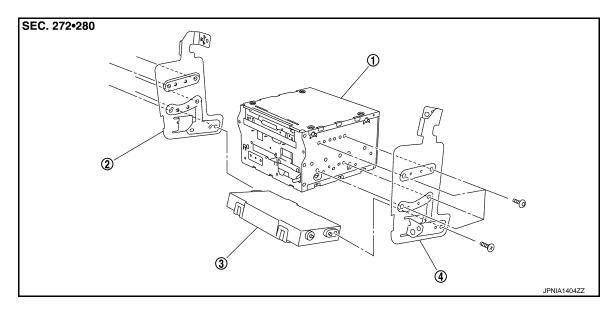

- 1. AV control unit Bracket RH
- 2. Bracket LH

3. A/C auto amp.

Removal and Installation

REMOVAL **CAUTION:**

- Before replacing AV control unit, perform "Read/Write Configuration" to save or print current vehicle specification. For details, refer to AV-175, "Work Procedure".
- · Remove battery terminal and AV control unit after a lapse of 30 seconds or more after turning the ignition switch OFF.

NOTE:

After the ignition switch is turned OFF, the AV control unit continues operating for approximately 30 seconds. Therefore, data corruption may occur if battery voltage is cut off within 30 seconds.

- Remove preset switch. Refer to AV-256, "Exploded View". 1.
- 2. Remove AV control unit with A/C auto amp. as a single unit from the body.
- Remove bracket screws, and then remove AV control unit.

INSTALLATION

Install in the reverse order of removal.

CAUTION:

AV-243 Revision: 2012 August 2013 370Z

Α

D

Е

F

INFOID:0000000008195424

ΑV

INFOID:0000000008195425

AV CONTROL UNIT

< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITH NAVIGATION]

- Since AV control unit connector and unified meter and A/C amp. connector have the same form, be careful not to insert them wrongly.
- Be sure to perform "Read/Write Configuration" when replacing AV control unit. For details, refer to AV-176, "Work Procedure".

FRONT DISPLAY UNIT


< REMOVAL AND INSTALLATION >	[BOSE AUDIO WITH NAVIGATION]	
FRONT DISPLAY UNIT		
Exploded View	INFOID:000000008195426	
Refer to IP-14, "Exploded View".		
Removal and Installation	INFOID:000000008195427	
REMOVAL		
 Remove cluster lid D. Refer to <u>IP-14, "Exploded View"</u>. Remove front display unit with bracket as a single unit. 		
INSTALLATION		
Install in the reverse order of removal.		

AV-245 Revision: 2012 August 2013 370Z

FRONT DOOR SPEAKER

Exploded View

INFOID:0000000008195428

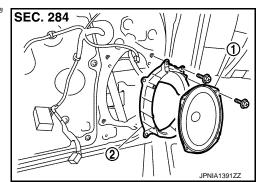

- 1. Front door speaker
- 2. Speaker bracket

Removal and Installation

INFOID:0000000008195429

REMOVAL

- 1. Remove door finisher. Refer to INT-15, "Exploded View" (coupe models) or INT-47, "Exploded View" (roadster models).
- Remove front door speaker screws, then disconnect front door speaker connector and remove front door speaker.

INSTALLATION

Install in the reverse order of removal.


TWEETER

[BOSE AUDIO WITH NAVIGATION]

TWEETER

Exploded View

INFOID:0000000008195430

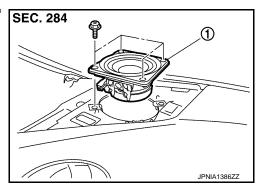

I. Tweeter

Removal and Installation

INFOID:0000000008195431

REMOVAL

- 1. Remove speaker grille. Refer to IP-14, "Exploded View".
- 2. Remove tweeter screws, then lift up tweeter, disconnect connector and remove tweeter.

INSTALLATION

Install in the reverse order of removal.

Н

Α

В

D

Е

J

Κ

L

M

ΑV


C

[BOSE AUDIO WITH NAVIGATION]

REAR SPEAKER

Exploded View

INFOID:0000000008195432

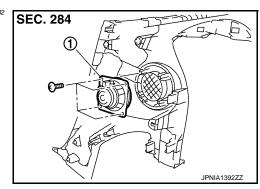

Rear speaker

Removal and Installation

INFOID:0000000008195433

REMOVAL

- 1. Remove rear side finisher. Refer to INT-18, "Exploded View" (coupe models) or INT-51, "Exploded View" (roadster models).
- 2. Remove rear speaker screws, then remove rear speaker.

INSTALLATION


Install in the reverse order of removal.

[BOSE AUDIO WITH NAVIGATION]

WOOFER

Exploded View

INFOID:0000000008195434

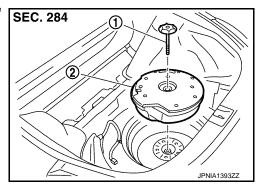

- 1. Clamp
- 2. Woofer

Removal and Installation

INFOID:0000000008195435

REMOVAL

- 1. Remove luggage spacer. Refer to INT-31, "Exploded View".
- 2. Remove clamp, then disconnect woofer connector and remove the woofer.

INSTALLATION

Install in the reverse order of removal.

Н

Α

В

D

Е

Κ

L

M

ΑV

C

REAR WOOFER

< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITH NAVIGATION]

REAR WOOFER

Removal and Installation

INFOID:0000000008195436

REMOVAL

- 1. Remove the mounting clip on the front side of the storage room finisher and the soft top bumper rubber. Refer to RF-222, "STORAGE ROOM FINISHER: Removal and Installation".
- 2. Turn up the storage room finisher to obtain work space.
- 3. Remove rear woofer bracket.
- 4. Remove the screw and disconnect the connecter to remove the rear woofer.

INSTALLATION

Install in the reverse order of removal.

[BOSE AUDIO WITH NAVIGATION]

BOSE AMP.

COUPE

COUPE: Exploded View

INFOID:0000000008195437

Α

В

D


Е

F

M


ΑV

REMOVAL

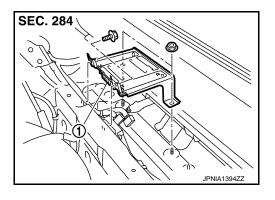

1. BOSE amp.

DISASSEMBLY

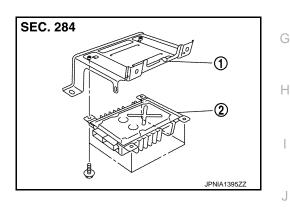

- 1. Bracket
- 2. BOSE amp.

COUPE: Removal and Installation

INFOID:0000000008195438

REMOVAL

- Remove luggage floor spacer front. Refer to <u>INT-31, "Exploded View"</u>.
- 2. Disconnect BOSE amp. connector, remove BOSE amp. with bracket as a single unit from body.
- 3. Remove BOSE amp. bracket screws to remove BOSE amp.

INSTALLATION

Install in the reverse order of removal.

ROADSTER

ROADSTER: Removal and Installation

INFOID:0000000008195439

REMOVAL

- 1. Remove the mounting clip on the front side of the storage room finisher and the soft top bumper rubber. Refer to RF-222, "STORAGE ROOM FINISHER: Removal and Installation".
- 2. Turn up the storage room finisher to obtain work space.
- Remove storage room spacer. Refer to RF-222, "STORAGE ROOM FINISHER: Exploded View".
- Disconnect BOSE amp. connector, remove BOSE amp. with bracket as a single unit from body.
- 5. Remove BOSE amp. bracket screws to remove BOSE amp.

INSTALLATION

BOSE AMP.

[BOSE AUDIO WITH NAVIGATION]

Install in the reverse order of removal.

ANTENNA AMP.


< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITH NAVIGATION]

ANTENNA AMP.

Exploded View

INFOID:0000000008195440

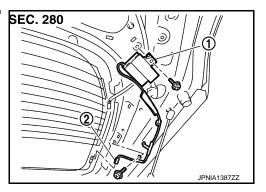

- Antenna amp.
- 2. Connector

Removal and Installation

INFOID:0000000008195441

REMOVAL

- 1. Remove back door finisher side. Refer to INT-33, "Exploded View".
- 2. Disconnect connector and remove screw, then remove antenna amp.

INSTALLATION

Install in the reverse order of removal.

Н

Α

В

D

Е

. I

Κ

L

M


ΑV

0

ANTENNA BASE

Exploded View

INFOID:0000000008195442

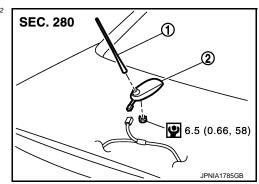

- 1. Antenna rod
- 2. Antenna base

Refer to GI-4, "Components" for symbols in the figure.

Removal and Installation

INFOID:0000000008195443

REMOVAL

- 1. Remove trunk lid finisher inner. Refer to INT-79, "Exploded View".
- 2. Remove antenna base mounting nut, disconnect the antenna base connector.
- 3. Remove antenna base.

INSTALLATION

Installation is the reverse order of removal.

CAUTION:

Be careful about tightening torque. Antenna sensitivity becomes poor, and when it is excessive, trunk lid panel may be deformed, when antenna base mounting nut tightening torque is loose.

MULTIFUNCTION SWITCH

< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITH NAVIGATION]

MULTIFUNCTION SWITCH

Exploded View

INFOID:0000000008195444

Α

В


D

Е

REMOVAL

Refer to IP-14, "Exploded View".

DISASSEMBLY

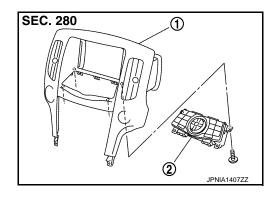

- 1. Cluster lid C
- 2. Multifunction switch

Removal and Installation

INFOID:0000000008195445

REMOVAL

- 1. Remove cluster lid C. Refer to IP-14, "Exploded View".
- 2. Remove multifunction switch screws, then remove multifunction switch from cluster lid C.

INSTALLATION

Install in the reverse order of removal.

Н

Κ

L

M

AV

C


PRESET SWITCH

Exploded View

REMOVAL

Refer to IP-14, "Exploded View".

DISASSEMBLY

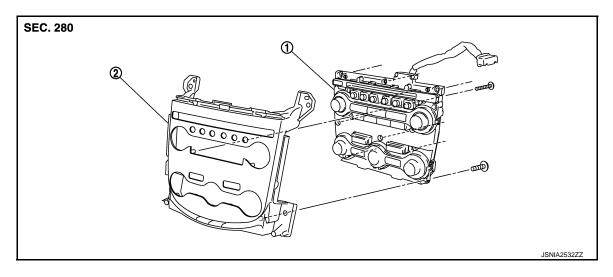

1. Preset switch


2. Cluster lid C finisher

Removal and Installation

INFOID:0000000008195447

REMOVAL

- 1. Remove cluster lid C. Refer to IP-14, "Exploded View".
- 2. Remove preset switch with cluster lid C finisher as a single unit from the body.
- Remove preset switch screws (A) (B) to remove preset switch (1) from cluster lid C finisher.

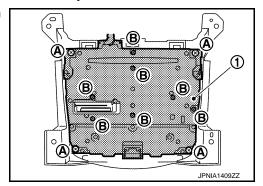

INSTALLATION

	STEERING SWITCH	
< REMOVAL AND INSTALLATION >		[BOSE AUDIO WITH NAVIGATION]
STEERING SWITCH		
Exploded View		INFOID:000000008195448
Refer to SR-14, "Exploded View".		
Removal and Installation		INFOID:000000008195449
REMOVAL Refer to SR-14, "Exploded View". INSTALLATION Install in the reverse order of removal.		

AV

A

В

С

D

Е

F

G

Н

J

Κ

L

M

0

USB CONNECTOR

< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITH NAVIGATION]

USB CONNECTOR

Removal and Installation

INFOID:0000000008195450

REMOVAL

- 1. Remove center console. Refer to IP-25, "Exploded View".
- 2. Push the pawl from the back of center console to remove USB connector.

INSTALLATION

AUXILIARY INPUT JACKS

< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITH NAVIGATION]

AUXILIARY INPUT JACKS

Exploded View

INFOID:0000000008195451


Α

В

REMOVAL

Refer to IP-25, "Exploded View".

DISASSEMBLY

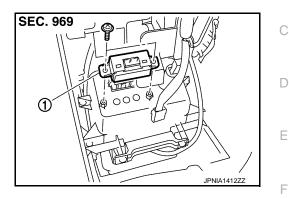

1. Auxiliary input jacks

Removal and Installation

INFOID:0000000008195452

REMOVAL

- 1. Remove center console. Refer to IP-25, "Exploded View".
- 2. Remove screws to remove auxiliary input jacks from the center console.

INSTALLATION

Install in the reverse order of removal.

J

Н

K

L

M

ΑV

C


MICROPHONE

Exploded View

REMOVAL

Refer to INL-38, "Exploded View" (Coupe models) or INL-84, "Exploded View" (Roadster models).

DISASSEMBLY

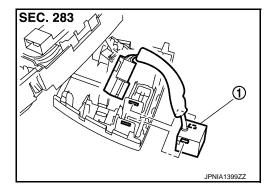

1. Microphone

Removal and Installation

INFOID:0000000008195454

REMOVAL


- 1. Remove map lamp. Refer to INL-38, "Exploded View" (coupe models), or INL-84, "Exploded View" (road-ster models).
- 2. Press the pawl to remove microphone from map lamp.

INSTALLATION

GPS ANTENNA

Feeder Layout

COUPE MODELS

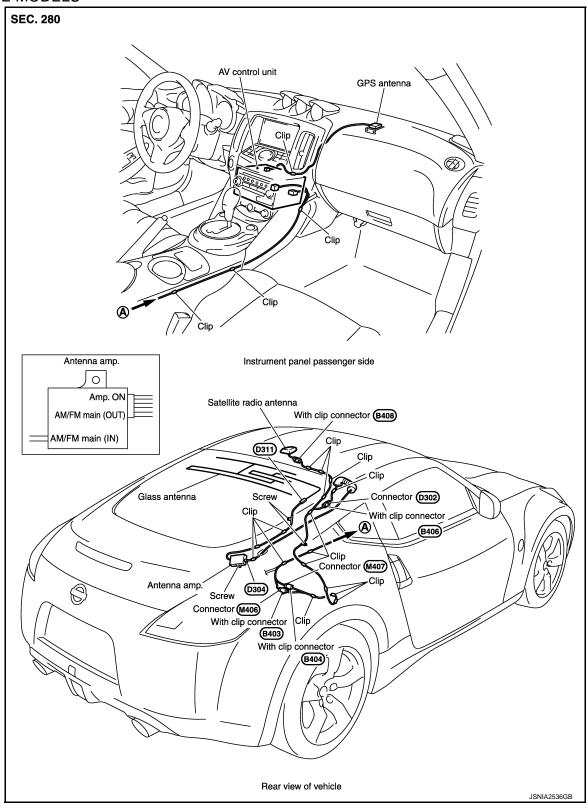

C

D

Α

В

Е

F

G

П


<

M

ΑV

0

ROADSTER MODELS

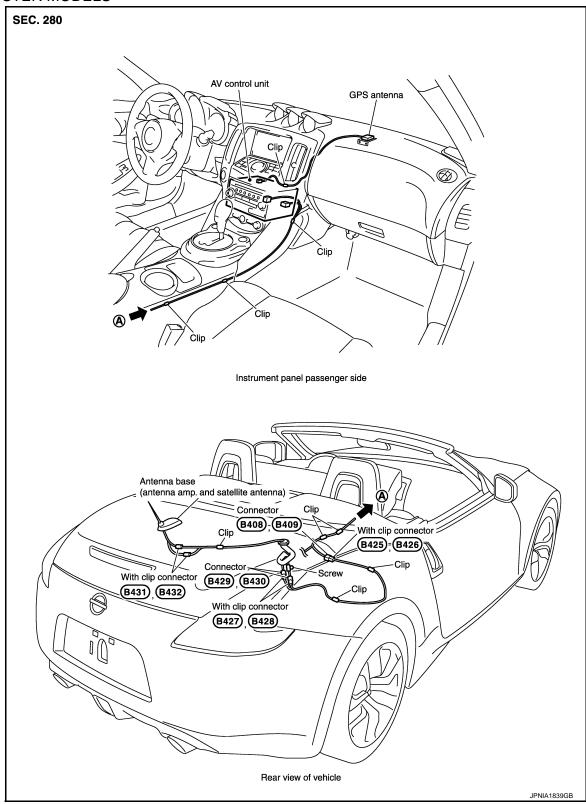

Removal and Installation

INFOID:0000000008195456

REMOVAL


1. Remove installment panel. Refer to IP-14, "Exploded View".

GPS ANTENNA

< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITH NAVIGATION]

2. Remove screw to remove GPS antenna (1) from instrument panel.

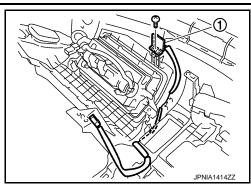

INSTALLATION

Install in the reverse order of removal.

Е

Α

В

C

D

F

Н

Κ

L

M

ΑV


0

Ρ

SATELLITE RADIO ANTENNA

Exploded View

INFOID:0000000008195457

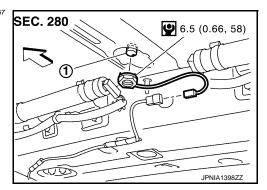

Satellite radio antenna

Refer to GI-4, "Components" for symbols in the figure.

Removal and Installation

INFOID:0000000008195458

REMOVAL

- 1. Remove rear pillar finisher (LH/RH). Refer to INT-18, "Exploded View".
- Pull down headlining (rear side) and obtain space for work between vehicle and headlining. Refer to INT-28, "Exploded View".
- 3. Disconnect satellite radio antenna connector.
- 4. Remove satellite radio antenna mounting nut, then remove satellite radio antenna from roof panel.

INSTALLATION

Install in the reverse order of removal.

CAUTION:

- Never bend headlining when pull down headlining (rear side).
- When satellite radio antenna mounting nut tightening torque is loose, be careful about tightening torque. Antenna sensitivity becomes poor, and when it is excessive, roof panel may become deformed.

REAR VIEW CAMERA

Removal and Installation

INFOID:0000000008195459

Α

В

D

M

ΑV

REMOVAL

- 1. Remove license plate lamp bracket. Refer to EXT-17, "Removal and Installation".
- 2. Remove rear camera mounting screws to remove rear camera.

INSTALLATION

Install in the reverse order of removal.


NOTE:

Adjust the guide line position if the guide line position is shifted after installing the rear view camera. Refer to <u>AV-265</u>, "Adjustment".

Adjustment INFOID:000000008195460

Adjust the guide line position if the guide line position is shifted after installing the rear view camera.

- Draw lines on rearward area of the vehicle passing through the following points: 200 mm (7.87 in) from both sides of the vehicle, and 0.5 m (1.64 ft), 1.0 m (3.28 ft) from the rear end of the bumper.
- 2. Set into "Adjust offset of rear view camera" mode of Confirmation / Adjustment mode.

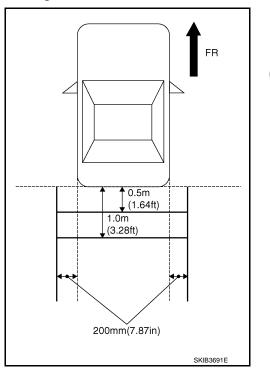


 Rotate the center dial, and then select the guiding line pattern so that its angle is aligned with the correction line of the rear of the vehicle.

Selected pattern :
$$(-10^{\circ}) - (10^{\circ})$$

4. Make fine adjustment to the correction line of the rear of the vehicle with up/down/left/right switches so that its position is aligned with the guiding line. Press "OK" switch and record the adjusted guiding line position to the camera control unit.



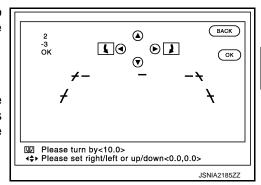

CAUTION:

Never operate other function such as pressing BACK while writing index data.

STEERING ANGLE SENSOR

< REMOVAL AND INSTALLATION >

[BOSE AUDIO WITH NAVIGATION]

STEERING ANGLE SENSOR

Removal and Installation

INFOID:0000000008195461

REMOVAL

- 1. Remove the spiral cable. Refer to SR-17, "Removal and Installation".
- 2. Remove the screws to remove the steering angle sensor from the spiral cable.

INSTALLATION

ANTENNA FEEDER

COUPE

COUPE: Feeder Layout

INFOID:0000000008195462

Α


В

D

Е

M

ΑV

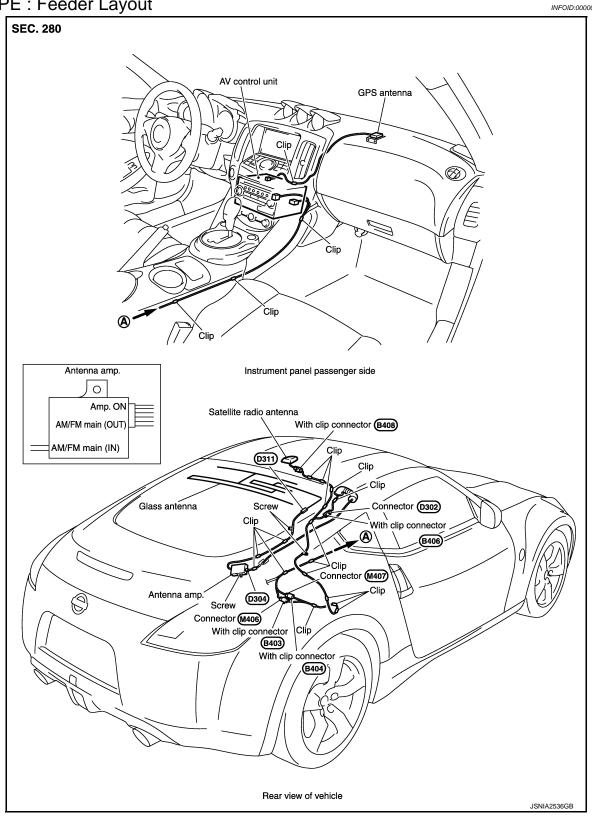

ROADSTER

ROADSTER: Feeder Layout

INFOID:0000000008195463

