# SECTION STEERING CONTROL SYSTEM

 $\mathsf{D}$ 

Е

F

STC

Н

J

K

L

M

Ν

0

Р

# **CONTENTS**

PRECAUTION3	HYDRAULIC PUMP ELECTRIC POWER
PRECAUTIONS	STEERING SYSTEM         14           Wiring Diagram         14
(SRS) "AIR BAG" and "SEAT BELT PRE-TEN-SIONER"	BASIC INSPECTION19
Service Notice and Precautions for Hydraulic Pump Electric Power Steering System3	DIAGNOSIS AND REPAIR WORK FLOW      19         Work Flow
SYSTEM DESCRIPTION4	DTC/CIRCUIT DIAGNOSIS22
COMPONENT PARTS	C1143 STEERING ANGLE SENSOR         22           DTC Logic         22           Diagnosis Procedure         22
SYSTEM6	C1601 BATTERY POWER SUPPLY23
HYDRAULIC PUMP ELECTRIC POWER STEER- ING SYSTEM6	DTC Logic
HYDRAULIC PUMP ELECTRIC POWER STEERING SYSTEM: System Description6 HYDRAULIC PUMP ELECTRIC POWER	C1602 NO TUNING SET       26         DTC Logic       26         Diagnosis Procedure       26
STEERING SYSTEM : Fail-safe8 HYDRAULIC PUMP ELECTRIC POWER STEERING SYSTEM : Protection Function9	C1606 EPS MOTOR         27           DTC Logic         27           Diagnosis Procedure         27
DIAGNOSIS SYSTEM (POWER STEERING CONTROL MODULE)10  CONSULT Function	C1607, C1608 POWER STEERING CON- TROL MODULE28 DTC Logic28
ECU DIAGNOSIS INFORMATION11	Diagnosis Procedure
POWER STEERING CONTROL MODULE11 Reference Value11	<b>C160A HEAT PROTECTION29</b> DTC Logic
Fail-safe12Protection Function12DTC Inspection Priority Chart13DTC Index13	U1000 CAN COMM CIRCUIT       30         Description       30         DTC Logic       30         Diagnosis Procedure       30
WIRING DIAGRAM14	HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP31

Component Function Check  Diagnosis Procedure		STEERING WHEEL TURNING FORCE IS HEAVY OR LIGHT	3/
SYMPTOM DIAGNOSIS		Diagnosis Procedure	
HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP DOES NOT TURN ON	. 32	UNBALANCE STEERING WHEEL TURNING FORCE AND RETURN BETWEEN RIGHT AND LEFT	
Description Diagnosis Procedure		UNBALANCE STEERING WHEEL TURNING	50
HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP DOES NOT		Procedure Diagnosis Procedure	
TURN OFF		UNIT REMOVAL AND INSTALLATION	. 39
Description  Diagnosis Procedure		POWER STEERING CONTROL MODULE Removal and Installation	

#### **PRECAUTIONS**

#### < PRECAUTION >

# **PRECAUTION**

#### **PRECAUTIONS**

Precaution for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRF-TFNSIONER"

The Supplemental Restraint System such as "AIR BAG" and "SEAT BELT PRE-TENSIONER", used along with a front seat belt, helps to reduce the risk or severity of injury to the driver and front passenger for certain types of collision. Information necessary to service the system safely is included in the SR and SB section of this Service Manual.

#### **WARNING:**

- To avoid rendering the SRS inoperative, which could increase the risk of personal injury or death in the event of a collision which would result in air bag inflation, all maintenance must be performed by an authorized NISSAN/INFINITI dealer.
- Improper maintenance, including incorrect removal and installation of the SRS, can lead to personal injury caused by unintentional activation of the system. For removal of Spiral Cable and Air Bag Module, see the SR section.
- Do not use electrical test equipment on any circuit related to the SRS unless instructed to in this Service Manual. SRS wiring harnesses can be identified by yellow and/or orange harnesses or harness connectors.

PRECAUTIONS WHEN USING POWER TOOLS (AIR OR ELECTRIC) AND HAMMERS

- When working near the Airbag Diagnosis Sensor Unit or other Airbag System sensors with the Ignition ON or engine running, DO NOT use air or electric power tools or strike near the sensor(s) with a hammer. Heavy vibration could activate the sensor(s) and deploy the air bag(s), possibly causing serious injury.
- When using air or electric power tools or hammers, always switch the Ignition OFF, disconnect the battery and wait at least three minutes before performing any service.

Service Notice and Precautions for Hydraulic Pump Electric Power Steering System

- Check each tire for proper air pressure and size. Refer to WT-61, "Tire".
- Verify that the steering system components are Genuine NISSAN parts and have been installed properly.
- Check the steering column for loose mounting bolts.
- Check the steering gear assembly for loose mounting bolts. Check the inner sockets and outer sockets for damage or wear. Inspect the boots and seals for leakage of power steering fluid.
- Verify proper wheel alignment. Refer to <u>FSU-6</u>, "Inspection and Adjustment".
- Check for any damage, wear, or modification to the suspension and body that would result in increased weight or an improper wheelarch height. Refer to FSU-26, "Wheelarch Height (Unladen\*1)".
- Check for proper battery voltage.
- Verify that all power steering pump assembly connections are clean and fully seated.
- Verify that only Genuine NISSAN E-PSF is used. Use of any power steering fluid other than Genuine NIS-SAN E-PSF will prevent the power steering system from proper operation.
- An audible high pitch noise may be heard from the engine compartment when the steering wheel is operated, particularly at low speeds such as a parking lot maneuver. This condition is not a malfunction, rather normal system operation. Steering at low speeds or parking lot maneuvers demands higher hydraulic assistance, resulting in larger power steering pump load and increased system noise.
- The power steering pump is electrically controlled by the power steering control module.
- Before connecting or disconnecting the power steering control module harness connectors, turn ignition switch "OFF" and disconnect battery ground cable. Battery voltage is applied to power steering control module even if ignition switch is turned "OFF".

STC-3

STC

Α

В

D

Е

K

M

INFOID:0000000010482266


2015 Altima Sedan

# SYSTEM DESCRIPTION

# **COMPONENT PARTS**

# **Component Parts Location**

INFOID:0000000010482267

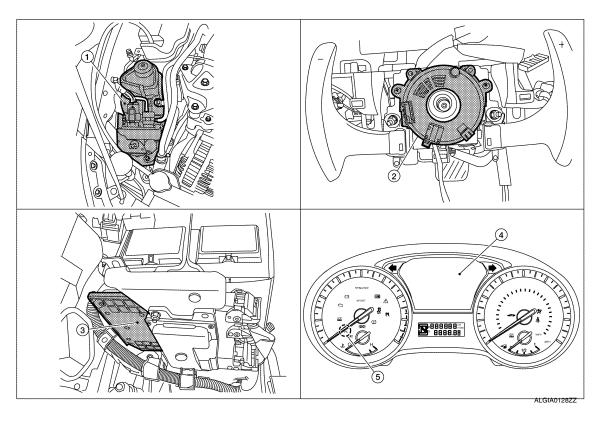

- 1. Power steering oil pump assembly
- Steering angle sensor (view with the steering wheel removed)

3.

**ECM** 

- 4. Combination meter
- 5. EPS warning light

# **Component Description**

INFOID:0000000010482268


Component parts Reference		
Power steering oil pump assembly	STC-5, "Power Steering Oil Pump Assembly"	
Steering angle sensor	Transmits steering angle sensor signal to the power steering control module via CAN communication.	
ECM	Transmits engine speed signal to the power steering control module via CAN communication.	
Combination meter	Transmits vehicle speed signal to the power steering control module via CAN communication. The combination meter also displays the EPS warning light.	

#### **COMPONENT PARTS**

#### < SYSTEM DESCRIPTION >

# Power Steering Oil Pump Assembly

The power steering oil pump assembly is primarily composed of the reservoir tank (1), power steering oil pump (2), power steering motor (3), and power steering control module (4).

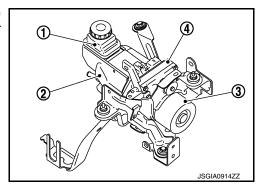

INFOID:0000000010482269

Α

В

D

Е

#### RESERVOIR TANK

Fluid is filled from the reservoir tank.

#### POWER STEERING OIL PUMP

The power steering oil pump is driven by the power steering motor and generates hydraulic oil pressure in the system.

#### POWER STEERING MOTOR

The power steering motor is controlled by the power steering control module and drives the power steering oil pump.

#### POWER STEERING CONTROL MODULE

By receiving steering angle sensor signal and vehicle speed signal, the power steering control module calculates hydraulic pressure of the hydraulic pump electric power steering system according to the driving conditions. The power steering control module controls the power steering motor.

STC

Н

K

L

M

Ν

0

#### **SYSTEM**


#### HYDRAULIC PUMP ELECTRIC POWER STEERING SYSTEM

# HYDRAULIC PUMP ELECTRIC POWER STEERING SYSTEM: System Description

NFOID:0000000010482270

- The system is composed primarily of the power steering oil pump assembly (power steering control module, power steering motor, power steering oil pump, and reservoir tank), hydraulic pipes, and steering gear assembly.
- The power steering control module controls the speed of the power steering motor according to the vehicle speed and steering angle speed. By changing the power steering oil pump flow, the power steering control module controls the steering assist force.
- According to the power steering motor control, the system hydraulic pressure is transmitted from the power steering motor to power steering oil pump. The power steering oil pump is driven by the system hydraulic pressure.
- After engine start, the hydraulic pump electric power steering system performs control.
- When a malfunction occurs in the system, the fail-safe function stops the hydraulic pump electric power steering system (manual steering state) or restricts its operation (certain steering assist force). Refer to <u>STC-8, "HYDRAULIC PUMP ELECTRIC POWER STEERING SYSTEM: Fail-safe"</u>.
- When the power steering function is used continuously in an extreme manner, the protective function reduces the output to the power steering motor. Refer to <a href="STC-9">STC-9</a>, "HYDRAULIC PUMP ELECTRIC POWER STEERING SYSTEM: Protection Function".

#### SYSTEM DIAGRAM

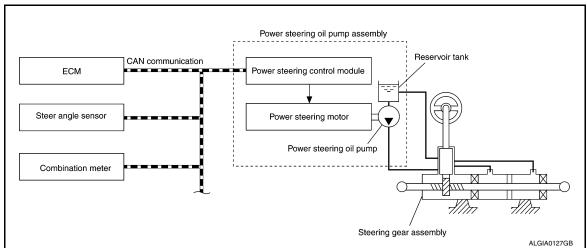


#### INPUT/OUTPUT SIGNAL

Communicates the signal from each control unit via CAN communication.

Control unit	Signal status		
ECM	Transmits engine status signal to power steering control module via CAN communication.		
Steering angle sensor  Transmits steering angle sensor signal to power steering control module via CA nication.			
	Transmits vehicle speed signal to power steering control module via CAN communication.		
Combination meter	Receives hydraulic pump electric power steering warning lamp signal from power steering control module via CAN communication.		


#### OPERATION CHARACTERISTICS

When the steering angle speed is high or the vehicle speed is low, force is generated by increasing discharge amount from the power steering oil pump and by raising system hydraulic pressure.

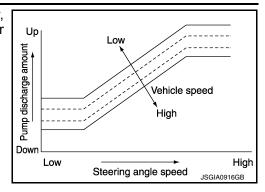


#### **OPERATION PRINCIPLE**

When Steering Wheel is in the Neutral Position

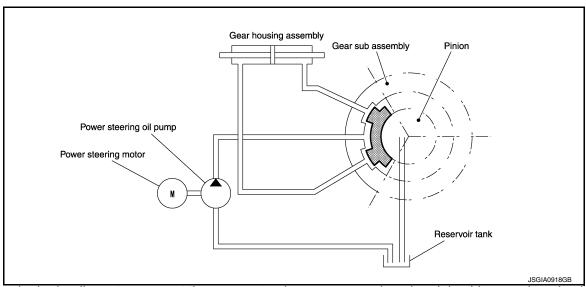

Because the hydraulic routes open at the power steering pump, gear housing right side, gear housing left side, and reservoir tank, the hydraulic pressure applied to the right side and left side of the gear housing is equal and no steering assist force is generated.

When Steering Wheel is Rotated to the Right

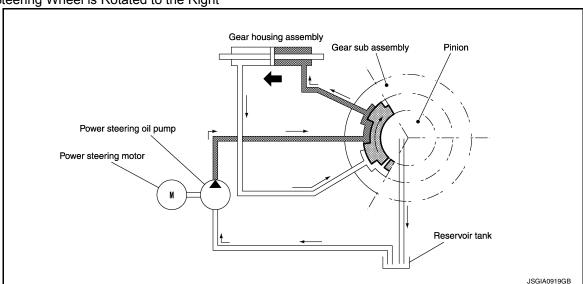

The hydraulic routes open from power steering pump to gear housing right side and from gear housing left side to reservoir tank, providing left direction assist force to the rack.

STC-7 Revision: May 2014 2015 Altima Sedan В

Α

D

Е


F

STC

K

Ν

When Steering Wheel is Rotated to the Left

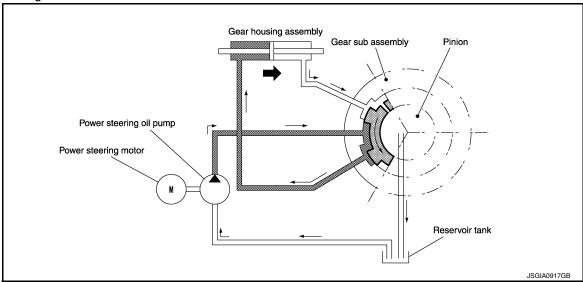

The hydraulic routes open from power steering pump to gear housing left side and from gear housing right side to reservoir tank, providing right direction assist force to the rack.

#### CONDITIONS FOR HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP ON

- When the hydraulic pump electric power steering system is operating and steering assist force is being generated, the hydraulic pump electric power steering warning lamp is OFF.
- When the hydraulic pump electric power steering system is stopped by the fail-safe or protective function and steering assist force is not being generated, the hydraulic pump electric power steering warning lamp turns ON to inform the driver that the system is in the manual steering state.
   NOTE:

When the hydraulic pump electric power steering system warning lamp turns ON according to the protection system, the cause is internal high temperature state of the hydraulic pump electric power steering system. By stopping the engine, internal temperature of the system decreases. After starting the engine, the system returns to the normal state and the hydraulic pump electric power steering system warning lamp turns OFF. (The system is not malfunctioning.) For information about the protective function, refer to <a href="STC-9">STC-9</a>, "HYDRAU-LIC PUMP ELECTRIC POWER STEERING SYSTEM: Protection Function".

• When the ignition switch is turned ON, this lamp turns ON for lamp check (system check). When the system is operating normally, the lamp turns OFF after the engine starts.

Condition	Hydraulic pump electric power steering warning lamp
Ignition switch ON. (Lamp check)	ON
After engine start (steering assist force is generated)	OFF
When steering assist is stopped	ON

#### HYDRAULIC PUMP ELECTRIC POWER STEERING SYSTEM: Fail-safe INFOID-000000010482271

When an error occurs in the hydraulic pump electric power steering system, fail-safe brings the system to a halt (manual steering) or restricted (constant steering assist level) state. When the system is in a halt state, fail-safe turns ON the hydraulic pump electric power steering warning lamp to warn the driver that the hydraulic pump electric power steering system is in the manual steering state.

DTC	Fail-safe condition		
C1143	Certain steering assist force		
C1601	Manual steering state		
C1606	Manual steering state		
C1607	Certain steering assist force		

#### **SYSTEM**

#### < SYSTEM DESCRIPTION >

DTC	Fail-safe condition
C1608	Manual steering state
U1000	Normal control NOTE: If the cause is in a different ECU, the state changes to fixed steering assist force.

#### HYDRAULIC PUMP ELECTRIC POWER STEERING SYSTEM: Protection Function

NFOID:0000000010482272

- When the steering wheel is operated repeatedly or turned all the way for a long period during parking or low speed driving, the function of the hydraulic pump electric power steering system becomes limited to prevent the system from overheating. Continued operation of the steering wheel will cause the hydraulic pump electric power steering system to stop and the hydraulic pump electric power steering system warning lamp may come ON. In this case, the steering wheel operation temporarily becomes hard. This is not a malfunction. When the engine is turned OFF (ignition switch OFF) and steering operation is stopped for a while, the temperature of the hydraulic pump electric power steering system decreases and the steering operation returns to normal after restarting the engine.
- Then, the hydraulic pump electric power steering system warning lamp turns OFF. If the system is OFF
  under the protection state, the hydraulic pump electric power steering system warning lamp turns ON to
  warn that the system is in the manual steering state. (This is not a system malfunction.) In addition, the following DTC remains to distinguish from malfunction.

DTC	vehicle condition
C160A	The system temporarily enters the manual steering state. (This is not a hydraulic pump electric power steering system malfunction.)

STC

Α

В

D

Е

Н

K

L

M

Ν

0

#### **DIAGNOSIS SYSTEM (POWER STEERING CONTROL MODULE)**

#### < SYSTEM DESCRIPTION >

# DIAGNOSIS SYSTEM (POWER STEERING CONTROL MODULE)

#### CONSULT Function

INFOID:0000000010482273

#### **CAUTION:**

After disconnecting the CONSULT vehicle interface (VI) from the data link connector, the ignition must be cycled OFF  $\rightarrow$  ON (for at least 5 seconds)  $\rightarrow$  OFF. If this step is not performed, the BCM may not go to "sleep mode", potentially causing a discharged battery and a no-start condition.

#### **FUNCTION**

CONSULT can display each diagnostic item using the diagnostic test modes shown as per the following:

Diagnostic test mode	Function
ECU identification	The part number stored in the control unit can be read.
Self Diagnostic Results	Self-diagnostic results and freeze frame data can be read and erased quickly.
Data monitor	Input/Output data in the power steering control module can be read.

#### **ECU IDENTIFICATION**

Displays the part number stored in the control unit.

#### SELF-DIAG RESULTS MODE

Refer to STC-13, "DTC Index".

When "CRNT" is displayed on "Self Diagnostic Result".

The system is presently malfunctioning.

When "PAST" is displayed on "Self Diagnostic Result".

System malfunction in the past is detected, but the system is presently normal.

#### DATA MONITOR MODE

Monitor item (Unit)	Remarks
BATTERY VOLT (V)	Displays the power supply voltage for power steering control module.
STEERING ANGLE (deg)	Displays the steering angle based on the steering angle signal transmitted by CAN communications.
STR ANG SPD (deg/s)	Displays the steering angle speed based on the steering angle signal transmitted by CAN communications.
MOTOR CURRENT (A)	Displays the current value consumed by power steering control module.
MTR REV SPD COMM (rpm)	Displays the power steering motor speed command value.
MTR REV SPD (rpm)	Displays the power steering motor speed.
C/U TEMP (°C or °F)	Displays the temperature of the power steering control module.
C/U TEMP A (°C or °F)	Displays the temperature of the power steering control module.
MTR ASSIST (%)	Displays the current percentage of the allowable assist ratio power steering motor.
ESTM VHCL SPD (km/h or mph)	Displays the vehicle speed calculated by the power steering control module.
WARNING LAMP (On/Off)	Hydraulic pump electric power steering system warning lamp control status is displayed.
ENGINE STATUS (STOP/RUN/CRANK)	Engine speed is displayed from engine condition signal with CAN communication
VHCL SPD JUDGE (OK/NG)	Displays the receiving status of the vehicle speed signal transmitted by CAN communications.

< ECU DIAGNOSIS INFORMATION >

# **ECU DIAGNOSIS INFORMATION**

# POWER STEERING CONTROL MODULE

Reference Value

#### VALUES ON THE DIAGNOSIS TOOL

Monitor itom	Data monitor		
Monitor item	Condition		Display value
BATTERY VOLT	Engine running		Battery voltage (V)
CTEEDING ANGLE	The steering wheel is not steered.		Approx. 0.0 deg
STEERING ANGLE	The steering wheel is	s steered.	Displays steering angle (deg)
CTD AND CDD	The steering wheel is	s not steered.	Approx. 0.0 deg/s
STR ANG SPD	The steering wheel is	s steered.	Displays steering angle speed (deg/s)
MOTOR CURRENT	Engine running	Steering wheel: Not steering (There is no steering force)	MAX approx. 10 A*1
WOTOK GOKKLINT	Lingine running	Steering wheel: Right or left turn	Displays consumption current of power steering control module (A)
MTR REV SPD COMM	Engine running	Steering wheel: Not steering (There is no steering force)	Shows an almost constant value (rpm)
WITCHEV SPD COMM	Lingine running	Steering wheel: Right or left turn	The value changes as a steering speed (rpm)
MTR REV SPD		Steering wheel: Not steering (There is no steering force)	Shows an almost constant value $(rpm)^{*2}$
	Engine running	Steering wheel: Right or left turn	The value changes as a steering speed (rpm)*2
C/U TEMP	Engine running		Displays temperature of inside of power steering control module (°C or °F)
C/U TEMP A	Engine running		Displays temperature of inside of power steering control module (°C or °F)
MTR ASSIST	Engine running		100% <sup>*3</sup>
	Vehicle stopped		0.00 km/h or mph
ESTM VHCL SPD	While driving		Approximately equal to the indication on speedometer $^{*4}$ (inside of $\pm 10\%$ )
WARNING LAMP	Hydraulic pump elec	tric power steering warning lamp: ON	On
WARNING LAMP	Hydraulic pump electric power steering warning lamp: OFF		Off
	Engine not running		STOP
ENGINE STATUS	Engine running		RUN
	Engine cranking		CRANK
	Vehicle speed signal	can be received via CAN communication	ОК
VHCL SPD JUDGE	Vehicle speed signal cannot be received via CAN communication		NG

<sup>\*1:</sup> The value changes according to load of power steering motor.

Revision: May 2014

**STC-11** 

---

Α

D

Е

. .

K

L

M

Ν

0

Р

2015 Altima Sedan


<sup>\*2:</sup> This is in close agreement with a motor speed command value. Although a quick steering operation may cause disagreement, this is not a malfunction.

<sup>\*3:</sup> Usually, 100% is displayed. An excessive steering operation gradually lowers the percentage. When left standing, the percentage returns to 100%.

#### < ECU DIAGNOSIS INFORMATION >

\*4: This may not agree with the speedometer indication immediately after the ignition switch is turned ON. This is not a malfunction.

#### TERMINAL LAYOUT

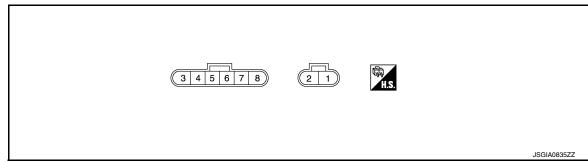

#### PHYSICAL VALUES

_	Ferminal No. (Wire Color)  Description		Condition	Value	
+	_	Signal name	Input/Output		
1 (W)	Ground	Battery power supply	Input	Always	Battery Voltage
2 (B)	Ground	Ground	_	Always	0 V
5	Ground	Ignition power supply	Input	Ignition switch: ON	Battery Voltage
(BR)			ignition power supply	Input	прис
7 (P)	_	CAN low	Input/Output	_	_
8 (L)	_	CAN high	Input/Output	_	_

Fail-safe

When an error occurs in the hydraulic pump electric power steering system, fail-safe brings the system to a halt (manual steering) or restricted (constant steering assist level) state. When the system is in a halt state, fail-safe turns ON the hydraulic pump electric power steering warning lamp to warn the driver that the hydraulic pump electric power steering system is in the manual steering state.

DTC	Fail-safe condition
C1143	Certain steering assist force
C1601	Manual steering state
C1606	Manual steering state
C1607	Certain steering assist force
C1608	Manual steering state
U1000	Normal control NOTE: If the cause is in a different ECU, the state changes to fixed steering assist force.

#### **Protection Function**

INFOID:0000000010482276

• When the steering wheel is operated repeatedly or turned all the way for a long period during parking or low speed driving, the function of the hydraulic pump electric power steering system becomes limited to prevent the system from overheating. If the steering wheel is operated further more, the hydraulic pump electric power steering system stops and the hydraulic pump electric power steering system warning lamp may be turned ON. In this case, the steering wheel operation temporarily becomes hard. This is not a malfunction. When the engine is turned OFF (ignition switch OFF) and steering operation is stopped for a while, the temperature of the hydraulic pump electric power steering system decreases and the steering operation returns to normal after restarting the engine.

Revision: May 2014 STC-12 2015 Altima Sedan

#### < ECU DIAGNOSIS INFORMATION >

• Then, the hydraulic pump electric power steering system warning lamp turns OFF. If the system is OFF under the protection state, the hydraulic pump electric power steering system warning lamp turns ON to warn that the system is in the manual steering state. (This is not a system malfunction.) In addition, the following DTC remains to distinguish from malfunction.

DTC	vehicle condition
C160A	The system temporarily enters the manual steering state. (This is not a hydraulic pump electric power steering system malfunction.)

# **DTC Inspection Priority Chart**

INFOID:0000000010482277

When multiple DTCs are detected simultaneously, check one by one depending on the following priority list:

Priority	Priority order item (DTC)
1	C1601 BATTERY VOLT C1602 NO TUNING SET C1606 EPS MOTOR C1608 CONTROL UNIT
2	• C1607 EEPROM
3	C160A HEAT PROTECTION
4	C1143 ST ANG SEN CIRCUIT     U1000 CAN COMM CIRCUIT

DTC Index

DTC	Items (CONSULT screen terms)	Reference
C1143	ST ANG SEN CIRCUIT	STC-22, "DTC Logic"
C1601	BATTERY VOLT	STC-23, "DTC Logic"
C1602	NO TUNING SET	STC-26, "DTC Logic"
C1606	EPS MOTOR	STC-27, "DTC Logic"
C1607	EEPROM	STC-28, "DTC Logic"
C1608	CONTROL UNIT	STC-28, "DTC Logic"
C160A	HEAT PROTECTION	STC-29, "DTC Logic"
U1000	CAN COMM CIRCUIT	STC-30, "DTC Logic"

#### NOTE:

If two or more DTCs are detected, refer to STC-13, "DTC Inspection Priority Chart".

Revision: May 2014 STC-13 2015 Altima Sedan

C

Α

В

D

Е

F

STC

Н

K


L

N

 $\cap$ 

# WIRING DIAGRAM

# HYDRAULIC PUMP ELECTRIC POWER STEERING SYSTEM

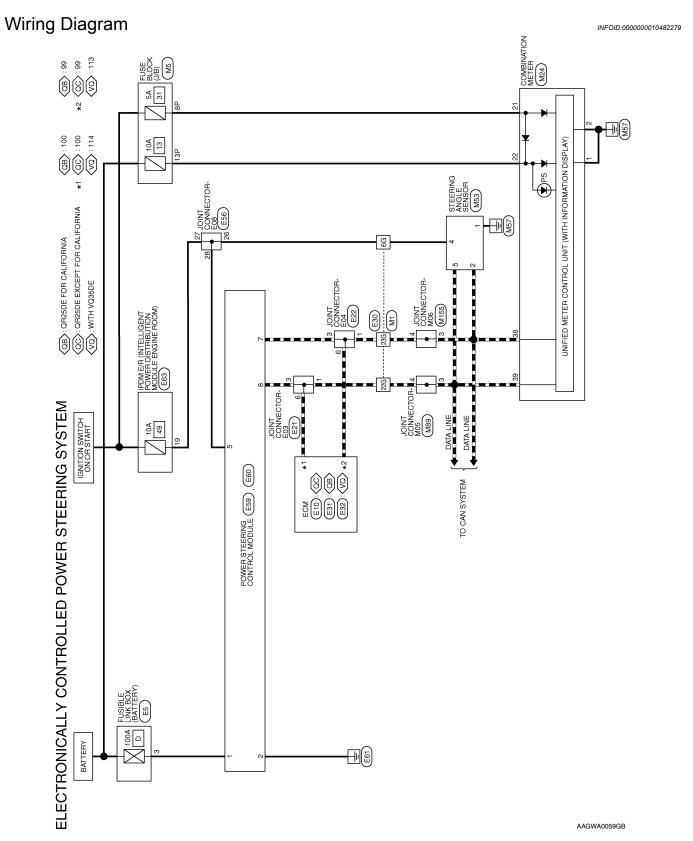

# HYDRAULIC PUMP ELECTRIC POWER STEERING SYSTEM

M5   M5   Connector Name   FUSE BLOCK (J/B)   Connector Color   WHITE   MHITE   MHIT	M89   Signal Name   Signal Name   Signal Name   Signal Name   Color of   Color of   Signal Name   Color of   Color	
Connector No. M5 Connector Name FUSE E Connector Color WHITE  The BE BE HAS  The BE	Connector No. Connector Name Connector Color H.S.  3 L 4 L	
Terminal No.   Color of   Signal Name   GG   G   G   C   C   C   C   C   C	Connector No.   M53	
20 0 100 0 0 100 0 0 0 0 0 0 0 0 0 0 0 0	M24   Connector Name   COMBINATION METER   Connector Name   COMBINATION METER   Connector Color   WHITE	
Connector No. M1  Connector Name WIRE TO WIRE  Connector Color WHITE  Connector Color WHITE  To 2020 2020 2020 2020 2020 2020 2020 20	Connector No. M24  Connector Name COMBI  Connector Name COMBI  LS.  H.S.  20 19 18 17 16 15 14 13 12 17  20 19 18 17 16 15 14 13 12 17  a) 39 37 35 35 34 33 22 37  Color of  Wire  2 B  2 B  2 B  2 B  2 B  3 COLOR OF  Wire  3 B  2 B  3 B  3 B  3 B  3 B  4 B  2 B  3 B  3 B  3 B  4 B  5 B  5 B  6 B  7 B  8 B  7 B  8 B  8 B  9 B  9 B  9 B  9 B  9 B  9	

Revision: May 2014 STC-15 2015 Altima Sedan


# HYDRAULIC PUMP ELECTRIC POWER STEERING SYSTEM

Connector No.

	ECM (QR25DE EXCEPT FOR CALIFORNIA)	AY	99 1021/06/109/118/118 122 126 99 1021/06/119/118/118 122 126 109/07/111/115/118 123 127	Signal Name	CAN-L	CAN-H
E10		or GRAY	97 101 100 104 103	Color of Wire	Д	
Connector No.	Connector Name	Connector Color	H.S.	Terminal No.	66	100
	~			ame		

FUSIBLE LINK BOX (BATTERY)	44	<u> 4 8</u>	Signal Name	-
	lor GRAY		Color of Wire	M
Connector Name	Connector Color	斯 H.S.	Terminal No.	٣

55	JOINT CONNECTOR-M06	WHITE	4 3 2 1 1	Signal Name	1	
. M155				Color of Wire	Ь	۵
Connector No.	Connector Name	Connector Color	朝 H.S.	Terminal No.	3	,

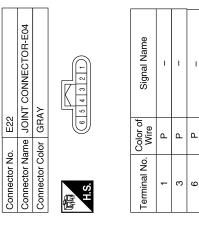

Connector Na	ame JO	Connector Name JOINT CONNECTOR-E03
Connector Color	olor GRAY	AY
原面 H.S.		5 4 3 2 1
Terminal No.	Color of Wire	Signal Name
1	٦	1
3	٦	_
9	٦	ı

AAGIA0160GB

Connector No. E21


# HYDRAULIC PUMP ELECTRIC POWER STEERING SYSTEM
 
#### < WIRING DIAGRAM >

	CALIFORNIA)	GRAY		97   101   105   108   117   128   128   129   109   109   101   101   129   1	Color of Signal Name	P CAN-L	CAN-T		E59		BLACK	3 4 5 6 7 8	Color of Signal Name	1		BR VIGN	- CAN-L	L CAN-H	
Connector Name		Connector Color		H.S.	Terminal No.	66	200		Connector No.	Connector Name	Connector Color	是 H.S.	Terminal No.	3		. S		8	
Signal_Name	ı	1	ı							JOINT CONNECTOR-E08 WHITE		11 10 9 8 7 6 5 4 3 2 1 1 22 21 20 19 18 17 16 15 14 13 12	28 27 26 25 24 23		Signal Name	1	1	ı	
Terminal No. Wire	6G BR	22G L	23G P						Connector No. E56	Connector Name JOINT C		H.S. (11 10 9 8 7 7 7 12 2 1 20 19 18	33 32 31 30 29		Terminal No. Wire	26 BR		28 BH	
				22G 11G	32G31G 42G	526 516	72G71G 82G												
WIRE TO WIRE	WHITE				416 406 386 386 376 366 356 346 336 33 506 496 486 476 466 456 446 436 43	61 9 60 9 59 9 58 9 57 9 56 9 55 9 54 9 53 9 5	Vuolleval lesd le Valencia l'oute de l'oute de l'oute de l'action   81 G   80 G   79 G   78 G   74 G   75 G   74 G   73 G   74	95G 94G 93G 92G 91G 100G 99G 98G 97G 96G	E32	ECM (WITH VQ35DE) BLACK		121125 129 133 137 141 145 149   122128 130 134 138 142 146 150	124128132136140144148152		Color of Signal Name Wire	P CAN-L	L CAN-H		
Connector Name	Connector Color			οį	416	616	810		Connector No.	Connector Name Connector Color		H.S.	###JJ		Terminal No. Col	123	124		

Revision: May 2014 STC-17 2015 Altima Sedan





Signal Name	SUB ECU	
Color of Wire	BR	
Terminal No.	19	

Connector No.	E60
Connector Name	Connector Name POWER STEERING CONTROL MODULE
Connector Color BLACK	BLACK





ABGIA0100GB

#### DIAGNOSIS AND REPAIR WORK FLOW

#### < BASIC INSPECTION >

# **BASIC INSPECTION**

#### DIAGNOSIS AND REPAIR WORK FLOW

Work Flow

#### **DETAILED FLOW**

# 1.INTERVIEW FROM THE CUSTOMER

Clarify customer complaints before inspection. First of all, perform an interview utilizing <u>STC-20</u>, "<u>Diagnostic Work Sheet</u>" and reproduce symptoms to understand them fully. Ask customer about his/her complaints carefully. Check symptoms by driving vehicle with customer, if necessary.

#### **CAUTION:**

Customers are not professional. Never make assumptions like "maybe the customer means that...," or "maybe the customer mentioned this symptom".

>> GO TO 2.

#### 2.CHECK SYMPTOM

Reproduce the symptom that is indicated by the customer, based on the information from the customer obtained by interview. Also check that the symptom is not caused by protection function. Refer to <a href="STC-12">STC-12</a>. <a href="Protection Function"</a>.

#### **CAUTION:**

When the symptom is caused by normal operation, fully inspect each portion and obtain the understanding of customer that the symptom is not caused by a malfunction.

>> GO TO 3.

# 3.check vehicle condition

#### **With CONSULT**

- Turn ignition switch ON.
- 2. Check "C/U TEMP" and "C/U TEMP A" in "Data Monitor" of "EPS".

Monitor item	Values
C/U TEMP	90°C (194°F) or less
C/U TEMP A	90°C (194°F) or less

#### Is the inspection result normal?

YES >> GO TO 4.

NO >> Wait with the ignition switch OFF until the "Data Monitor" indication becomes 90 °C (194 °F) or less. Go to 4 after the temperature drops to 90 °C (194 °F) or less.

#### 4.PERFORM SELF-DIAGNOSIS

#### (P)With CONSULT

Perform "Self Diagnostic Result" of "EPS".

#### Is any DTC detected?

YES >> Record or print DTC and freeze frame data (FFD). GO TO 5.

NO >> GO TO 7.

#### 5. RECHECK SYMPTOM

#### (P)With CONSULT

- Erase "Self Diagnostic Result" of "EPS".
- 2. Perform DTC confirmation procedures for the malfunctioning system.

#### NOTE

If some DTCs are detected at the same time, determine the order for performing the diagnosis based on <u>STC-13</u>, "<u>DTC Inspection Priority Chart"</u>.

#### Is any DTC detected?

STC

Α

D

Е

F

Н

J

1 \

M

N

0

#### DIAGNOSIS AND REPAIR WORK FLOW

#### < BASIC INSPECTION >

YES >> GO TO 6.

NO >> Check harness and connectors based on the information obtained by interview.

# 6.REPAIR OR REPLACE THE MALFUNCTIONING COMPONENTS.

- Repair or replace the malfunctioning components.
- · Reconnect part or connector after repairing or replacing.
- When DTC is detected, erase "Self Diagnostic Result" of "EPS".

#### >> GO TO 8.

# 7. IDENTIFY THE MALFUNCTIONING SYSTEM BY SYMPTOM DIAGNOSIS

Estimate the malfunctioning system based on symptom diagnosis and perform inspection.

#### Can the malfunctioning system be identified?

YES >> GO TO 8.

NO >> Check harness and connectors based on the information obtained by interview.

# 8. FINAL CHECK

#### (P)With CONSULT

- 1. Check the reference value for power steering control module.
- 2. Recheck the symptom and check that symptom is not reproduced on the same conditions.

#### Is the symptom reproduced?

YES >> GO TO 3.

NO >> Inspection End.

# Diagnostic Work Sheet

INFOID:0000000010482281

#### Description

- In general, customers have their own criteria for a problem. Therefore, it is important to understand the symptom and status well enough by asking the customer about his/her concerns carefully. To systemize all the information for the diagnosis, prepare the interview sheet referring to the interview points.
- In some cases, multiple conditions that appear simultaneously may cause a DTC to be detected.

#### Interview sheet sample

	Interview sheet					
Customer	MR/MS	Registration Initial year registration				
Hallie		Vehicle type VIN				
Storage date		Engine Mileage	km (Mile)			
		☐The steering wheel position (center) is in the wrong position.				
		□Warning lamp turns on.				
Symptom		□Noise □Vibration				
		□Others (	)			
First occurren	се	□Recently □Others (	)			
Frequency of	occurrence	□Always □Under a certain conditions of □Sometimes (time(s)/day	)			
		□Irrelevant				
Climate con-	Weather	□Fine □Cloud □Rain □Snow □Others (	)			
ditions	Temperature	□Hot □Warm □Cool □Cold □Temperature [Approx.	°C (°F)]			
	Relative humidity	□High □Moderate □Low				
Road conditio	Road conditions  □Urban area □Suburb area □High way □Mountain road (uphill or down hill) □Rough road					

# **DIAGNOSIS AND REPAIR WORK FLOW**

#### < BASIC INSPECTION >

		lr	nterview sheet		
Customer	MR/MS	Registration number		Initial year registration	
name		Vehicle type		VIN	
Storage date		Engine		Mileage	km (Mile)
□ Irrelevant □ When engine starts □ During idling Operation conditions, etc. □ During driving □ During acceleration □ At constant speed driving □ During deceleration □ During cornering (right curve or left curve) □ During steering			•		
Other conditions	3				
Memo					

STC

F

Н

Κ

L

 $\mathbb{N}$ 

Ν

0

#### C1143 STEERING ANGLE SENSOR

#### < DTC/CIRCUIT DIAGNOSIS >

# DTC/CIRCUIT DIAGNOSIS

#### C1143 STEERING ANGLE SENSOR

DTC Logic

#### DTC DETECTION LOGIC

DTC	Display item	Malfunction detected condition	Possible cause
C1143	ST ANG SEN CIRCUIT	When a malfunction is detected in steering angle sensor.	Harness or connector     Steering angle sensor     Power steering control module

#### DTC CONFIRMATION PROCEDURE

# 1.PRECONDITIONING

If DTC CONFIRMATION PROCEDURE has been previously conducted, always turn ignition switch OFF and wait at least 10 seconds before conducting the next test.

>> GO TO 2.

# 2.DTC REPRODUCTION PROCEDURE

#### (P)With CONSULT

- 1. Turn the ignition switch OFF to ON.
- 2. Perform "Self Diagnostic Result" of "EPS".

#### Is DTC C1143 detected?

YES >> Proceed to diagnosis procedure. Refer to <a href="STC-22">STC-22</a>, "Diagnosis Procedure".

NO >> Inspection End.

# Diagnosis Procedure

INFOID:0000000010482283

# 1. CHECK STEERING ANGLE SENSOR CIRCUIT

Check steering angle sensor circuit. Refer to BRC-89, "Diagnosis Procedure".

#### Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair or replace malfunctioning component.

# 2. CHECK TERMINALS AND HARNESS CONNECTORS

Check the power steering control module pin terminals for damage or loose connection with harness connector.

#### Is the inspection result normal?

YES >> Power steering control module is malfunctioning. Replace power steering oil pump assembly. Refer to <u>ST-38</u>, "Removal and Installation".

NO >> Repair or replace malfunctioning component.

#### C1601 BATTERY POWER SUPPLY

#### < DTC/CIRCUIT DIAGNOSIS >

#### C1601 BATTERY POWER SUPPLY

DTC Logic INFOID:0000000010482284

#### DTC DETECTION LOGIC

DTC	Display item	Malfunction detected condition	Possible cause	
C1601	BATTERY VOLT	When a power supply voltage to the power steering control module is maintained at 18.5 V or more or at less than 8.5 V continuously for 0.5 seconds or more.	Harness or connector     Power steering control module     Fuse     Battery power supply circuit     Battery	

#### DTC CONFIRMATION PROCEDURE

#### 1.PRECONDITIONING

If DTC CONFIRMATION PROCEDURE has been previously conducted, always turn ignition switch OFF and wait at least 10 seconds before conducting the next test.

>> GO TO 2.

# 2.DTC REPRODUCTION PROCEDURE

# (P)With CONSULT

Turn the ignition switch OFF to ON.

Perform "Self Diagnostic Result" of "EPS".

#### Is DTC "C1601" detected?

YES >> Proceed to diagnosis procedure. Refer to <a href="STC-23">STC-23</a>, "Diagnosis Procedure".

NO >> Inspection End.

#### Diagnosis Procedure

Regarding Wiring Diagram information, refer to <a href="STC-14">STC-14</a>, "Wiring Diagram".

# 1. CHECK POWER STEERING CONTROL MODULE GROUND CIRCUIT

- Turn ignition switch OFF.
- Disconnect power steering control module harness connector.
- Check continuity between power steering control module harness connector terminal and ground.

Power steering	control module		Continuity
Connector	Terminal	<del>-</del>	Continuity
E60	2	Ground	Yes

#### Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair open circuit or short to ground or short to power in harness or connectors, and repair or replace the malfunctioning component.

# 2.CHECK POWER STEERING CONTROL MODULE POWER SUPPLY CIRCUIT (1)

- Check voltage between power steering control module harness connector terminals and ground.
- Turn ignition switch ON.

#### **CAUTION:**

#### Never start the engine.

Check voltage between power steering control module harness connector terminals and ground.

**STC-23** 

STC

Е

F

Α

INFOID:0000000010482285

K

Ν

Р

2015 Altima Sedan

#### C1601 BATTERY POWER SUPPLY

#### < DTC/CIRCUIT DIAGNOSIS >

Power steering	Power steering control module		Ignition	Voltage
Connector	Terminal	_	igilition	(Approx.)
E60	1	Ground	ON	Battery voltage

#### Is the inspection result normal?

YES >> GO TO 4.

NO >> GO TO 3.

# 3.CHECK POWER STEERING CONTROL MODULE POWER SUPPLY CIRCUIT (2)

- Turn ignition switch OFF.
- 2. Check the 100A fusible link (D).
- 3. Disconnect fusible link box (battery) harness connector.
- 4. Check continuity between power steering control module harness connector terminal and fusible link box (battery) harness connector terminal.

Power steering control module		Fusible link box (battery)		Continuity
Connector	Terminal	Connector Terminal		Continuity
E60	1	E5	3	Yes

5. Check continuity between power steering control module harness connector terminal and ground.

Power steering control module		_	Ignition	Continuity	
Connector	Terminal	_	igilition	Continuity	
E60	1	Ground	ON	No	

#### Is the inspection result normal?

YES >> Perform the trouble diagnosis for battery power supply circuit. Refer to <u>PG-15</u>, "Wiring <u>Diagram — Battery Power Supply —"</u>.

NO >> Repair or replace the malfunctioning component.

# 4.CHECK POWER STEERING CONTROL MODULE POWER SUPPLY CIRCUIT (3)

1. Check voltage between power steering control module harness connector terminals and ground.

Power steering control module		_	Voltage	
Connector Terminal			(Approx.)	
E59	5	Ground	0 V	

Turn ignition switch ON.

#### **CAUTION:**

#### Never start the engine.

Check voltage between power steering control module harness connector terminals and ground.

Power steering control module		_	Voltage	
Connector	Terminal		(Approx.)	
E59	5	Ground	Battery voltage	

#### Is the inspection result normal?

YES >> GO TO 6.

NO >> GO TO 5.

# 5.CHECK POWER STEERING CONTROL MODULE POWER SUPPLY CIRCUIT (4)

- Turn ignition switch OFF.
- 2. Check the 10A fuse No. 49 in the IPDM E/R.
- Disconnect IPDM E/R harness connector E63.
- Check continuity between power steering control module harness connector terminal and IPDM E/R harness connector terminal.

#### **C1601 BATTERY POWER SUPPLY**

#### < DTC/CIRCUIT DIAGNOSIS >

Power steering	Power steering control module		IPDM E/R	
Connector	Terminal	Connector Terminal		Continuity
E59	5	E63	19	Yes

5. Check continuity between power steering control module harness connector terminal and ground.

Power steering control module		_	Continuity
Connector	Terminal	_	Continuity
E59	5	Ground	No

#### Is the inspection result normal?

YES >> Perform the trouble diagnosis for ignition power supply circuit. Refer to <u>PG-26, "Wiring Diagram — Ignition Power Supply —"</u>.

NO >> Repair or replace the malfunctioning component.

#### 6.CHECK TERMINALS AND HARNESS CONNECTORS

Check the power steering control module pin terminals for damage or loose connection with harness connector.

#### Is the inspection result normal?

YES >> Power steering control module is malfunctioning. Replace steering oil pump assembly. Refer to ST-38, "Removal and Installation".

NO >> Repair or replace the malfunctioning component.

STC

Α

В

D

Е

Н

K

L

M

Ν

0

Р

Revision: May 2014 STC-25 2015 Altima Sedan

#### **C1602 NO TUNING SET**

#### < DTC/CIRCUIT DIAGNOSIS >

#### C1602 NO TUNING SET

DTC Logic

#### DTC DETECTION LOGIC

DTC	Display item	Malfunction detected condition	Possible cause
C1602	NO TUNING SET	Configration is not finished.	Harness or connector     Power steering control module

#### DTC CONFIRMATION PROCEDURE

# 1.PRECONDITIONING

If "DTC CONFIRMATION PROCEDURE" has been previously conducted, always turn ignition switch OFF and wait at least 10 seconds before conducting the next test.

>> GO TO 2.

# 2.DTC REPRODUCTION PROCEDURE

#### (P)With CONSULT

- 1. Turn the ignition switch OFF to ON.
- 2. Perform "Self Diagnostic Result" of "EPS".

#### Is DTC "C1602" detected?

YES >> Proceed to diagnosis procedure. Refer to STC-26, "Diagnosis Procedure".

NO >> Inspection End.

# Diagnosis Procedure

INFOID:0000000010482287

# 1.PERFORM SELF-DIAGNOSIS

#### (P)With CONSULT

- Turn the ignition switch OFF to ON.
- 2. Erase "Self Diagnostic Result" of "EPS".
- 3. Turn the ignition switch OFF and wait for at least 10 seconds.
- Perform "Self Diagnostic Result" of "EPS".

#### Is DTC "C1602" detected?

YES >> Power steering motor is malfunctioning. Replace power steering oil pump assembly. Refer to <u>ST-38</u>, "Removal and Installation".

NO >> Check pin terminal and connection of each harness connector for malfunctioning conditions.

#### C1606 EPS MOTOR

#### < DTC/CIRCUIT DIAGNOSIS >

## C1606 EPS MOTOR

**DTC** Logic INFOID:0000000010482288

#### DTC DETECTION LOGIC

DTC	Display item	Malfunction detected condition	Possible cause	
C1606	EPS MOTOR	When the motor driver malfunction of power steering control module or power steering control module motor driver malfunction is detected.	Power steering control motor	С

#### DTC CONFIRMATION PROCEDURE

# 1.PRECONDITIONING

If "DTC CONFIRMATION PROCEDURE" has been previously conducted, always turn ignition switch OFF and wait at least 10 seconds before conducting the next test.

>> GO TO 2.

# 2.DTC REPRODUCTION PROCEDURE

(P)With CONSULT Turn the ignition switch OFF to ON.

Perform "Self Diagnostic Result" of "EPS".

#### Is DTC "C1606" detected?

YES >> Proceed to diagnosis procedure. Refer to STC-27, "Diagnosis Procedure".

>> Inspection End. NO

# Diagnosis Procedure

1.PERFORM SELF-DIAGNOSIS

#### (P)With CONSULT

- Turn the ignition switch OFF to ON.
- Erase "Self Diagnostic" result of "EPS".
- Turn the ignition switch OFF and wait for at least 10 seconds.
- Perform "Self Diagnostic" result of "EPS".

#### Is DTC "C1606" detected?

YES >> Power steering motor is malfunctioning. Replace power steering oil pump assembly. Refer to ST-38, "Removal and Installation".

NO >> Check pin terminal and connection of each harness connector for malfunctioning conditions. STC

Е

F

Α

В

INFOID:0000000010482289

K

M

Ν

#### C1607, C1608 POWER STEERING CONTROL MODULE

#### < DTC/CIRCUIT DIAGNOSIS >

# C1607, C1608 POWER STEERING CONTROL MODULE

DTC Logic

#### DTC DETECTION LOGIC

DTC	Display item	Malfunction detected condition	Possible cause
C1607	EEPROM	When the memory (EEPROM) system malfunction is detected in power steering control module.	Power steering control module
C1608	CONTROL UNIT	When the internal malfunction is detected in power steering control module.	Tower steering control module

#### DTC CONFIRMATION PROCEDURE

# 1.PRECONDITIONING

If "DTC CONFIRMATION PROCEDURE" has been previously conducted, always turn ignition switch OFF and wait at least 10 seconds before conducting the next test.

>> GO TO 2.

# 2.DTC REPRODUCTION PROCEDURE

#### (P)With CONSULT

- 1. Turn the ignition switch OFF to ON.
- 2. Perform "Self Diagnostic Result" of "EPS".

#### Is DTC "C1607" or "C1608" detected?

YES >> Proceed to diagnosis procedure. Refer to STC-28, "Diagnosis Procedure".

NO >> Inspection End.

# Diagnosis Procedure

INFOID:0000000010482291

# 1.PERFORM SELF-DIAGNOSIS

#### (P)With CONSULT

- 1. Turn the ignition switch OFF to ON.
- Erase "Self Diagnostic Result" of "EPS".
- 3. Turn the ignition switch OFF and wait for at least 10 seconds.
- Perform "Self Diagnostic Result" of "EPS".

#### Is DTC "C1607" or "C1608" detected?

YES >> Power steering control module is malfunctioning. Replace power steering oil pump assembly. Refer to <u>ST-38</u>, "Removal and Installation".

NO >> Check pin terminal and connection of each harness connector for malfunctioning conditions.

#### **C160A HEAT PROTECTION**

#### < DTC/CIRCUIT DIAGNOSIS >

# C160A HEAT PROTECTION

DTC Logic

#### DTC DETECTION LOGIC

DTC	Display item	Malfunction detected condition	Possible cause	
C160A	HEAT PROTECTION	When the steering wheel is operated excessively and the interior temperature of the power steering system reaches 118°C (244.4°F) or more. (Protection function)  NOTE:  Although the hydraulic pump electric power steering system warning lamp turns ON, this is not a system malfunction. The state returns to normal after stopping steering operation and waiting until the system interior temperature drops to 90°C (194°F) or less.	The protection of the hydraulic pump electric power steering system.	D E

#### DTC CONFIRMATION PROCEDURE

# 1.PRECONDITIONING

If "DTC CONFIRMATION PROCEDURE" has been previously conducted, always turn ignition switch OFF and wait at least 10 seconds before conducting the next test.

>> GO TO 2.

# 2.DTC REPRODUCTION PROCEDURE

# (E)With CONSULT

- 1. Turn the ignition switch OFF to ON.
- 2. Perform "Self Diagnostic Result" of "EPS".

#### Is DTC "C160A" detected?

YES >> Go to STC-19, "Work Flow".

NO >> Inspection End.

STC

F

Α

В

Н

1 \

IVI

Ν

Р

Revision: May 2014 STC-29 2015 Altima Sedan

#### **U1000 CAN COMM CIRCUIT**

#### < DTC/CIRCUIT DIAGNOSIS >

## U1000 CAN COMM CIRCUIT

Description INFOID:000000010482293

CAN (Controller Area Network) is a serial communication line for real time application. It is an on-vehicle multiplex communication line with high data communication speed and excellent error detection ability. Many electronic control units are equipped onto a vehicle, and each control unit shares information and links with other control units during operation (not independent). In CAN communication, control units are connected with 2 communication lines (CAN-H line, CAN-L line) allowing a high rate of information transmission with less wiring. Each control unit communicate data but selectively reads required data only.

DTC Logic INFOID:000000010482294

#### DTC DETECTION LOGIC

DTC	Display item	Malfunction detected condition	Possible cause
U1000	CAN COMM CIRCUIT	Power steering control module is not transmitting/receiving CAN communication signal for 2 seconds or more.	

#### DTC CONFIRMATION PROCEDURE

## 1.PRECONDITIONING

If "DTC CONFIRMATION PROCEDURE" has been previously conducted, always turn ignition switch OFF and wait at least 10 seconds before conducting the next test.

>> GO TO 2.

# 2.DTC REPRODUCTION PROCEDURE

#### (P)With CONSULT

- 1. Turn the ignition switch OFF to ON.
- Perform "Self Diagnostic Result" of "EPS".

#### Is DTC "U1000" detected?

YES >> Go to STC-30, "Diagnosis Procedure".

NO >> Inspection End.

# Diagnosis Procedure

INFOID:0000000010482295

Proceed to LAN-30, "CAN COMMUNICATION SYSTEM: CAN Communication Signal Chart".

# HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP

#### < DTC/CIRCUIT DIAGNOSIS >

< DTC/CIRCUIT DIAGNOSIS >	
HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP	Α
Component Function Check	7 (
1.CHECK THE ILLUMINATION OF THE HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP	В
Check that the hydraulic pump electric power steering warning lamp turns ON when ignition switch turns ON. Then, hydraulic pump electric power steering warning lamp turns OFF after the engine is started.  Is the inspection result normal?  YES >> Inspection End.	С
NO >> Perform trouble diagnosis. Refer to <u>STC-31, "Diagnosis Procedure"</u> .	D
Diagnosis Procedure	
1.PERFORM SELF-DIAGNOSIS	Е
<ul> <li>With CONSULT</li> <li>1. Turn the ignition switch OFF to ON.</li> <li>2. Perform "Self Diagnostic Result" of "EPS".</li> <li>Is any DTC detected?</li> </ul>	F
	STC
2. CHECK HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP SIGNAL	
<ul> <li>With CONSULT</li> <li>1. Turn the ignition switch ON.</li> <li>2. Select "WARNING LAMP" in "Data Monitor" of "EPS".</li> <li>3. Check that the item in "Data Monitor" is "On".</li> </ul>	H
CAUTION: The engine should not be running for step 3. 4. Start the engine. CAUTION:	J
Never drive the vehicle during the test.  5. Check that the item in "Data Monitor" is "Off".	
Is the inspection result normal?	K
YES >> Perform the trouble diagnosis for combination meter power supply circuit. Refer to <a href="MWI-57">MWI-57</a> , <a "="" href="">"COMBINATION METER: Diagnosis Procedure"</a> .  NO >> GO TO 3.	L
3. CHECK TERMINALS AND HARNESS CONNECTORS	
Check the power steering control module pin terminals for damage or loose connection with harness connector.	M
Is the inspection result normal?	
YES >> Power steering control module is malfunctioning. Replace power steering oil pump assembly.  Refer to <a href="ST-38">ST-38</a> , "Removal and Installation".  NO >> Repair or replace the malfunctioning component.	Ν
110 - F. Repair of replace the manufictioning component.	0
	J

Revision: May 2014 STC-31 2015 Altima Sedan

# HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP DOES NOT TURN ON

< SYMPTOM DIAGNOSIS >

# SYMPTOM DIAGNOSIS

# HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP DOES NOT TURN ON

Description INFOID:000000010482298

The hydraulic pump electric power steering warning lamp does not illuminate when the ignition switch is turned ON (lamp check).

#### Diagnosis Procedure

INFOID:000000010482299

1.check the hydraulic pump electric power steering warning lamp

Perform trouble diagnosis for the hydraulic pump electric power steering warning lamp system. Refer to <u>STC-31</u>, "Diagnosis Procedure".

#### Is the inspection result normal?

YES >> Check that the pin terminals and the connection of each connector are normal.

NO >> Repair or replace the malfunctioning components.

Revision: May 2014 STC-32 2015 Altima Sedan

# HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP DOES NOT TURN OFF

#### < SYMPTOM DIAGNOSIS > HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP Α DOES NOT TURN OFF Description INFOID:0000000010482300 В Hydraulic pump electric power steering warning lamp does not turn OFF several seconds after engine started Diagnosis Procedure 1.PERFORM SELF-DIAGNOSIS (P)With CONSULT D Perform "Self Diagnostic Result" of "EPS". Is any DTC detected? YES >> Check the DTC. Refer to STC-13, "DTC Index". Е NO >> GO TO 2. f 2 .CHECK HYDRAULIC PUMP ELECTRIC POWER STEERING WARNING LAMP Perform the trouble diagnosis of hydraulic pump electric power steering warning lamp. Refer to STC-31. "Diagnosis Procedure". Is the inspection result normal? STC YES >> GO TO 3. NO >> Repair or replace the malfunctioning components. 3.power steering control module power supply and ground circuit Perform the trouble diagnosis of power steering control module power supply and ground. Refer to STC-23, "Diagnosis Procedure". Is the inspection result normal? YES >> Check that the pin terminals and the connection of each connector are normal. NO >> Repair or replace the malfunctioning components.

K

L

M

Ν

O

Р

Revision: May 2014 STC-33 2015 Altima Sedan

#### STEERING WHEEL TURNING FORCE IS HEAVY OR LIGHT

#### < SYMPTOM DIAGNOSIS >

# STEERING WHEEL TURNING FORCE IS HEAVY OR LIGHT

# Diagnosis Procedure

INFOID:0000000010482302

# 1.PERFORM SELF-DIAGNOSIS

#### (A) With CONSULT

Perform "Self Diagnostic Result" of "EPS".

#### Is a malfunctioning system displayed?

YES >> Check malfunctioning system. Refer to STC-13, "DTC Index".

NO >> GO TO 2

2.CHECK THE POWER STEERING CONTROL MODULE SIGNAL (1)

#### (P)With CONSULT

1. Start the engine.

**CAUTION:** 

#### Never drive the vehicle.

- Turn the steering wheel until it stops.
- 3. Select "MTR ASSIST" in "Data Monitor" of "EPS".

#### Is the display value "100%"?

YES >> GO TO 4.

NO >> GO TO 3.

3.CHECK THE POWER STEERING CONTROL MODULE SIGNAL (2)

#### (P)With CONSULT

- 1. Select "C/U TEMP" and "C/U TEMP A" in "Data Monitor" of "EPS".
- 2. Stop the system until the "Data Monitor" display value drops to "90°C (194°F)" or less.
- 3. Check whether symptom continues.

#### Did symptom continue?

YES >> GO TO 4.

NO >> This occurs because the protection function lowers the assist force. It is not a system malfunction. Inspection End.

# 4. CHECK THE POWER STEERING CONTROL MODULE SIGNAL (3)

#### (P)With CONSULT

- Turn the steering wheel to the straight-ahead position. (There is no steering force)
- Select "BATTERY VOLT" in "Data Monitor" of "EPS".

#### Is the display value "10.5 V" or more?

YES >> GO TO 5.

NO >> Check the battery power system. Refer to <a href="STC-23">STC-23</a>, "Diagnosis Procedure".

# ${f 5}.$ CHECK THE POWER STEERING CONTROL MODULE SIGNAL (4)

#### (P)With CONSULT

Select "ESTM VHCL SPD" in "Data Monitor" of "EPS".

Monitor item	Test condition	Display value
	When stopped	0.00 km/h or mph
ESTM VHCL SPD	While driving	Approximately equal to the indication on speedometer* (Inside of ±10%)

<sup>\*:</sup> This may not agree with the speedometer indication immediately after the ignition switch is turned ON. This is not a malfunction.

#### Is the check result normal?

YES >> GO TO 6.

NO >> Check the combination meter, ABS actuator and electric unit (control unit). Refer to <a href="MWI-18">MWI-18</a>, <a href="MCONSULT Function">"CONSULT Function (METER/M&A)"</a> and <a href="BRC-33">BRC-33</a>, <a href="MCONSULT Function">"CONSULT Function (ABS)"</a>.

#### STEERING WHEEL TURNING FORCE IS HEAVY OR LIGHT

#### < SYMPTOM DIAGNOSIS >

# 6.CHECK THE POWER STEERING CONTROL MODULE SIGNAL (5)

#### (P)With CONSULT

Select "STR ANG SPD" in "Data Monitor" of "EPS".

Monitor item	Test condition	Display value
STR ANG SPD	The steering wheel is not steered.	Approx. 0.0 deg/s
STICANG OF D	The steering wheel is steered.	Displays steering angle speed (deg/s)

#### Is the check result normal?

YES >> GO TO 7.

NO >> Check the steering angle sensor. Refer to <a href="STC-22">STC-22</a>, "Diagnosis Procedure".

# 7.CHECK THE POWER STEERING CONTROL MODULE SIGNAL (6)

#### (P)With CONSULT

Select "ENGINE STATUS" in "Data Monitor" of "EPS".

#### Is the display value "RUN"?

YES >> GO TO 8.

NO >> Check the ECM. Refer to EC-78, "CONSULT Function".

# 8. CHECK THE STEERING FORCE

Check the steering force. Refer to STC-36, "Diagnosis Procedure".

#### Is the check result normal?

YES >> Inspection End.

NO >> It is possible that there is a mechanical malfunction. Check the steering system. STC

В

D

Е

F

Н

K

L

Ν

0

# UNBALANCE STEERING WHEEL TURNING FORCE AND RETURN BETWEEN RIGHT AND LEFT

#### < SYMPTOM DIAGNOSIS >

# UNBALANCE STEERING WHEEL TURNING FORCE AND RETURN BETWEEN RIGHT AND LEFT

# Diagnosis Procedure

INFOID:0000000010482303

1.check the illumination of the hydraulic pump electric power steering warning lamp

Check the hydraulic pump electric power steering warning lamp while engine is running.

Does the hydraulic pump electric power steering warning lamp turn OFF?

YES >> GO TO 2.

NO >> Refer to <u>STC-33</u>, "<u>Diagnosis Procedure</u>".

2. CHECK WHEEL ALIGNMENT

Check the wheel alignment. Refer to FSU-25, "Wheel Alignment (Unladen\*1)".

Is the inspection result normal?

YES >> GO TO 3.

NO >> Adjustment of wheel alignment. Refer to FSU-25, "Wheel Alignment (Unladen\*1)".

3.CHECK STEERING WHEEL TURNING FORCE

Check the steering wheel turning force. Refer to STC-37, "Diagnosis Procedure".

Is the inspection result normal?

YES >> Inspection End.

NO >> Check the steering wheel turning force for mechanical malfunction. Refer to <a href="STC-34">STC-34</a>, "Diagnosis Procedure".

Revision: May 2014 STC-36 2015 Altima Sedan

# UNBALANCE STEERING WHEEL TURNING FORCE (TORQUE VARIATION)

< SYMPTOM DIAGNOSIS >

# UNBALANCE STEERING WHEEL TURNING FORCE (TORQUE VARIA-TION)

Diagnosis Procedure

INFOID:0000000010482304

# 1.PERFORM SELF-DIAGNOSIS

#### (P)With CONSULT

Perform "Self Diagnostic Result" of "EPS".

#### Is a malfunctioning system displayed?

YES >> Check malfunctioning system. Refer to <a href="STC-13">STC-13</a>, "DTC Index".

NO >> GO TO 2.

2.CHECK THE POWER STEERING CONTROL MODULE SIGNAL (1)

#### (P)With CONSULT

Start the engine.

#### **CAUTION:**

Never drive the vehicle. F Turn the steering wheel until it stops.

Select "MTR ASSIST" in "Data Monitor" of "EPS".

# Is the display value "100%"?

YES >> GO TO 4.

NO >> GO TO 3.

# 3.CHECK THE POWER STEERING CONTROL MODULE SIGNAL (2)

#### (P)With CONSULT

- 1. Select "C/U TEMP" and "C/U TEMP A" in "Data Monitor" of "EPS".
- Stop the system until the "Data Monitor" display value drops to "90°C (194°F)" or less.
- Check whether symptom continues.

#### Did symptom continue?

YES >> GO TO 4.

NO >> This occurs because the protection function lowers the assist force. It is not a system malfunction. Inspection End.

# f 4.CHECK THE POWER STEERING CONTROL MODULE SIGNAL (3)

#### (P)With CONSULT

- Turn the steering wheel to the straight-ahead position. (There is no steering force.)
- Select "BATTERY VOLT" in "Data Monitor" of "EPS".

#### Is the display value "10.5 V" or more?

YES >> GO TO 5.

NO >> Check the battery power system. Refer to <a href="STC-23">STC-23</a>. "Diagnosis Procedure".

# ${f 5.}$ CHECK THE POWER STEERING CONTROL MODULE SIGNAL (4)

#### (P)With CONSULT

Select in "ESTM VHCL SPD" in "Data Monitor" of "EPS".

Monitor item	Test condition	Display value	(
	When stopped	0.00 km/h or mph	
ESTM VHCL SPD	While driving	Approximately equal to the indication on speedometer* (Inside of ±10%)	F

<sup>\*:</sup> This may not agree with the speedometer indication immediately after the ignition switch is turned ON. This is not a malfunction.

#### Is the check result normal?

YES >> GO TO 6.

**STC-37** 2015 Altima Sedan Revision: May 2014

STC

Α

В

D

Е

K

N

#### **UNBALANCE STEERING WHEEL TURNING FORCE (TORQUE VARIATION)**

#### < SYMPTOM DIAGNOSIS >

NO >> Check the combination meter, ABS actuator and electric unit (control unit). Refer to <a href="MWI-18">MWI-18</a>, <a href="CONSULT Function">"CONSULT Function (METER/M&A)"</a> and <a href="BRC-33">BRC-33</a>, <a href="CONSULT Function">"CONSULT Function (ABS)"</a>.

# 6. CHECK THE POWER STEERING CONTROL MODULE SIGNAL (5)

#### (P)With CONSULT

Select "STR ANG SPD" in "Data Monitor" of "EPS".

Monitor item	Test condition	Display value
STR ANG SPD	The steering wheel is not turning.	Approx. 0.0 deg/s
STRANG OF D	The steering wheel is being turned.	Displays steering angle speed (deg/s)

#### Is the check result normal?

YES >> GO TO 7.

NO >> Check the steering angle sensor. Refer to <a href="STC-22">STC-22</a>, "Diagnosis Procedure".

# 7.CHECK THE POWER STEERING CONTROL MODULE SIGNAL (6)

#### (P)With CONSULT

Select "ENGINE STATUS" in "Data Monitor" of "EPS".

#### Is the display value "RUN"?

YES >> GO TO 8.

NO >> Check the ECM. Refer to EC-78, "CONSULT Function".

# 8. CHECK STEERING COLUMN AND STEERING GEAR

#### Check the steering column assembly and steering gear assembly.

- Steering column assembly. Refer to ST-46, "Steering Column".
- Steering gear assembly. Refer to <u>ST-47, "Power Steering Gear"</u>.

#### Is the inspection result normal?

YES >> GO TO 9.

NO >> Repair or replace malfunctioning component.

#### 9. CHECK STEERING WHEEL TURNING FORCE

Check the steering wheel turning force. Refer to STC-34, "Diagnosis Procedure".

#### Is the inspection result normal?

YES >> Inspection End.

NO >> Check the steering wheel turning force for mechanical malfunction. Refer to <a href="STC-34">STC-34</a>, "Diagnosis Procedure".

Revision: May 2014 STC-38 2015 Altima Sedan

< UNIT REMOVAL AND INSTALLATION >

# UNIT REMOVAL AND INSTALLATION

# POWER STEERING CONTROL MODULE

#### Removal and Installation

#### INFOID:0000000010482305

#### **CAUTION:**

Disconnect battery negative cable before removing the power steering pump assembly.

The power steering control module is an integral part of the power steering pump assembly. If replacement of the power steering control module is necessary, replace the complete power steering pump assembly. Refer to <u>ST-38</u>, "Removal and Installation".

STC

Α

В

D

Е

F

Н

J

K

L

M

Ν

0