SECTION STC STEERING CONTROL SYSTEM

CONTENTS

BASIC INSPECTION3	COMPONENT DIAGNOSIS13
DIAGNOSIS AND REPAIR WORKFLOW 3 Work Flow	C1601 BATTERY POWER SUPPLY13 Description
INSPECTION AND ADJUSTMENT5	DTC Logic13 Diagnosis Procedure13
ADDITIONAL SERVICE WHEN REPLACING CONTROL UNIT	Special Repair Requirement 14 C1604 TORQUE SENSOR 15 Description 15 DTC Logic 15 Diagnosis Procedure 15 Component Inspection 17 Special Repair Requirement 18 C1606 EPS MOTOR 19 Description 19 DTC Logic 19 Diagnosis Procedure 19 Component Inspection (EPS Motor) 22 Component Inspection (EPS Motor Angle Sensor)
EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION5	22 Special Repair Requirement22
EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Description	C1607 EEPROM23Description23DTC Logic23Diagnosis Procedure23Special Repair Requirement23
FUNCTION DIAGNOSIS7	C1608 CONTROL UNIT25 Description
EPS SYSTEM 7 System Diagram .7 System Description .7 Component Parts Location .8 Component Description .9	DTC Logic
DIAGNOSIS SYSTEM (EPS CONTROL UNIT)	DTC Logic27 Diagnosis Procedure27
10 CONSULT-III Function (EPS)10	Special Repair Requirement28

D

Е

F

STC

Н

L

M

Ν

0

C1613 TORQUE SENSOR CALIBRATION	29	EPS CONTROL UNIT	. 43
Description	29	Reference Value	. 43
DTC Logic		Fail Safe	
Diagnosis Procedure		DTC Inspection Priority Chart	
Special Repair Requirement	30	DTC Index	45
C16A0 HV ECU	31	WIRING DIAGRAM	. 47
Description	31		
DTC Logic		ELECTRONICALLY CONTROLLED POWER	
Diagnosis Procedure		STEERING SYSTEM	
Special Repair Requirement	32	Wiring Diagram	. 47
C16A1 EPS DC/DC CONVERTER		SYMPTOM DIAGNOSIS	. 51
Description		EPS SYSTEM SYMPTOMS	E 4
DTC Logic		Symptom Table	
Diagnosis Procedure		Symptom rable	. 51
Component Inspection		NORMAL OPERATING CONDITION	. 53
Special Repair Requirement	36	Description	
C16A2 EPS MOTOR ANGLE SENSOR INI-		PRECAUTION	. 54
TIALIZATION			
Description		PRECAUTIONS	. 54
DTC Logic		Precautions For High-Voltage System	. 54
Diagnosis Procedure		Precautions for Inspecting the Hybrid Control Sys-	
Special Repair Requirement	38	tem	. 54
U0129 BRAKE ECU COMMUNICATION	30	Precaution for Supplemental Restraint System	
Description		(SRS) "AIR BAG" and "SEAT BELT PRE-TEN-	
DTC Logic		SIONER"	
Diagnosis Procedure		Service Notice or Precautions for EPS System	. 55
Special Repair Requirement		PREPARATION	57
HOOSE LIVE FOLL COMMUNICATION			. 01
U0293 HV ECU COMMUNICATION		PREPARATION	. 57
Description		Commercial Service Tools	57
DTC Logic		ON VEHICLE DEDAID	
Diagnosis Procedure		ON-VEHICLE REPAIR	. 58
Special Repair Requirement	40	EPS CONTROL UNIT	58
EPS WARNING LAMP	41	Exploded View	
Description		Removal and Installation	
Diagnosis Procedure			
-		EPS DC/DC CONVERTER	
ECU DIAGNOSIS	43	Exploded View	
		Removal and Installation	. 60

DIAGNOSIS AND REPAIR WORKFLOW

< BASIC INSPECTION >

BASIC INSPECTION

DIAGNOSIS AND REPAIR WORKFLOW

Work Flow INFOID:0000000005440463

DETAILED FLOW

${f 1}$.collect the information from the customer

It is also important to clarify customer complaints before inspection. First of all, reproduce symptoms, and understand them fully. Ask customer about his/her complaints carefully. In some cases, it will be necessary to check symptoms by driving vehicle with customer.

>> GO TO 2.

2.CHECK EPS WARNING LAMP STATUS

Check EPS warning lamp operation. Refer to STC-41, "Description".

Is the operation normal?

YES >> GO TO 3.

NO >> Proceed to STC-41, "Diagnosis Procedure".

3.CHECK DTC WITH EPS CONTROL UNIT

(P) With CONSULT-III

Perform the self-diagnosis.

Is any malfunction detected by self-diagnosis?

YES >> GO TO 4. NO >> GO TO 7.

4. ERASE DTC MEMORY

(P) With CONSULT-III

- Record DTC.
- 2. Erase DTC once.

NOTE:

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 5.

5.PERFORM DTC CONFIRMATION PROCEDURE

(P) With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) with recorded DTC.

If two or more DTCs are detected, refer to STC-45, "DTC Inspection Priority Chart" and determine trouble diagnosis order.

Is any malfunction detected by self-diagnosis?

YES >> GO TO 6.

NO >> Check Intermittent Incident. Refer to GI-42, "Intermittent Incident".

6.DETECT MALFUNCTIONING PART BY DIAGNOSIS PROCEDURE

Perform the diagnosis applicable to the displayed DTC. Refer to STC-45, "DTC Index".

>> GO TO 9.

/ .PERFORM DIAGNOSIS BY SYMPTOM

Perform the diagnosis or repair applicable to the symptom. Refer to STC-51, "Symptom Table".

>> GO TO 8.

8.CHECK INPUT/OUTPUT SIGNAL

STC-3 Revision: September 2009 2010 Altima HEV STC

Α

D

Е

F

L

M

Ν

 \mathbf{C}

DIAGNOSIS AND REPAIR WORKFLOW

< BASIC INSPECTION >

Check input/output signal standard of EPS control unit. Refer to <u>STC-43</u>, "Reference Value".

Is the inspection result normal?

YES >> GO TO 10. NO >> GO TO 2.

9. FINAL CHECK (WHEN DTC WAS DETECTED)

(P) With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) with applicable DTC.

Is any malfunction detected by self-diagnosis?

YES >> GO TO 6.

NO >> Inspection End

$10. {\sf FINAL\ CHECK\ (WHEN\ SYMPTOM\ OCCURRED)}$

Make sure that the symptom is not detected.

Does symptom remain?

YES >> GO TO 7.

INSPECTION AND ADJUSTMENT

< BASIC INSPECTION >

INSPECTION AND ADJUSTMENT

ADDITIONAL SERVICE WHEN REPLACING CONTROL UNIT

ADDITIONAL SERVICE WHEN REPLACING CONTROL UNIT: Description

INFOID:0000000005440464

Α

D

When replacing EPS control unit, this procedure must be performed.

ADDITIONAL SERVICE WHEN REPLACING CONTROL UNIT: Special Repair Requirement INFOID:0000000005440465

 ${f 1}$.PERFORM EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION

Perform EPS motor angle sensor initialization and torque sensor calibration. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

>> Inspection End

ADDITIONAL SERVICE WHEN REPLACING STEERING GEAR ASSEMBLY ADDITIONAL SERVICE WHEN REPLACING STEERING GEAR ASSEMBLY: Description INFOID:0000000005440466

When replacing steering gear assembly, this procedure must be performed.

ADDITIONAL SERVICE WHEN REPLACING STEERING GEAR ASSEMBLY : Special Repair Requirement INFOID:0000000005440467

 ${f 1}$.PERFORM EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION

Perform EPS motor angle sensor initialization and torque sensor calibration. Refer to <u>STC-5, "EPS MOTOR</u> ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

>> Inspection End

EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALI-BRATION

EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRA-

TION: Description INFOID:0000000005440468

Perform EPS motor angle sensor initialization and torque sensor calibration when replacing EPS control unit, replacing steering gear assembly and/or unbalanced steering wheel turning force.

- If DTC "C1604 TORQUE SENSOR" is detected, torque sensor calibration cannot be performed.
- If DTC "C1606 EPS MOTOR" is detected, EPS motor angle sensor initialization cannot be performed.

EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRA-

TION: Special Repair Requirement

INFOID:0000000005440469

1. CHECK IGNITION POWER SUPPLY

(P) With CONSULT-III

- 1. Turn the ignition switch ON (READY).
- 2. Select "DATA MONITOR" mode for "EPS".
- Read out the value of "IGN VOLT" and check voltage.

If ignition power supply voltage is 10 V or less, initialization and calibration cannot be performed.

Is the voltage 10 - 14V?

YES >> GO TO 2.

STC-5 Revision: September 2009 2010 Altima HEV STC

F

K

Ν

INSPECTION AND ADJUSTMENT

< BASIC INSPECTION >

NO >> Charge or replace battery.

2. ERASE DTC

(I) With CONSULT-III

- 1. Turn the ignition switch ON (READY).
- 2. Perform the self-diagnosis.

NOTE:

- If DTC "C1604 TORQUE SENSOR" is detected, torque sensor calibration cannot be performed. Erase DTC memory before starting calibration.
- If DTC "C1606 EPS MOTOR" is detected, EPS motor angle sensor initialization cannot be performed. Erase DTC memory before starting initialization.

Is any malfunction detected by self-diagnosis?

YES >> Erase DTC memory or check the malfunctioning system.

NO >> GO TO 3.

3.PERFORM EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION

(P) With CONSULT-III

- 1. Turn the ignition switch ON (READY).
- 2. Return the steering wheel to the straight-ahead position.
- 3. Select "WORK SUPPORT" mode for "EPS".
- 4. Select "SENSOR CALIBLATION".
- 5. Follow the procedures on the CONSULT-III display to clear the EPS motor angle sensor calibration value, initialize the EPS motor angle sensor value, and calibrate the torque sensor.

CAUTION:

- When initializing the EPS motor angle sensor value, observe the following to stabilize sensor voltage:
 - After turning the ignition switch ON or READY mode, wait for at least 2.5 seconds before turning the steering wheel. Do not turn the steering wheel quickly.
- The steering wheel will vibrate during torque sensor calibration. Do not touch the steering wheel while it is vibrating or for 2 seconds after it stops.


FUNCTION DIAGNOSIS

EPS SYSTEM

System Diagram

INFOID:0000000005440470

CONTROL DIAGRAM

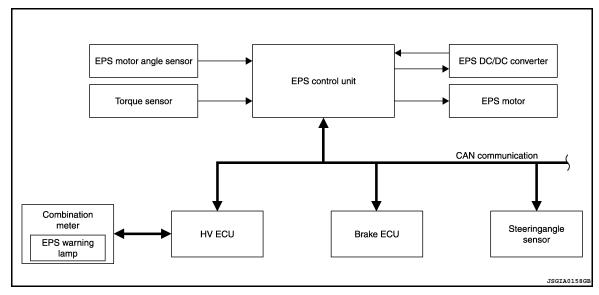

System Description

INFOID:0000000005440471

DESCRIPTION

The EPS system generates assist torque to assist steering effort through the operation of the motor installed on the steering gear assembly.

the direction and amount of power assistance are determined by signals from the torque sensor and controlled in accordance with vehicle speed. As a result, steering effort is controlled to be light during low speed driving and moderately high during high speed driving.

STC

Α

В

D

Е

F

Н

L

J


K

N

0

Component Parts Location

INFOID:0000000005440472

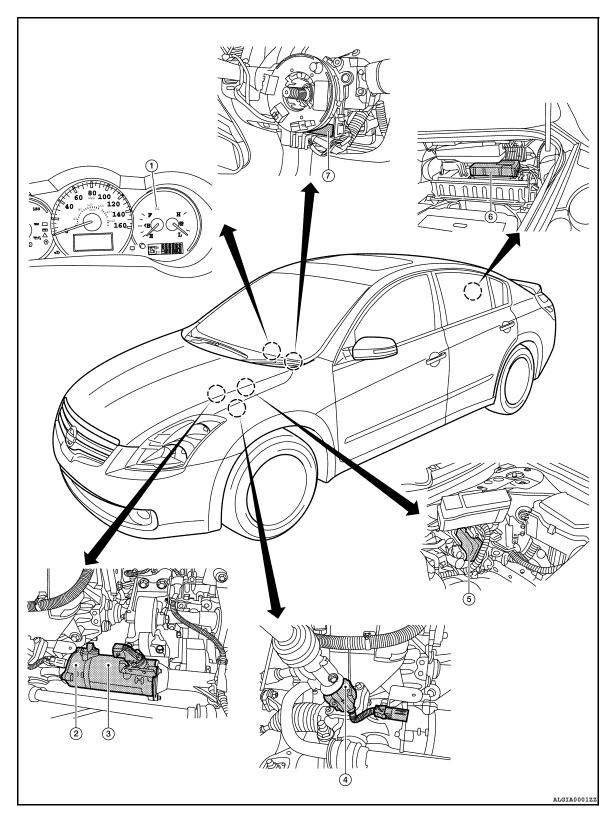

- 1. EPS warning lamp
- 4. Torque sensor (in steering gear as- 5. sembly)
- 7. Steering angle sensor
- EPS motor angle sensor (in steering 3. gear assembly)
 - EPS control unit

- EPS motor (in steering gear assembly)
- 6. EPS DC/DC converter

EPS SYSTEM

< FUNCTION DIAGNOSIS >

Component Description

INFOID:0000000005440473

Α

В

С

D

Е

F

Component parts	Function	
 Outputs optimum assist torque signal to EPS motor. Reduces output signals to EPS motor and protects EPS motor and EPS content when using power steering continuously and excessively. As a fail-safe function, turned off output signal to EPS motor and then enteresteering state, if malfunction is detected in EPS system. 		
EPS motor	Products assist torque by control signal from EPS control unit.	
Torque sensor	Detects steering wheel turning force and outputs sensor signal to EPS control unit.	
EPS motor angle sensor	Detects EPS motor rotation angle and outputs sensor signal to EPS control unit.	
EPS DC/DC converter	converter Is controlled by EPS control unit. Steps down HV battery-supplied voltage to 42V to ply power to EPS motor through motor driving circuit in EPS control unit.	
EPS warning lamp	Illuminates if malfunction is detected in electrical system of EPS system.	
Brake ECU	Transmits the following signals via CAN communication to EPS control unit. • Vehicle speed signal	
Steering angle sensor	Transmits the following signals via CAN communication to EPS control unit. • Steering angle signal	
HV ECU (Hybrid Vehicle Control ECU)	Transmits the following signals via CAN communication to EPS control unit. Power steering assist permission signal Power steering assist stop request signal READY status signal Receives the following signals via CAN communication from EPS control unit Power steering assist signal	

STC

Н

Κ

L

M

Ν

0

DIAGNOSIS SYSTEM (EPS CONTROL UNIT)

< FUNCTION DIAGNOSIS >

DIAGNOSIS SYSTEM (EPS CONTROL UNIT)

CONSULT-III Function (EPS)

INFOID:0000000005440474

FUNCTION

CONSULT-III can display each diagnostic item using the diagnostic test modes shown following.

Diagnostic test mode	Function	
Work support	This mode enables a technician to adjust some devices faster and more accurately by following the indications on CONSULT-III.	
Self-diagnostic result	Self-diagnostic results can be read and erased quickly.	
Data monitor	Input/Output data in the EPS control unit can be read.	
ECU Identification	EPS control unit part number can be read.	

WORK SUPPORT MODE

Work Item

Work item	Condition	Usage
SENSOR CALIBRATION	 Ignition voltage is more than 10 V The steering wheel to the straight-ahead position No DTC detected 	Use to EPS motor angle sensor initialization and torque sensor calibration when replacing EPS control unit, replacing steering gear assembly and/or unbalanced steering wheel turning force.

SELF-DIAG RESULT MODE

Display Item List

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause
C1601	BATTERY VOLT	When the power supply malfunction supplied to EPS control unit is detected.	Power supplyHarness or connectorEPS control unit
C1604	TORQUE SENSOR	When the torque sensor malfunction built in steering gear assembly is detected.	 Torque sensor calibration incomplete Harness or connector Torque sensor EPS control unit
C1606	EPS MOTOR	When the motor driver malfunction in EPS control unit or EPS motor malfunction is detected.	 EPS motor angle sensor initialization incomplete EPS motor angle sensor Harness or connector EPS motor EPS control unit
C1607	EEPROM	When the memory (EEPROM) system malfunction is detected in EPS control unit.	EPS control unit
C1608	CONTROL UNIT	When the internal malfunction is detected in EPS control unit.	EPS control unit
C1609	VHCL SPEED SIGNAL	Malfunction is detected in vehicle speed signal that is output from brake ECU through CAN communication. (Improper signal inputs while driving.)	 Wheel sensor Brake ECU Harness or connector (CAN communication line) EPS control unit
C1613	TQ SE CLB NOT PFRM	Torque sensor calibration is not performed.	Torque sensor calibration not performed
C16A0	HV ECU	Malfunction has been detected from HV ECU.	HV ECU

DIAGNOSIS SYSTEM (EPS CONTROL UNIT)

< FUNCTION DIAGNOSIS >

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause
C16A1	EPS DCDC CONVERTER	Malfunction has been detected from EPS DC/DC converter.	EPS DC/DC converter HV ECU Harness or connector EPS control unit
C16A2	ANG SE INT NOT PFM	EPS motor angle sensor initialization is not performed.	EPS motor angle sensor initialization not performed
U0129	LOST COMM (BRAKE)	CAN communication line* data communication error is detected. (An error signal is detected from brake ECU.)	Harness or connector (CAN communication line) Brake ECU (When U0129 only is output)
U0293	LOST COMM (HV ECU)	CAN communication line* data communication error is detected. (An error signal is detected from HV ECU.)	 Harness or connector (CAN communication line) HV ECU (When U0293 only is output)

CAUTION:

If "LOST COMM (BRAKE) [U0129]" or "LOST COMM (HV ECU) [U0293]" is displayed with other DTCs, first perform the trouble diagnosis for CAN communication line.

NOTE

"TORQUE SENSOR [C1604]", "EPS MOTOR [C1606]", "EEPROM [C1607]" and "CONTROL UNIT [C1608]" may be detected also for malfunctions other than EPS system components.

DATA MONITOR MODE

Display Item List

Monitor item (Unit)	Remarks
VEHICLE SPEED [km/h]	Vehicle speed is displayed.
MTR Q CRNT [A]	Current value consumed by EPS motor (Q shaft) is displayed.
MTR CRNT CMND [A]	Current commanded value to EPS motor is displayed.
STR ANGL SPD [deg/s]	Steering angle speed is displayed.
THERM TEMP [degC]	EPS control unit internal temperature is displayed.
IGN VOLT [V]	EPS control unit ignition power supply voltage is displayed.
STR ANGL SIG [0/1/2/3]	Steering angle sensor signal is displayed.
TRQ SEN1 ANG [deg]	Torque sensor 1 rotation angle is displayed.
TRQ SEN2 ANG [deg]	Torque sensor 2 rotation angle is displayed.
TRQ1 ZERO VAL [deg]	Torque sensor 1 rotation angle at zero point is displayed.
TRQ2 ZERO VAL [deg]	Torque sensor 2 rotation angle at zero point is displayed.
STR TORQUE [Nm]	Steering wheel turning force detected by torque sensor is displayed.
MTR ROTA ANG [deg]	EPS motor rotation angle is displayed.
MTR D CRNT [A]	Current value consumed by EPS motor (D shaft) is displayed.
MOTOR VOLT [V]	Power supply voltage for EPS motor is displayed
MTR U VOLT [V]	EPS motor U terminal output voltage is displayed.
MTR V VOLT [V]	EPS motor V terminal output voltage is displayed.
MTR W VOLT [V]	EPS motor W terminal output voltage is displayed.
IG ON/OFF FRQ	Ignition OFF frequency after system malfunction is displayed.
PRTCT OVRLD	Protect overload status is displayed.
MTR PWR LOW	Memory of decrease of power supply voltage of EPS motor is displayed.
ST ANG SIG IN	Steering angle sensor signal interruption is displayed.
VHCL SPD INTR	Vehicle speed signal interruption is displayed.
BATTERY VOLT [V]	EPS control unit battery power supply voltage is displayed.

STC

Α

В

D

Е

Н

K

Ν

Р

Revision: September 2009 STC-11 2010 Altima HEV

DIAGNOSIS SYSTEM (EPS CONTROL UNIT)

< FUNCTION DIAGNOSIS >

Monitor item (Unit)	Remarks
DRDD VOLT [V]	EPS DC/DC converter power supply voltage is displayed.
HV BATT VOLT [V]	HV battery power supply voltage is displayed.
PS ASIST PRMS	Power steering assist permission status is displayed.
PS AST STP RQ	Power steering assist stop request signal is displayed.
EPS CNVRT SIG	EPS DC/DC converter status is displayed.
PS ASSIST SIG	Power steering assist status is displayed.
READY STATE	READY status is displayed.
ANG SEN INITL [ON/OFF]	EPS motor angle sensor initialization status is displayed.
TRQ SEN CLBRT [ON/OFF]	Torque sensor calibration status is displayed.
OFF ELEC ANG1 [deg]	Offset electrical angle 1 (column side) is displayed.
OFF ELEC ANG2 [deg]	Offset electrical angle 2 (pinion side) is displayed.
TRQ PNT AMNT [Nm]	Amount of zero torque point compensation is displayed.
OFF ELEC ANG3 [deg]	Offset electrical angle 3 (motor side) is displayed.
DTC	The number of DTCs currently and previously stored is displayed.

C1601 BATTERY POWER SUPPLY

< COMPONENT DIAGNOSIS >

COMPONENT DIAGNOSIS

C1601 BATTERY POWER SUPPLY

Description INFOID:0000000005440475

EPS control unit receives power from the battery and then provides power to the EPS DC/DC converter and EPS motor control circuit. (Or EPS control unit receives power for EPS DC/DC converter and EPS motor control circuit from the battery.)

DTC Logic INFOID:0000000005440476

DTC DETECTION LOGIC

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause	Е
C1601	BATTERY VOLT	When the power supply malfunction supplied to EPS control unit is detected.	Power supplyHarness or connectorEPS control unit	F

DTC CONFIRMATION PROCEDURE

1. ERASE DTC MEMORY

(P) With CONSULT-III

- Record DTC.
- Erase DTC once.

NOTE:

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 2.

2.PERFORM DTC CONFIRMATION

(P) With CONSULT-III

- 1. Turn the ignition switch ON (READY).
- Steer 360° leftward and rightward slowly.
- Return the steering wheel to the straight-ahead position.
- Perform the self-diagnosis.

Is DTC "C1601" detected?

YES >> Proceed to STC-13, "Diagnosis Procedure".

NO >> Inspection End

Diagnosis Procedure

Regarding Wiring Diagram information, refer to STC-47, "Wiring Diagram".

1. CHECK EPS CONTROL UNIT POWER SUPPLY CIRCUIT

- Turn the ignition switch OFF.
- Disconnect EPS control unit harness connector.

Α

D

STC

K

INFOID:0000000005440477

Р

Ν

 \mathbf{C}

C1601 BATTERY POWER SUPPLY

< COMPONENT DIAGNOSIS >

Check the voltage between EPS control unit harness connector and ground.

EPS control unit		Ground	Voltage (Approx.)
Connector Terminal		Ground	
E302	4	Ground	Battery voltage

Is the inspection result normal?

YES >> GO TO 2.

NO

- >> Check the following. If any items are damaged, repair or replace damaged parts.
 - 10A fuse (#63)
 - Harness for short or open between battery and EPS control unit harness connector

2. CHECK EPS CONTROL UNIT GROUND CIRCUIT

- Turn the ignition switch OFF.
- Disconnect EPS control unit harness connector.
- Check the continuity between EPS control unit harness connector and ground.

EPS control unit		Ground	Continuity
Connector Terminal		Ground	
E302	2	Ground	Existed

Also check harness for short to ground and short to power.

Is the inspection result normal?

YES >> Replace EPS control unit. Refer to STC-58, "Removal and Installation".

NO >> Repair open circuit or short to ground or short to power in harness or connectors.


Special Repair Requirement

INFOID:0000000005440478

${f 1}$.INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

Always perform EPS motor angle sensor initialization and torque sensor calibration after replacing EPS control unit or steering gear assembly. Refer to STC-5. "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

>> Inspection End

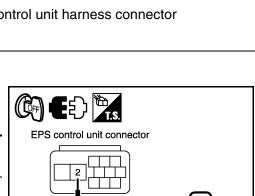

EPS control unit connector

< COMPONENT DIAGNOSIS >

C1604 TORQUE SENSOR

Description INFOID:000000005440479

Torque sensor detects steering wheel turning force and outputs sensor signal to EPS control unit.

DTC Logic INFOID:0000000005440480

DTC DETECTION LOGIC

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause
C1604	TORQUE SENSOR	When the torque sensor malfunction built in steering gear assembly is detected.	Torque sensor calibration incomplete Harness or connector Torque sensor EPS control unit

NOTE:

C1604 may be detected also for malfunctions other than EPS system components.

DTC CONFIRMATION PROCEDURE

1. ERASE DTC MEMORY

(P) With CONSULT-III

- Record DTC.
- Erase DTC once.

NOTE:

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 2.

2.PERFORM DTC CONFIRMATION

(P) With CONSULT-III

- Turn the ignition switch ON (READY).
- Steer 360° leftward and rightward slowly.
- Return the steering wheel to the straight-ahead position.
- Perform the self-diagnosis.

Is DTC "C1604" detected?

YES >> Proceed to STC-15, "Diagnosis Procedure".

>> Inspection End NO

Diagnosis Procedure

Regarding Wiring Diagram information, refer to STC-47, "Wiring Diagram".

1. CHECK TORQUE SENSOR CIRCUIT

- Turn the ignition switch OFF.
- Disconnect EPS control unit harness connector and torque sensor harness connector.

STC

Α

В

D

Е

F

K


INFOID:0000000005440481

Ν

< COMPONENT DIAGNOSIS >

Check the continuity between EPS control unit harness connector and torque sensor harness connector.

EPS control unit		Torque sensor		Continuity
Connector	Terminal	Connector	Terminal	Continuity
	19		1	
	20	E327	2	
	21		3	
E326	22		4	Existed
	23		5	
	24		6	
	25		7	

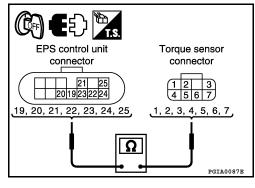

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair or replace the harnesses or connectors.

2. CHECK TORQUE SENSOR

Check the resistance between torque sensor harness connector terminals. Refer to <u>STC-17</u>, "Component Inspection".

Is the inspection result normal?

YES >> GO TO 3.

NO >> Torque sensor is malfunctioning. Replace steering gear assembly. Refer to <u>ST-11, "Removal and Installation".</u>

3. CHECK EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION PER-FORMED

Check if EPS motor angle sensor initialization and torque sensor calibration are performed before the self-diagnosis.

Were the above items performed before the self-diagnosis?

YES >> GO TO 5. NO >> GO TO 4.

4. PERFORM SELF-DIAGNOSIS AGAIN

(P) With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-15, "DTC Logic".

Which DTC is detected?

C1604 >> Replace EPS control unit. Refer to STC-58, "Removal and Installation".

Except C1604>>Check the malfunctioning system.

No DTC>>Inspection End

${f 5.}$ INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

(P) With CONSULT-III

Perform EPS motor angle sensor initialization and torque sensor calibration again. Refer to <u>STC-5. "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement"</u>.

Were they performed correctly?

YES >> GO TO 6.

NO >> Check the malfunctioning cause.

6.PERFORM SELF-DIAGNOSIS AGAIN

(P) With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-15, "DTC Logic".

Is DTC "C1604" detected?

YES >> GO TO 7.

< COMPONENT DIAGNOSIS >

NO >> Inspection End

7.CHECK THE NUMBER OF WORK SUPPORT IMPLEMENTATION

Check the numbers of EPS motor angle sensor initialization and torque sensor calibration.

How many times were they implemented?

Once/twice>>GO TO 5.

More than twice>>Replace EPS control unit, refer to STC-58, "Removal and Installation". Then GO TO 8.

f 8. INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

(P) With CONSULT-III

Perform EPS motor angle sensor initialization and torque sensor calibration again. Refer to <u>STC-5</u>, "<u>EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION</u>: <u>Special Repair Requirement</u>".

Were they performed correctly?

YES >> GO TO 9.

NO >> Check the malfunctioning cause.

9. PERFORM SELF-DIAGNOSIS AGAIN

With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-15, "DTC Logic".

Is DTC "C1604" detected?

YES >> GO TO 10.

NO >> Inspection End

10.check the number of work support implementation

Check the numbers of EPS motor angle sensor initialization and torque sensor calibration after replacement of EPS control unit.

How many times were they implemented?

Once/twice>>GO TO 8.

More than twice>>Torque sensor is malfunctioning. Replace steering gear assembly. Refer to <u>ST-11</u>, <u>"Removal and Installation"</u>.


Component Inspection

Regarding Wiring Diagram information, refer to STC-47, "Wiring Diagram".

1. CHECK TORQUE SENSOR

- 1. Turn the ignition switch OFF.
- 2. Disconnect torque sensor harness connector.
- Check the resistance between torque sensor harness connector terminals.

Torque sensor		Resistance (Approx.)	
Connector	Terminal	riesisiance (Approx.)	
	1 – 6	90 – 170 Ω	
	2 – 6	300 – 430 Ω	
E327	4 – 6	90 – 170 Ω	
	5 – 6	300 – 430 Ω	
	3 – 7	4 – 14 Ω	

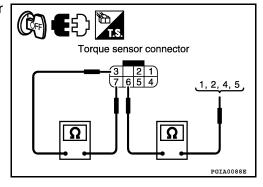

Is the inspection result normal?

YES >> Inspection End

NO >> Torque sensor is malfunctioning. Replace steering gear assembly. Refer to <u>ST-11, "Removal and Installation"</u>.

Revision: September 2009 STC-17 2010 Altima HEV

STC

Α

D

Е

v

INFOID:0000000005440482

Ν

< COMPONENT DIAGNOSIS >

Special Repair Requirement

INFOID:0000000005440483

${f 1}$. INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

Always perform EPS motor angle sensor initialization and torque sensor calibration after replacing EPS control unit or steering gear assembly. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

C1606 EPS MOTOR

< COMPONENT DIAGNOSIS >

C1606 EPS MOTOR

Description INFOID:0000000005440484

EPS motor provides the assist torque by control signal from EPS control unit.

DTC Logic INFOID:0000000005440485

DTC DETECTION LOGIC

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause
C1606	EPS MOTOR	When the motor driver malfunction in EPS control unit or EPS motor malfunction is detected.	EPS motor angle sensor initialization incomplete EPS motor angle sensor Harness or connector EPS motor EPS control unit

NOTE:

C1606 may be detected also for malfunctions other than EPS system components.

DTC CONFIRMATION PROCEDURE

1. ERASE DTC MEMORY

(P) With CONSULT-III

- Record DTC.
- Erase DTC once.

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 2.

2.PERFORM DTC CONFIRMATION

(P) With CONSULT-III

- Turn the ignition switch ON (READY).
- Steer 360° leftward and rightward slowly.
- Return the steering wheel to the straight-ahead position.
- Perform the self-diagnosis.

Is DTC "C1606" detected?

>> Proceed to STC-19, "Diagnosis Procedure". YES

NO >> Inspection End

Diagnosis Procedure

Regarding Wiring Diagram information, refer to STC-47, "Wiring Diagram".

1. CHECK EPS MOTOR GROUND

- Turn the ignition switch OFF.
- Check the installation condition of the EPS motor ground wire connected to the steering gear assembly. **CAUTION:**

EPS motor ground wire is securely installed to the steering gear assembly and body ground.

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair the EPS motor ground wire installation condition.

2.CHECK EPS MOTOR ANGLE SENSOR CIRCUIT

STC

Α

В

D

Е

F

INFOID:0000000005440486

 \mathbf{C}


N

C1606 EPS MOTOR

< COMPONENT DIAGNOSIS >

- 1. Turn the ignition switch OFF.
- Disconnect EPS control unit harness connector and EPS motor angle sensor harness connector.
- 3. Check the continuity between EPS control unit harness connector and EPS motor angle sensor harness connector.

EPS control unit		EPS motor angle sensor		Continuity	
Connector	Terminal	Connector Terminal		- Continuity	
	14	E329	4	Existed	
E326	15		5		
L320	16		6		
	17		7		

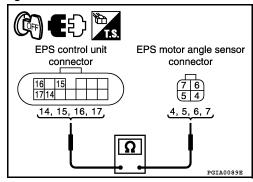

Is the inspection result normal?


YES >> GO TO 3.

NO >> Repair or replace the harnesses or connectors.

3. CHECK EPS MOTOR CIRCUIT

- 1. Turn the ignition switch OFF.
- 2. Disconnect EPS control unit harness connector and EPS motor harness connector.
- 3. Check the continuity between EPS control unit harness connector and EPS motor harness connector.

EPS control unit		EPS motor		Continuity
Connector	Terminal	Connector	Terminal	Continuity
E325	11	E328	1	Existed
	12		3	
	13		2	

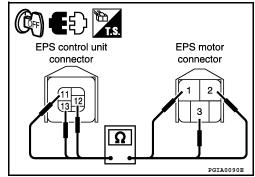

Is the inspection result normal?

YES >> GO TO 4.

NO >> Repair or replace the harnesses or connectors.

4. CHECK EPS MOTOR

Check the resistance between EPS motor harness connector terminals. Refer to <u>STC-22</u>, "Component Inspection (EPS Motor)".

Is the inspection result normal?

YES >> GO TO 5.

NO >> EPS motor is malfunctioning. Replace steering gear assembly. Refer to <u>ST-11, "Removal and Installation".</u>

5. CHECK EPS MOTOR ANGLE SENSOR

Check the resistance between EPS motor angle sensor harness connector terminals. Refer to <u>STC-22, "Component Inspection (EPS Motor Angle Sensor)"</u>.

Is the inspection result normal?

YES >> GO TO 6.

NO >> EPS motor angle sensor is malfunctioning. Replace steering gear assembly. Refer to <u>ST-11.</u> "Removal and Installation".

6.CHECK EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION PERFORMED

Check if EPS motor angle sensor initialization and torque sensor calibration are performed before the self-diagnosis.

Were the above items performed before the self-diagnosis?

YES >> GO TO 8.

NO >> GO TO 7.

C1606 EPS MOTOR

< COMPONENT DIAGNOSIS >

7.PERFORM SELF-DIAGNOSIS AGAIN (A) With CONSULT-III Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-19, "DTC Logic". Which DTC is detected? C1606 >> Replace EPS control unit. Refer to STC-58, "Removal and Installation". Except C1606>>Check the malfunctioning system. No DTC>>Inspection End $oldsymbol{8}.$ INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN (P) With CONSULT-III D Perform EPS motor angle sensor initialization and torque sensor calibration again. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement". Е Were they performed correctly? YES >> GO TO 9. NO >> Check the malfunctioning cause. F $\mathbf{9}$.PERFORM SELF-DIAGNOSIS AGAIN (P) With CONSULT-III Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-19, "DTC Logic". STC Is DTC "C1606" detected? YES >> GO TO 10. NO >> Inspection End 10.CHECK THE NUMBER OF WORK SUPPORT IMPLEMENTATION Check the numbers of EPS motor angle sensor initialization and torque sensor calibration. How many times were they implemented? Once/twice>>GO TO 8. More than twice>>Replace EPS control unit, refer to STC-58, "Removal and Installation". Then GO TO 11. ${f 11}$. INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN (P) With CONSULT-III Perform EPS motor angle sensor initialization and torque sensor calibration again. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement". Were they performed correctly? YFS >> GO TO 12. NO >> Check the malfunctioning cause. 12. PERFORM SELF-DIAGNOSIS AGAIN M (P) With CONSULT-III Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-19, "DTC Logic". N Is DTC "C1606" detected? YES >> GO TO 13. NO >> Inspection End 13.CHECK THE NUMBER OF WORK SUPPORT IMPLEMENTATION Check the numbers of EPS motor angle sensor initialization and torque sensor calibration after replacement of EPS control unit. Р How many times were they implemented? Once/twice>>GO TO 11.

Revision: September 2009 STC-21 2010 Altima HEV

More than twice>>EPS motor or EPS motor angle sensor is malfunctioning. Replace steering gear assembly.

Refer to ST-11, "Removal and Installation".

Component Inspection (EPS Motor)


INFOID:000000000544048

Regarding Wiring Diagram information, refer to STC-47, "Wiring Diagram".

1. CHECK EPS MOTOR

- 1. Turn the ignition switch OFF.
- Disconnect EPS motor harness connector.
- Check the resistance between EPS motor harness connector terminals.

EPS motor		Resistance (Approx.)	
Connector	Terminal	riesisiance (Approx.)	
	1 – 2		
E328	2-3	Less than 10 Ω	
	3 – 1		

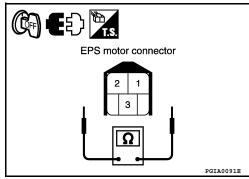

Is the inspection result normal?

YES >> Inspection End

NO >> EPS motor is malfunctioning. Replace steering gear assembly. Refer to <u>ST-11, "Removal and Installation"</u>.

Component Inspection (EPS Motor Angle Sensor)


INFOID:0000000005440488

Regarding Wiring Diagram information, refer to STC-47, "Wiring Diagram".

1. CHECK EPS MOTOR ANGLE SENSOR

- 1. Turn the ignition switch OFF.
- 2. Disconnect EPS motor angle sensor harness connector.
- 3. Check the resistance between EPS motor angle sensor harness connector terminals.

EPS motor angle sensor		Resistance (Approx.)	
Connector	Terminal	hesistance (Approx.)	
	4 – 6	50 – 140 Ω	
E329	7 – 6	30 - 140 22	
	5 – 6	15 – 45 Ω	

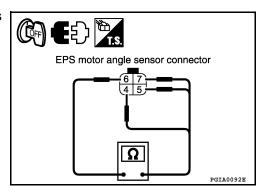

Is the inspection result normal?

YES >> Inspection End

NO >> EPS motor angle sensor is malfunctioning. Replace steering gear assembly. Refer to <u>ST-11</u>, "Removal and Installation".

Special Repair Requirement

INFOID:0000000005440489

$oldsymbol{1}$. INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

Always perform EPS motor angle sensor initialization and torque sensor calibration after replacing EPS control unit or steering gear assembly. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

C1607 EEPROM

< COMPONENT DIAGNOSIS >

C1607 EEPROM

Description INFOID:0000000005440490

EEPROM is a nonvolatile memory that allows electrical writing and erasing of data to be stored. EEPROM is built into the EPS control unit.

Diagnosis information, sensor calibration data, temperature calibration data, etc. are stored in EEPROM.

DTC Logic INFOID:0000000005440491

DTC DETECTION LOGIC

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause
C1607	EEPROM	When the memory (EEPROM) system malfunction is detected in EPS control unit.	EPS control unit

NOTE:

C1607 may be detected also for malfunctions other than EPS system components.

DTC CONFIRMATION PROCEDURE

1. ERASE DTC MEMORY

(P) With CONSULT-III

- Record DTC.
- 2. Erase DTC once.

(P) With CONSULT-III

NOTE:

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 2.

2.perform dtc confirmation

- Turn the ignition switch ON (READY).
- Steer 360° leftward and rightward slowly.
- Return the steering wheel to the straight-ahead position.
- Perform the self-diagnosis.

Is DTC "C1607" detected?

YES >> Proceed to <u>STC-23, "Diagnosis Procedure"</u>.

NO >> Inspection End

Diagnosis Procedure

${f 1}$.PERFORM SELF-DIAGNOSIS AGAIN

(P) With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-23, "DTC Logic".

Which DTC is detected?

C1607 >> Replace EPS control unit. Refer to STC-58, "Removal and Installation".

Except C1607>>Check the malfunctioning system.

No DTC>>Inspection End

Special Repair Requirement

$oldsymbol{1}$.INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

Always perform EPS motor angle sensor initialization and torque sensor calibration after replacing EPS control unit or steering gear assembly. Refer to STC-5. "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

STC

Α

D

Е

F

INFOID:0000000005440492

M

Ν

 \mathbf{C}

INFOID:0000000005440493

C1607 EEPROM

C1608 CONTROL UNIT

Description INFOID:000000005440494

EPS control unit performs an arithmetical operation on data, such as steering wheel turning force (sensor signal) from the torque sensor, vehicle speed signal, etc. then it generates an optimum assist torque to the EPS motor according to the driving condition.

- EPS control unit outputs optimum assist torque signal to EPS motor.
- EPS control unit reduces output signals to EPS motor and protects EPS motor and EPS control unit when using power steering continuously and excessively.
- As a fail-safe function, turned off output signal to EPS motor and then enters a manual steering state, if malfunction is detected in EPS system.

DTC Logic INFOID:0000000005440495

DTC DETECTION LOGIC

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause
C1608	CONTROL UNIT	When the internal malfunction is detected in EPS control unit.	EPS control unit

NOTE:

C1608 may be detected also for malfunctions other than EPS system components.

DTC CONFIRMATION PROCEDURE

ERASE DTC MEMORY

(P) With CONSULT-III

- Record DTC.
- Erase DTC once.

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 2.

2.PERFORM DTC CONFIRMATION

(P) With CONSULT-III

- Turn the ignition switch ON (READY).
- Steer 360° leftward and rightward slowly.
- Return the steering wheel to the straight-ahead position.
- Perform the self-diagnosis.

Is DTC "C1608" detected?

>> Proceed to STC-25, "Diagnosis Procedure".

>> Inspection End NO

Diagnosis Procedure

1.PERFORM SELF-DIAGNOSIS AGAIN

(P) With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-25, "DTC Logic".

Which DTC is detected?

C1608 >> Replace EPS control unit. Refer to STC-58, "Removal and Installation".

Except C1608>>Check the malfunctioning system.

No DTC>>Inspection End

Special Repair Requirement

 $oldsymbol{1}$.INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

Α

D

Е

K

Ν INFOID:0000000005440496

INFOID:0000000005440497

C1608 CONTROL UNIT

< COMPONENT DIAGNOSIS >

Always perform EPS motor angle sensor initialization and torque sensor calibration after replacing EPS control unit or steering gear assembly. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

C1609 VEHICLE SPEED SIGNAL

< COMPONENT DIAGNOSIS >

C1609 VEHICLE SPEED SIGNAL

Description INFOID:000000005440498

The vehicle speed signal is transmitted from brake ECU to EPS control unit via CAN communication.

DTC Logic

DTC DETECTION LOGIC

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause	
C1609	VHCL SPEED SIGNAL	Malfunction is detected in vehicle speed signal that is output from brake ECU through CAN communication. (Improper signal inputs while driving.)	Wheel sensor Brake ECU Harness or connector (CAN communication line) EPS control unit	

DTC CONFIRMATION PROCEDURE

1. ERASE DTC MEMORY

(II) With CONSULT-III

- Record DTC.
- Erase DTC once.

NOTE:

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 2.

2.perform dtc confirmation

(P) With CONSULT-III

- 1. Turn the ignition switch ON (READY).
- 2. Drive at 30 km/h (19 MPH) or more for approx. 1 minute.
- 3. Perform the self-diagnosis.

Is DTC "C1609" detected?

YES >> Proceed to STC-27, "Diagnosis Procedure".

NO >> Inspection End

Diagnosis Procedure

1. PERFORM SELF-DIAGNOSIS AGAIN

(P) With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-27, "DTC Logic".

Is DTC "U0129" detected?

YES >> Proceed to STC-39, "Diagnosis Procedure".

NO >> GO TO 2.

2.CHECK DTC WITH BRAKE ECU

(P)With CONSULT-III

Perform brake ECU self-diagnosis.

Is any error system detected?

YES >> Check the error system.

NO >> Replace EPS control unit. Refer to STC-58, "Removal and Installation".

STC

Α

В

D

Е

F

INFOID:0000000005440500

M

Ν

C1609 VEHICLE SPEED SIGNAL

< COMPONENT DIAGNOSIS >

Special Repair Requirement

INFOID:0000000005440501

${f 1}$. INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

Always perform EPS motor angle sensor initialization and torque sensor calibration after replacing EPS control unit or steering gear assembly. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

C1613 TORQUE SENSOR CALIBRATION

< COMPONENT DIAGNOSIS >

C1613 TORQUE SENSOR CALIBRATION

Description INFOID:000000005440502

This DTC does not indicate a malfunction. The EPS control unit outputs this DTC when it determines that torque sensor calibration has not been performed. When ignition power is low voltage, torque sensor calibration cannot be performed.

DTC Logic INFOID:0000000005440503

DTC DETECTION LOGIC

					D
-	DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause	
_	C1613	TQ SE CLB NOT PFRM	Torque sensor calibration is not performed.	Torque sensor calibra- tion not performed	Е

DTC CONFIRMATION PROCEDURE

ERASE DTC MEMORY

(P) With CONSULT-III

- Record DTC.
- 2. Erase DTC once.

NOTE:

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 2.

2 Perform DTC CONFIRMATION

(P) With CONSULT-III

- Turn the ignition switch ON (READY).
- Steer 360° leftward and rightward slowly.
- Return the steering wheel to the straight-ahead position.
- Perform the self-diagnosis.

Is DTC "C1613" detected?

YES >> Proceed to STC-29, "Diagnosis Procedure".

>> Inspection End NO

Diagnosis Procedure

 ${f 1}$.INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR

(P) With CONSULT-III

Perform EPS motor angle sensor initialization and torque sensor calibration. Refer to <u>STC-5</u>, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement.".

Were they performed correctly?

YES >> GO TO 2.

NO >> Check the malfunctioning cause.

2.PERFORM SELF-DIAGNOSIS AGAIN

(P) With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-29, "DTC Logic".

Is DTC "C1613" detected?

YES >> GO TO 3.

NO >> Inspection End

3.CHECK THE NUMBER OF WORK SUPPORT IMPLEMENTATION

Check the numbers of EPS motor angle sensor initialization and torque sensor calibration.

STC

F

Α

INFOID:0000000005440504

N

C1613 TORQUE SENSOR CALIBRATION

< COMPONENT DIAGNOSIS >

How many times were they implemented?

Once/twice>>GO TO 1.

More than twice>>Replace EPS control unit, refer to STC-58, "Removal and Installation". Then GO TO 4.

f 4.INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

(II) With CONSULT-III

Perform EPS motor angle sensor initialization and torque sensor calibration again. Refer to <u>STC-5. "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement"</u>.

Were they performed correctly?

YES >> GO TO 5.

NO >> Check the malfunctioning cause.

5. PERFORM SELF-DIAGNOSIS AGAIN

(P) With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-29, "DTC Logic".

Is DTC "C1613" detected?

YES >> GO TO 6.

NO >> Inspection End

6.CHECK THE NUMBER OF WORK SUPPORT IMPLEMENTATION

Check the numbers of EPS motor angle sensor initialization and torque sensor calibration after replacement of EPS control unit.

How many times were they implemented?

Once/twice>>GO TO 4.

More than twice>>Torque sensor is malfunctioning. Replace steering gear assembly. Refer to <u>ST-11</u>, <u>"Removal and Installation"</u>.

Special Repair Requirement

INFOID:0000000005440505

${f 1}$. INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

Always perform EPS motor angle sensor initialization and torque sensor calibration after replacing EPS control unit or steering gear assembly. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

C16A0 HV ECU

Description INFOID:0000000005440506

 HV ECU (Hybrid Vehicle Control ECU) transmits the following signals via CAN communication to EPS control unit.

- Power steering assist permission signal
- Power steering assist stop request signal
- READY status signal
- HV ECU (Hybrid Vehicle Control ECU) receives the following signals via CAN communication from EPS control unit
- Power steering assist signal

DTC Logic INFOID:0000000005440507

DTC DETECTION LOGIC

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause
C16A0	HV ECU	Malfunction has been detected from HV ECU.	HV ECU

DTC CONFIRMATION PROCEDURE

1. ERASE DTC MEMORY

(P) With CONSULT-III

- Record DTC.
- 2. Erase DTC once.

NOTE:

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 2.

2.PERFORM DTC CONFIRMATION

(P) With CONSULT-III

- Turn the ignition switch ON (READY).
- Drive at 30 km/h (19 MPH) or more for approx. 1 minute.
- Steer 360° leftward and rightward slowly.
- Return the steering wheel to the straight-ahead position.
- 5. Perform the self-diagnosis.

Is DTC "C16A0" detected?

YES >> Proceed to STC-31, "Diagnosis Procedure".

NO >> Inspection End

Diagnosis Procedure

1.PERFORM SELF-DIAGNOSIS AGAIN

With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-31, "DTC Logic".

Is DTC "U0293" detected?

YES >> Proceed to STC-40, "Diagnosis Procedure".

NO >> GO TO 2.

$\mathbf{2}.$ CHECK WITH HV ECU

(P)With CONSULT-III

Perform HV ECU self-diagnosis.

Is any error system detected?

YES >> Check the error system.

NO >> Replace EPS control unit. Refer to STC-58, "Removal and Installation".

STC-31 Revision: September 2009 2010 Altima HEV STC

Α

В

D

Е

F

INFOID:0000000005440508

Ν

C16A0 HV ECU

< COMPONENT DIAGNOSIS >

Special Repair Requirement

INFOID:0000000005440509

${f 1}$. INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

Always perform EPS motor angle sensor initialization and torque sensor calibration after replacing EPS control unit or steering gear assembly. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

< COMPONENT DIAGNOSIS >

C16A1 EPS DC/DC CONVERTER

Description INFOID:000000005440510

EPS DC/DC converter is controlled by EPS control unit. It steps down HV battery-supplied voltage to 42V to supply power to EPS motor through motor driving circuit in EPS control unit.

DTC Logic

DTC DETECTION LOGIC

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause
C16A1	EPS DCDC CONVERTER	Malfunction has been detected from EPS DC/DC converter.	EPS DC/DC converterHV ECUHarness or connectorEPS control unit

DTC CONFIRMATION PROCEDURE

1. ERASE DTC MEMORY

(II) With CONSULT-III

- Record DTC.
- 2. Erase DTC once.

NOTE:

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 2.

2. PERFORM DTC CONFIRMATION

(P) With CONSULT-III

- 1. Turn the ignition switch ON (READY).
- 2. Steer 360° leftward and rightward slowly.
- 3. Return the steering wheel to the straight-ahead position.
- 4. Perform the self-diagnosis.

Is DTC "C16A1" detected?

YES >> Proceed to <u>STC-33</u>, "<u>Diagnosis Procedure</u>".

NO >> Inspection End

Diagnosis Procedure

Regarding Wiring Diagram information, refer to STC-47, "Wiring Diagram".

1.PRECAUTION

WARNING:

Be sure to refer to GI-24, "Precautions For High-Voltage System" when inspecting high-voltage-related systems.

>> GO TO 2.

2. CHECK WITH HV ECU

(P) With CONSULT-III

Perform HV ECU self-diagnosis.

Is any error system detected?

YES >> Check the error system.

STC

Α

D

Е

F

Н

K

INFOID:0000000005440512

Ν

< COMPONENT DIAGNOSIS >

NO >> GO TO 3.

3. CHECK EPS DC/DC CONVERTER CIRCUIT

- 1. Turn the ignition switch OFF.
- 2. Disconnect EPS control unit harness connector and EPS DC/DC converter harness connectors. **CAUTION:**


Turn the ignition switch OFF before disconnecting or reconnecting any harness connector.

3. Check the continuity between EPS control unit harness connector and EPS DC/DC converter harness connectors.

EPS control unit		EPS DC/DC converter		Continuity
Connector	Connector Terminal		Terminal	Continuity
	1	E303	1	
E302	5	E305	3	Existed
	6		4	LXISIGU
	7		5	

4. Check the continuity between EPS control unit harness connector and ground.

EPS co	ntrol unit	Ground	Continuity
Connector	Connector Terminal		Continuity
E302	1		Not existed
	5	Ground	
	6	Ground	
	7		

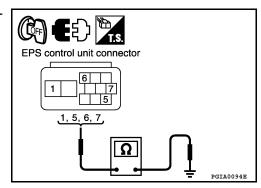


5. Check the continuity between EPS DC/DC converter harness connectors and ground.

EPS DC/D	C converter	Ground	Continuity	
Connector Terminal		Glound	Continuity	
E303	1			
	3	Ground	Not existed	
E305	4	Glound	Not existed	
	5			

- Turn the ignition switch ON.
- 7. Check the voltage between EPS control unit harness connector and ground.

EPS co	ntrol unit	Ground	Voltage (Ap- prox.)
Connector	Terminal	around	
	1		1 V or less
E302	5	Ground	
	6	Ground	
	7		

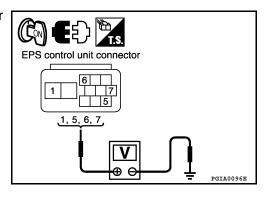

8. Check the voltage between EPS DC/DC converter harness connectors and ground.

< COMPONENT DIAGNOSIS >

EPS DC/D	C converter	Ground	Voltage (Ap-
Connector Terminal		Giodila	prox.)
E303	1		
	3	Ground	1 V or less
E305	4	Glound	1 V 01 1635
	5		

Is the inspection result normal?

YES >> GO TO 4.

NO >> Repair or replace the harnesses or connectors.

4. CHECK EPS DC/DC CONVERTER INSTALLATION CONDITION

- Turn the ignition switch OFF.
- Check the installation condition of the EPS DC/DC converter ground wire connected to the vehicle body. Refer to <u>STC-60</u>, "<u>Exploded View</u>".

CAUTION:

EPS DC/DC converter ground wire is securely installed to the vehicle body.

3. Check the installation condition of the EPS DC/DC converter assembly. Refer to STC-60, "Exploded View".

Is the inspection result normal?

YES >> GO TO 5.

NO >> Repair each installation condition.

5. CHECK EPS DC/DC CONVERTER GROUND

- 1. Turn the ignition switch OFF.
- Disconnect EPS DC/DC converter harness connectors.

CAUTION:

Turn the ignition switch OFF before disconnecting or reconnecting any harness connector.

3. Check the continuity between EPS DC/DC converter harness connectors and ground.

EPS DC/D	C converter	Ground	Continuity
Connector Terminal		Ground	Continuity
E304	E304 2		Existed
E305 6		Ground	

Is the inspection result normal?

YES >> GO TO 6.

NO >> Repair or replace the harnesses or connectors.

6. CHECK HV BATTERY CIRCUIT

- 1. Turn the ignition switch OFF.
- Disconnect EPS DC/DC converter harness connector and HV battery harness connector. CAUTION:

Turn the ignition switch OFF before disconnecting or reconnecting any harness connector.


3. Check the continuity between EPS DC/DC converter harness connector and HV battery harness connector.

EPS DC/DC converter		HV battery		Continuity
Connector	Terminal	Connector Terminal		Outilifully
B500	7	B501	26	Existed
D300	8	D301	29	LAISIEU

Is the inspection result normal?

YES >> GO TO 7.

NO >> Repair or replace the harnesses or connectors.

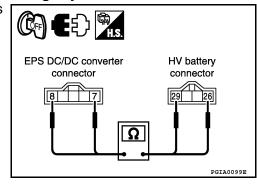

STC

Α

D

Е

Н

ı

J

M

Ν

С

< COMPONENT DIAGNOSIS >

7.CHECK EPS DC/DC CONVERTER

Check the EPS DC/DC converter function. Refer to STC-36, "Component Inspection".

Is the inspection result normal?

YES >> Replace EPS control unit. Refer to <u>STC-58</u>, "Removal and Installation".

NO >> Replace EPS DC/DC converter assembly. Refer to STC-60, "Removal and Installation".

Component Inspection

INFOID:0000000005440513

Regarding Wiring Diagram information, refer to STC-47, "Wiring Diagram".

1. CHECK EPS DC/DC CONVERTER

- 1. Turn the ignition switch OFF.
- 2. Disconnect EPS control unit harness connector E302.

CAUTION:

Turn the ignition switch OFF before disconnecting or reconnecting any harness connector.

3. Apply 12 V to EPS control unit harness connector E302 terminal 5.


CAUTION:

- · Never make the terminals short.
- Connect the 5A fuse between the terminals when applying the voltage.
- Turn the ignition switch ON (READY).
- 5. Check the voltage between EPS control unit harness connector and ground.

CAUTION:

Never make the terminals short.

EPS co	ntrol unit	Ground	Voltage (Ap-	
Connector Terminal		around	prox.)	
E302	1	Ground	42 – 45 V	

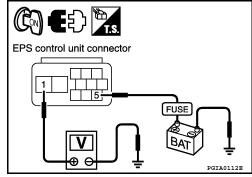

Is the inspection result normal?

YES >> Inspection End

NO >> Replace EPS DC/DC converter assembly. Refer to STC-60, "Removal and Installation".

Special Repair Requirement

INFOID:0000000005440514

${f 1}$. Initialize EPS motor angle sensor and calibrate torque sensor again

Always perform EPS motor angle sensor initialization and torque sensor calibration after replacing EPS control unit or steering gear assembly. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

C16A2 EPS MOTOR ANGLE SENSOR INITIALIZATION

< COMPONENT DIAGNOSIS >

C16A2 EPS MOTOR ANGLE SENSOR INITIALIZATION

Description INFOID:0000000005440515

This DTC does not indicate a malfunction. The EPS control unit outputs this DTC when it determines that EPS motor angle sensor value initialization has not been performed. When ignition power is low voltage, EPS motor angle sensor initialization cannot be performed.

DTC Logic INFOID:0000000005440516

DTC DETECTION LOGIC

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause
C16A2	ANG SE INT NOT PFM	EPS motor angle sensor initialization is not performed.	EPS motor angle sen- sor initialization not performed

DTC CONFIRMATION PROCEDURE

1. ERASE DTC MEMORY

(P) With CONSULT-III

- Record DTC.
- Erase DTC once.

NOTE:

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 2.

2. PERFORM DTC CONFIRMATION

(P) With CONSULT-III

- Turn the ignition switch ON (READY).
- Steer 360° leftward and rightward slowly.
- Return the steering wheel to the straight-ahead position.
- Perform the self-diagnosis.

Is DTC "C16A2" detected?

>> Proceed to STC-37, "Diagnosis Procedure". YES

NO >> Inspection End

Diagnosis Procedure

 $oldsymbol{1}$.INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR

(P) With CONSULT-III

Perform EPS motor angle sensor initialization and torque sensor calibration. Refer to <u>STC-5, "EPS MOTOR</u> ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement.

Were they performed correctly?

YES >> GO TO 2.

NO >> Check the malfunctioning cause.

2.PERFORM SELF-DIAGNOSIS AGAIN

With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-37, "DTC Logic".

Is DTC "C16A2" detected?

YES >> GO TO 3.

NO >> Inspection End

3.CHECK THE NUMBER OF WORK SUPPORT IMPLEMENTATION

Check the numbers of EPS motor angle sensor initialization and torque sensor calibration.

STC

Α

D

INFOID:0000000005440517

M

Ν

C16A2 EPS MOTOR ANGLE SENSOR INITIALIZATION

< COMPONENT DIAGNOSIS >

How many times were they implemented?

Once/twice>>GO TO 1.

More than twice>>Replace EPS control unit, refer to STC-58, "Removal and Installation". Then GO TO 4.

f 4.INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

(II) With CONSULT-III

Perform EPS motor angle sensor initialization and torque sensor calibration again. Refer to <u>STC-5</u>, <u>"EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement"</u>.

Were they performed correctly?

YES >> GO TO 5.

NO >> Check the malfunctioning cause.

PERFORM SELF-DIAGNOSIS AGAIN

(P) With CONSULT-III

Perform "DTC CONFIRMATION PROCEDURE" (self-diagnosis) again. Refer to STC-37, "DTC Logic".

Is DTC "C16A2" detected?

YES >> GO TO 6.

NO >> Inspection End

6.CHECK THE NUMBER OF WORK SUPPORT IMPLEMENTATION

Check the numbers of EPS motor angle sensor initialization and torque sensor calibration after replacement of EPS control unit.

How many times were they implemented?

Once/twice>>GO TO 4.

More than twice>>EPS motor or EPS motor angle sensor is malfunctioning. Replace steering gear assembly. Refer to <u>ST-11</u>, "Removal and Installation".

Special Repair Requirement

INFOID:0000000005440518

1. INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

Always perform EPS motor angle sensor initialization and torque sensor calibration after replacing EPS control unit or steering gear assembly. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

>> Inspection End

U0129 BRAKE ECU COMMUNICATION

< COMPONENT DIAGNOSIS >

U0129 BRAKE ECU COMMUNICATION

Description INFOID:0000000005440519

EPS control unit receive information from brake ECU for optimum control of the EPS system with the CAN communication line between EPS control unit and brake ECU.

DTC Logic INFOID:0000000005440520

DTC DETECTION LOGIC

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause
U0129	LOST COMM (BRAKE)	CAN communication line* data communication error is detected. (An error signal is detected from brake ECU.)	Harness or connector (CAN communication line) Brake ECU (When U0129 only is output)

^{*:} Communication line between EPS control unit and brake ECU.

DTC CONFIRMATION PROCEDURE

1. ERASE DTC MEMORY

(P) With CONSULT-III

- Record DTC.
- Erase DTC once.

NOTE:

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 2.

2 Perform DTC CONFIRMATION

(P) With CONSULT-III

- Turn the ignition switch ON (READY).
- Drive at 30 km/h (19 MPH) or more for approx. 1 minute.
- Perform the self-diagnosis.

Is DTC "U0129" detected?

YES >> Proceed to STC-39, "Diagnosis Procedure".

>> Inspection End NO

Diagnosis Procedure

Proceed to LAN-17, "Trouble Diagnosis Flow Chart".

Special Repair Requirement

$oldsymbol{1}$.INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

Always perform EPS motor angle sensor initialization and torque sensor calibration after replacing EPS control unit or steering gear assembly. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

>> Inspection End

STC

Α

D

Е

INFOID:0000000005440521

INFOID:0000000005440522

Ν

U0293 HV ECU COMMUNICATION

< COMPONENT DIAGNOSIS >

U0293 HV ECU COMMUNICATION

Description INFOID:000000005440523

EPS control unit and HV ECU transmit/receive information to/from each other for optimum control of the EPS system with the CAN communication line between EPS control unit and HV ECU.

DTC Logic

DTC DETECTION LOGIC

DTC	Item (CONSULT-III screen term)	DTC detecting condition	Possible cause
U0293	LOST COMM (HV ECU)	CAN communication line* data communication error is detected. (An error signal is detected from HV ECU.)	Harness or connector (CAN communication line) HV ECU (When U0293 only is output)

^{*:} Communication line between EPS control unit and HV ECU.

DTC CONFIRMATION PROCEDURE

1. ERASE DTC MEMORY

(P) With CONSULT-III

- 1. Record DTC.
- 2. Erase DTC once.

NOTE:

After erasing DTC record, currently occurred DTC can be detected by reading out DTC again.

>> GO TO 2.

2. PERFORM DTC CONFIRMATION

(P) With CONSULT-III

- 1. Turn the ignition switch ON (READY).
- 2. Drive at 30 km/h (19 MPH) or more for approx. 1 minute.
- 3. Steer 360° leftward and rightward slowly.
- 4. Return the steering wheel to the straight-ahead position.
- Perform the self-diagnosis.

Is DTC "U0293" detected?

YES >> Proceed to STC-40, "Diagnosis Procedure".

NO >> Inspection End

Diagnosis Procedure

INFOID:0000000005440525

Proceed to LAN-17, "Trouble Diagnosis Flow Chart".

Special Repair Requirement

INFOID:0000000005440526

${f 1}$. INITIALIZE EPS MOTOR ANGLE SENSOR AND CALIBRATE TORQUE SENSOR AGAIN

Always perform EPS motor angle sensor initialization and torque sensor calibration after replacing EPS control unit or steering gear assembly. Refer to STC-5, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

>> Inspection End

EPS WARNING LAMP

< COMPONENT DIAGNOSIS >

EPS WARNING LAMP

Description INFOID:000000005440527

Turns ON when there is a malfunction in EPS system. It indicates that fail-safe mode is engaged and enters
a manual steering state (Control turning force steering wheel becomes heavy), fixed at a particular point or
decreased simultaneously, to protect the system.

• Also turns ON when ignition switch is turned ON, for purpose of lamp check. Turns OFF within a few seconds after READY mode if the system is in the normal condition.

EPS WARNING LAMP INDICATION

Condition	EPS warning lamp	
Lamp check	Turns ON when ignition switch is turned ON. Turns OFF after READY mode.	
EPS system malfunction	ON	
Other than above (system normal)	OFF	

Diagnosis Procedure

INFOID:0000000005440528

Regarding Wiring Diagram information, refer to STC-47, "Wiring Diagram".

1. CHECK TERMINALS AND HARNESS CONNECTORS

Check EPS control unit pin terminals for damage or loose connection with harness connector.

Is the inspection result normal?

YES >> GO TO 2.

NO >> Repair or replace the harnesses or connectors.

2. CHECK DTC WITH EPS CONTROL UNIT

(II) With CONSULT-III

Perform EPS control unit self-diagnosis.

Is DTC "U0129" or "U0293" detected?

YES >> Proceed to LAN-17, "Trouble Diagnosis Flow Chart".


NO >> GO TO 3.

${f 3.}$ CHECK EPS CONTROL UNIT IGNITION POWER SUPPLY CIRCUIT

- 1. Turn the ignition switch OFF.
- 2. Disconnect EPS control unit harness connector.
- Check the voltage between EPS control unit harness connector and ground.

EPS co	ntrol unit	Ground	Voltage (Approx.)	
Connector Terminal		around	voltage (Approx.)	
E302	3	Ground	0 V	

4. Turn the ignition switch ON.

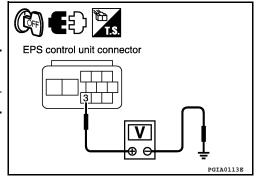

STC

Α

D

,10

L

IVI

Ν

0

EPS WARNING LAMP

< COMPONENT DIAGNOSIS >

Check the voltage between EPS control unit harness connector and ground.

EPS co	ntrol unit	Ground	Voltage (Approx.)	
Connector	Terminal	Ground	voltage (Approx.)	
E302	3	Ground	10 – 14 V	



Is the inspection result normal?

YES >> GO TO 4.

NO

- >> Check the following. If any items are damaged, repair or replace damaged parts.
 - 10A fuse (#34)
 - Harness for short or open between IPDM E/R and EPS control unit harness connector

4. CHECK EPS CONTROL UNIT GROUND CIRCUIT

- Turn the ignition switch OFF.
- 2. Disconnect EPS control unit harness connector.
- Check the continuity between EPS control unit harness connector and ground.

EPS co	ntrol unit	Ground	Continuity	
Connector	Connector Terminal		Continuity	
E302	2	Ground	Existed	

Also check harness for short to ground and short to power.

Is the inspection result normal?

YES >> GO TO 5.

NO

>> Repair open circuit or short to ground or short to power in harness or connectors.

5. CHECK DTC WITH COMBINATION METER

(P)With CONSULT-III

Perform the self-diagnosis of the combination meter.

Is any error system detected?

YFS >> Check the error system.

NO >> GO TO 6.


6.CHECK EPS WARNING LAMP OPERATION


- Turn the ignition switch ON (READY).
- Check EPS warning lamp operation.

Does EPS warning lamp turn OFF after being ON for a few seconds?

>> Inspection End YES

>> Replace EPS control unit. Refer to STC-58, "Removal and Installation". NO

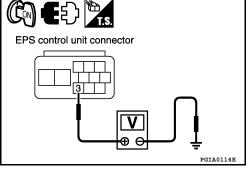

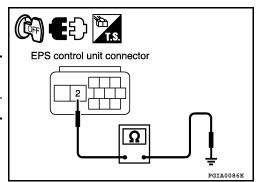

EPS CONTROL UNIT

Α

В

< ECU DIAGNOSIS >

ECU DIAGNOSIS

EPS CONTROL UNIT

Reference Value

VALUES ON THE DIAGNOSIS TOOL

Monitor item	Condition	Value/Status
	Vehicle stopped	0.00 km/h
VEHICLE SPEED	Vehicle running CAUTION: Check air pressure of tire under standard condition.	Approximately equal to the indication on speedometer (Inside of $\pm 10\%$)
MTR Q CRNT	Steering wheel: Steering	The values are changed in proportion by steering wheel turning force
MTR CRNT CMND	Steering wheel: Steering	The values are changed in proportion by steering wheel turning force
STR ANGL SPD	Steering wheel: Steering	The values are changed in proportion by steering speed
THERM TEMP	Ignition switch: ON	-40 - 150 degC
IGN VOLT	Ignition switch: ON	10 – 14 V
STR ANGL SIG	Ignition switch: ON	The details for data of steering angle sensor signal are as follow: 0: OK 1: Steering angle sensor is not learning 2: Steering angle sensor malfunction 3: Communication malfunction
TRQ SEN1 ANG	Steering wheel: Steering	The values are changed in proportion by steering wheel turning force
TRQ SEN2 ANG	Steering wheel: Steering	The values are changed in proportion by steering wheel turning force
TRQ1 ZERO VAL	Steering wheel: Not steering (There is no steering force)	Values differ depending on vehicle
TRQ2 ZERO VAL	Steering wheel: Not steering (There is no steering force)	Values differ depending on vehicle
STR TORQUE	Steering wheel: Steering	The values are changed in proportion by steering wheel turning force
MTR ROTA ANG	Steering wheel: Steering	The values are changed from 0 to 360 deg every 38.2 deg of steering angle
MTR D CRNT	Steering wheel: Steering	The values are changed in proportion by steering wheel turning force
MOTOR VOLT	Steering wheel: Not steering	0 V
WICTOIT VOLT	Steering wheel: Steering	42 – 45 V
MTR U VOLT	Steering wheel: Steering	2 – 45 V
MTR V VOLT	Steering wheel: Steering	2 – 45 V
MTR W VOLT	Steering wheel: Steering	2 – 45 V
IG ON/OFF FRQ	Ignition switch: ON	(MAX. 255)
PRTCT OVRLD	Ignition switch: ON	It displays record of protect overload status 0: Not detected. 1: Detected in the past or current memorized

Monitor item	Condition	Value/Status
MTR PWR LOW	Ignition switch: ON	It displays record of EPS motor power supply low voltage 0: Not detected. 1: Detected in the past or current memorized
ST ANG SIG IN	Ignition switch: ON	It displays record of steering angle sensor signal interruption 0: Not detected. 1: Detected in the past or current memorized
VHCL SPD INTR	Ignition switch: ON	It displays record of vehicle speed signal interruption 0: Not detected. 1: Detected in the past or current memorized
BATTERY VOLT	Ignition switch: ON (READY)	Battery voltage
DRDD VOLT	Ignition switch: ON (READY)	Battery voltage
HV BATT VOLT	Ignition switch: ON (READY)	183.6 – 348.8 V
PS ASIST PRMS	Ignition switch: ON (READY)	The details for data of power steering assist permission signal are as follow: 0: NG (Non-permission) 1: OK (Permission)
PS AST STP RQ	Ignition switch: ON (READY)	The details for data of power steering assist stop request signal are as follow: 0: OK (Non-request) 1: NG (Request)
EPS CNVRT SIG	Ignition switch: ON (READY)	The details for data of EPS DC/DC converter status are as follow: 0, 1 or 2: EPS DC/DC converter has malfunction 3: OK
PS ASSIST SIG	Ignition switch: ON (READY)	The details for power steering assist signal are as follow: 0: NG (Non-assist) 1: OK (Assist)
DEADY OTATE	Vehicle: READY mode	1
READY STATE	Vehicle: Except READY mode	0
ANG SEN INITL	Ignition switch: ON (READY)	OFF
TRQ SEN CLBRT	Ignition switch: ON (READY)	OFF
OFF ELEC ANG1	Ignition switch: ON	Values differ depending on vehicle
OFF ELEC ANG2	Ignition switch: ON	Values differ depending on vehicle
OFF ELEC ANG3	Ignition switch: ON	Values differ depending on vehicle
TRQ PNT AMNT	Ignition switch: ON	Values differ depending on vehicle
DTC	Ignition switch: ON	It displays the number of past and currently detected DTCs

Fail Safe

EPS system

- If any malfunction occurs in EPS system, and control unit detects the malfunction, EPS warning lamp turns ON to indicate system malfunction.
- When EPS warning lamp is ON, vehicle enters a manual steering state (Control turning force steering wheel becomes heavy), fixed at a particular point or decreased simultaneously, to protect the system.

NOTE:

While stopping or driving, EPS control unit decreases the output to EPS motor while extremely using the power steering function (e.g., full steering) for protecting EPS motor and EPS control unit (Protect overload status). While activating protect overload status, the assist torque gradually decreases, and the steering wheel turning force becomes heavy. The normal assist torque reactivates by not steering for approximately 10 minutes in READY mode state.

EPS CONTROL UNIT

< ECU DIAGNOSIS >

Warn- ing lamp	DTC	Malfunction item		Fail-safe
ON	C1601	Battery power su	pply	
ON	C1604	Torque sensor		Power assistance stops
ON	C1606	EPS motor		
ON	C1607	EPS control unit memory (EEPROM) system		EPS motor angle sensor initialization and torque sensor calibration data are set to the default values.
ON	C1608	EPS control unit	When temperature sensor in EPS control unit is open or short	Power assistance continues at certain temperature
			Other than the above	Power assistance stops
ON	C1609	Vehicle speed signal		Amount of power assistance is fixed for a speed of 100 km/h (62 MPH).
ON	C1613	Torque sensor ca	libration not performed	_
ON	C16A0	HV ECU		Daway aggistance stone
ON	C16A1	EPS DC/DC converter		Power assistance stops
ON	C16A2	EPS motor angle sensor initialization not performed		_
ON	U0129	Lost communication with brake ECU		Amount of power assistance is fixed for a speed of 100 km/h (62 MPH).
ON	U0293	Lost communication with HV ECU		Power assistance stops

DTC Inspection Priority Chart

INFOID:0000000005440532

Α

В

D

Е

J

Κ

M

Ν

If some DTCs are displayed at the same time, perform inspections one by one based on the following priority chart.

Priority	Detected items (DTC)	
1	U0129 LOST COMM (BRAKE) U0293 LOST COMM (HV ECU)	
2	C1613 TQ SE CLB NOT PFRM C16A2 ANG SE INT NOT PFM	
3	C1601 BATTERY VOLT C1609 VHCL SPEED SIGNAL C16A0 HV ECU C16A1 EPS DCDC CONVERTER	
4	C1604 TORQUE SENSOR C1606 EPS MOTOR C1607 EEPROM C1608 CONTROL UNIT	

DTC Index

DTC	Items (CONSULT-III screen terms)	Reference
C1601	BATTERY VOLT	STC-13, "Description"
C1604	TORQUE SENSOR	STC-15, "Description"
C1606	EPS MOTOR	STC-19, "Description"
C1607	EEPROM	STC-23, "Description"
C1608	CONTROL UNIT	STC-25, "Description"
C1609	VHCL SPEED SIGNAL	STC-27, "Description"
C1613	TQ SE CLB NOT PFRM	STC-29, "Description"
C16A0	HV ECU	STC-31, "Description"

Revision: September 2009 STC-45 2010 Altima HEV

EPS CONTROL UNIT

< ECU DIAGNOSIS >

DTC	Items (CONSULT-III screen terms)	Reference
C16A1	EPS DCDC CONVERTER	STC-33, "Description"
C16A2	ANG SE INT NOT PFM	STC-37, "Description"
U0129	LOST COMM (BRAKE)	STC-39, "Description"
U0293	LOST COMM (HV ECU)	STC-40, "Description"

WIRING DIAGRAM


ELECTRONICALLY CONTROLLED POWER STEERING SYSTEM

Wiring Diagram

Α

C


D

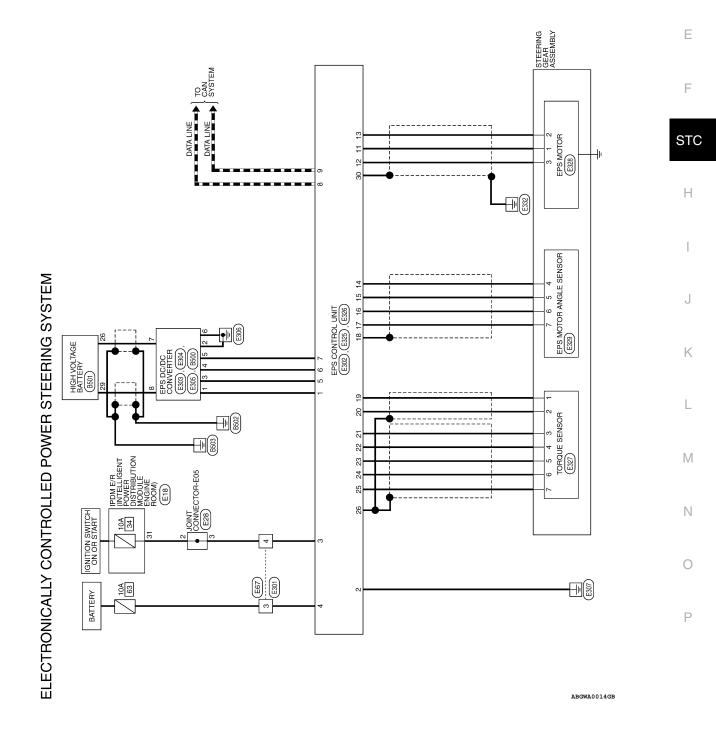

ELECTRONICALLY CONTROLLED POWER STEERING SYSTEM CONNECTORS

E67	Connector Name WIRE TO WIRE Connector Color BLACK	Į.	1 2 3 4	olor of Signal Name	1	- B			
Connector No.	Connector Name Connector Color	Ą	H.S.	Terminal No. Wire	က	4			
Connector No. E28	Connector Name JOINT CONNECTOR-E05 Connector Color WHITE		H.S.	Terminal No. Wire Signal Name	2 B -	3 G/W –			
E18	Connector Name POWER DISTRIBUTION MODULE ENGINE ROOM)	WHITE					-	lor of Signal Name	B IG
Connector No.	Connector Name	Connector Color	E SH		:	9 10 11 12	t l	Terminal No. Wire	31

Signal Name	DRDD	WDD1	WDD2	CAN-H	CAN-L
Color of Wire	В	5	L/R	Υ	BR
Terminal No.	2	9	7	8	6

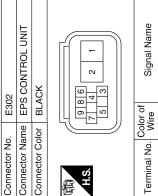

Signal Name	PIG	PGND	IG	+B
Color of Wire	Μ	В	G/W	B/B
Terminal No. Wire	-	2	ဇ	4





E301

Connector No.



Signal Name	I	I	
Color of Wire	B/B	G/W	
Terminal No.	3	4	

ABGIA0037GB

ELECTRONICALLY CONTROLLED POWER STEERING SYSTEM

< WIRING DIAGRAM >

DIA	٩G	iK/	4M >
E305	Connector Name EPS DC/DC CONVERTER	WHITE	
Connector No.	Connector Name	Connector Color WHITE	斯 H.S.
	TER		
E304	Connector Name EPS DC/DC CONVERTER	GRAY	
Connector No. E304	Connector Name	Connector Color GRAY	所.S.

Connector Name | EPS DC/DC CONVERTER

E303

Connector No.

Connector Color WHITE

Signal Name	DRDD	WDD1	WDD2	GND
Color of Wire	æ	5	L/R	В
Terminal No. Wire	8	4	2	9

Signal Name GND

Terminal No. Wire

Signal Name 42_OUT

Color of Wire ≥

Terminal No.

Signal Name	RZCS	RZV	RZG	RZSN	I	INCS	NSNI	TRQV	SONO	NSNO	TRQG2	TRQG1	I
Color of Wire	В	В	В	M	SHIELD	>	Ъ	В	8	В	9	У	SHIELD
Terminal No.	14	15	16	17	18	19	20	21	22	23	24	25	56

	EPS CONTROL UNIT		15 18 16 20 14 17
٥	CON	<u>}</u>	1 6
E320	EPS	GRAY	25 26 21 24 22 23
or No.	or Name	or Color	

EPS GR	25 26 24 22
Connector No. Connector Name Connector Color	崎 H.S.

是 H.S.H

E325	EPS CONTROL UNIT	GRAY	[2] [1] [2] [8]
Connector No.	Connector Name	Connector Color	引 H.S.

30 11	Signal Name	^	n	M	
	Color of Wire	Μ	æ	В	SHIFLD
H.S.	Terminal No.	11	12	13	Oε

ABGIA0038GB

Е

F

Α

В

C

D

STC

Н

J

Κ

L

 \mathbb{N}

Ν

0


Ρ

ELECTRONICALLY CONTROLLED POWER STEERING SYSTEM

< WIRING DIAGRAM >

Connector No.	E329
Connector Name	EPS MOTOR ANGLE SENSOR
Connector Color GRAY	GRAY



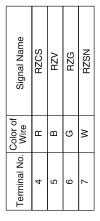



TORQUE SENSOR


Connector Name

E327

Connector No.

Connector Color GRAY




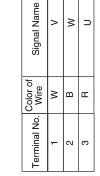





Signal Name	INCS	NSNI	TRQV	SONO	NSNO	TRQG2	TRQG1
Color of Wire	^	Ь	В	8	В	G	\
Ferminal No.	-	2	3	4	2	9	7

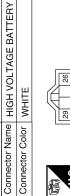


B501


Connector No.

B500

Connector No.



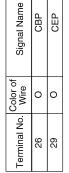

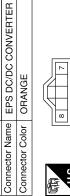



Signal Name	CBP	CEP
Color of Wire	0	0
Terminal No.	7	8

ABGIA0039GB

Α

SYMPTOM DIAGNOSIS

EPS SYSTEM SYMPTOMS

Symptom Table

If EPS warning lamp turns ON, perform self-diagnosis.

Symptom	Condition	Check item	Reference	С
		Front tires (Tire pressure, wear condition)	WT-64, "Tire"	
	 While stopping or driving Steering wheel turn- ing 	Front wheel alignment	FSU-6, "Inspection and Adjustment"	D
		Front suspension (Ball joint)	FSU-10, "Re- moval and Instal- lation"	Е
		Steering gear assembly (Torque sensor, EPS motor, EPS motor angle sensor)	ST-11, "Explod- ed View"	F
Steering wheel turning force is/was		Steering column assembly	ST-8, "Exploded View"	
heavy		Battery and power supply circuit	PG-3, "Work Flow"	ST
		Power supply for EPS control unit	STC-43, "Reference Value"	Н
		Harness and connector (Between EPS control unit and EPS DC/DC converter)	STC-33, "Diag- nosis Procedure"	
		EPS control unit	STC-43, "Reference Value"	
		Vehicle condition (Steering wheel is turned from left to right repeatedly while vehicle stopped or heavy load is continuously applied to the vehicle)	STC-10, "CON- SULT-III Func- tion (EPS)"	J
			STC-5, "EPS MOTOR ANGLE SENSOR INI- TIALIZATION	K
		EPS motor angle sensor initialization and torque sensor calibration	AND TORQUE SENSOR CALI- BRATION: Spe- cial Repair Requirement"	L
Steering wheel turning force is different between right and left, or uneven (torque variation) • While stopping or driving • Steering wheel turning		Front tires (Tire pressure, wear condition)	WT-64, "Tire"	M
	Front wheel alignment	FSU-6, "Inspection and Adjustment"	N	
	Front suspension (Ball joint)	FSU-10, "Re- moval and Instal- lation"	0	
		Steering gear assembly (Torque sensor, EPS motor, EPS motor angle sensor)	ST-11, "Explod- ed View"	
		Steering column assembly	ST-8, "Exploded View"	Р
		EPS control unit	STC-43, "Reference Value"	

EPS SYSTEM SYMPTOMS

< SYMPTOM DIAGNOSIS >

Symptom	Condition	Check item	Reference	
		Front suspension (Ball joint)	FSU-10, "Re- moval and Instal- lation"	
		Wheel sensor	BRC-190, "In- spection"	
Steering wheel turning force does not change according to vehicle	While driving Steering wheel turning	Brake ECU	BRC-5, "Work Flow"	
speed, or steering wheel does not return smoothly		Steering gear assembly (Torque sensor, EPS motor, EPS motor angle sensor)	ST-11, "Exploded View"	
		EPS control unit	STC-43, "Reference Value"	
		CAN communication line	LAN-57, "Trou- ble Diagnosis Flow Chart"	
Scratch sound occur when turning the steering wheel	While driving (Low speed)	Steering gear assembly (EPS motor)	ST-11, "Explod- ed View"	
	Steering wheel turn- ing	Steering column assembly	ST-8, "Exploded View"	
Shrill sound (squeaking) occur when turning the steering wheel	While stopped Steering wheel turning (Slowly)	Steering gear assembly (EPS motor)	ST-11, "Explod- ed View"	
Steering wheel vibrates and noise when turning the steering wheel from left to right	While stopped Steering wheel turning	Steering gear assembly (EPS motor)	ST-11, "Exploded View"	
		Steering column assembly	ST-8, "Exploded View"	
		CAN communication line		
EPS warning lamp does not turn OFF several seconds after READY	READY mode state	Ignition power supply circuit	STC-41, "Diag-	
mode	TILAD I IIIOGE SIGIE	Combination meter	nosis Procedure'	
		EPS control unit		

NORMAL OPERATING CONDITION

< SYMPTOM DIAGNOSIS >

NORMAL OPERATING CONDITION

Description A

PROTECT OVERLOAD STATUS

While stopping or driving, EPS control unit decreases the output to EPS motor while extremely using the
power steering function (e.g., full steering) for protecting EPS motor and EPS control unit (Protect overload
status). While activating protect overload status, the assist torque gradually decreases, and the steering
wheel turning force becomes heavy. The normal assist torque reactivates by not steering for approximately
10 minutes in ignition switch OFF state.

STC

В

D

Е

F

Н

J

K

L

M

Ν

0

INFOID:000000005440536

INFOID:0000000005440537

PRECAUTION


PRECAUTIONS

Precautions For High-Voltage System

Refer to GI-24, "Precautions For High-Voltage System".

Precautions for Inspecting the Hybrid Control System

Before inspecting the high-voltage system or disconnecting the low voltage connector of the inverter with
converter assembly, take safety precautions, such as wearing insulated gloves and removing the service
plug grip to prevent electrical shocks. Make sure to turn the ignition switch OFF before removing the service
plug grip. After removing the service plug grip, put it in your pocket to prevent other technicians from accidentally reconnecting it while you are working on the high-voltage system.

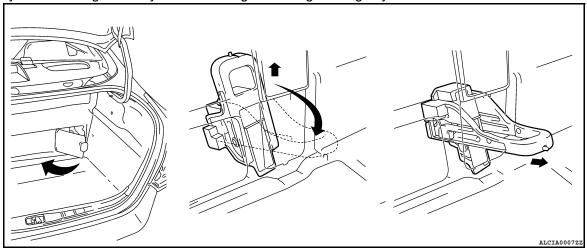

NOTE:

Turning the ignition switch ON (READY) with the service plug grip removed could cause a malfunction. Do not turn the ignition switch ON (READY) unless instructed by the service manual.

 After disconnecting the service plug grip, wait for at least 10 minutes before touching any of the high-voltage connectors or terminals.

NOTE:

Waiting for at least 10 minutes is required to discharge the high-voltage capacitor inside the inverter with converter assembly.

- Turn the ignition switch OFF, wear insulated gloves, and disconnect the negative terminal of the auxiliary battery before touching any of the orange-colored wires of the high-voltage system.
- Turn the ignition switch OFF before performing any resistance checks.
- Turn the ignition switch OFF before disconnecting or reconnecting any connectors.

Precaution for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRE-TENSIONER"

The Supplemental Restraint System such as "AIR BAG" and "SEAT BELT PRE-TENSIONER", used along with a front seat belt, helps to reduce the risk or severity of injury to the driver and front passenger for certain types of collision. This system includes seat belt switch inputs and dual stage front air bag modules. The SRS system uses the seat belt switches to determine the front air bag deployment, and may only deploy one front air bag, depending on the severity of a collision and whether the front occupants are belted or unbelted. Information necessary to service the system safely is included in the SR and SB section of this Service Manual.

WARNING:

- To avoid rendering the SRS inoperative, which could increase the risk of personal injury or death in the event of a collision which would result in air bag inflation, all maintenance must be performed by an authorized NISSAN/INFINITI dealer.
- Improper maintenance, including incorrect removal and installation of the SRS, can lead to personal
 injury caused by unintentional activation of the system. For removal of Spiral Cable and Air Bag
 Module, see the SR section.

PRECAUTIONS

< PRECAUTION >

 Do not use electrical test equipment on any circuit related to the SRS unless instructed to in this Service Manual. SRS wiring harnesses can be identified by yellow and/or orange harnesses or harness connectors.

PRECAUTIONS WHEN USING POWER TOOLS (AIR OR ELECTRIC) AND HAMMERS

WARNING:

- When working near the Airbag Diagnosis Sensor Unit or other Airbag System sensors with the Ignition ON or engine running, DO NOT use air or electric power tools or strike near the sensor(s) with a hammer. Heavy vibration could activate the sensor(s) and deploy the air bag(s), possibly causing serious injury.
- When using air or electric power tools or hammers, always switch the Ignition OFF, disconnect the battery, and wait at least 3 minutes before performing any service.


Service Notice or Precautions for EPS System

INFOID:0000000005440539

CAUTION:


Check the following item when performing the trouble diagnosis.

- Check any possible causes by interviewing the symptom and it's condition from the customer if any malfunction, such as EPS warning lamp is turned ON, occurs.
- Check if air pressure and size of tires are proper, the specified part is used for the steering wheel, and control unit is genuine part.
- Check if the connection of steering column assembly and steering gear assembly is proper (there is not looseness of mounting bolts, damage of rods, boots or sealants, and leakage of grease, etc.).
- Check if the wheel alignment is adjusted properly.
- Check if there is any damage or modification to suspension or body resulting in increased weight or altered ground clearance.
- Check if installation conditions of each link and suspension are proper.
- Check if the 12-volt battery voltage is proper.
- Check connection conditions of each connector are proper.
- Before connecting or disconnecting the EPS control unit harness connector, turn ignition switch "OFF" and disconnect 12-volt battery negative terminal. Because 12-volt battery voltage is applied to EPS control unit even if ignition switch is turned "OFF".

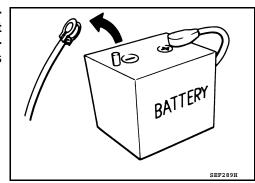

 When connecting or disconnecting pin connectors into or from EPS control unit, take care not to damage pin terminals (bend or break).

When connecting pin connectors, make sure that there are no bends or breaks on EPS control unit pin terminal.

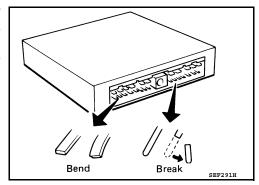

STC

В

D

Е

Н

M

Ν


0

Revision: September 2009 STC-55 2010 Altima HEV

PRECAUTIONS

< PRECAUTION >

- Before replacing EPS control unit, perform EPS control unit input/output signal inspection and make sure whether EPS control unit functions properly or not. Refer to <u>STC-43</u>, "Reference Value".
- If EPS control unit is replaced, always install new one.
- Once EPS control unit is used, it stores vehicle's data, which are non-erasable. Never use EPS control unit of other vehicles.
- Perform EPS motor angle sensor initialization and torque sensor calibration when replacing EPS control unit. Refer to <u>STC-5</u>, "EPS MOTOR ANGLE SENSOR INITIALIZATION AND TORQUE SENSOR CALIBRATION: Special Repair Requirement".

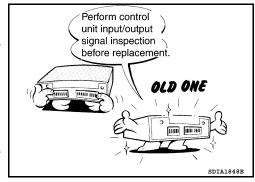

PREPARATION

< PREPARATION >

PREPARATION

PREPARATION

Commercial Service Tools

Tool name (Kent-Moore No.)		Description
Insulation gloves	JMCIA0149ZZ	Guaranteed insulation performance for 1000V/300A

STC

Α

В

С

D

Е

F

INFOID:0000000005803214

Н

J

Κ

L

M


Ν

0

ON-VEHICLE REPAIR

EPS CONTROL UNIT

Exploded View

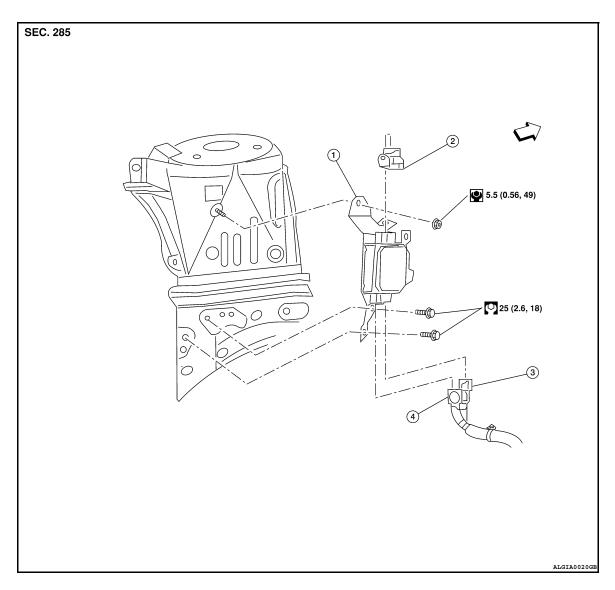

1. EPS control unit

- 2. EPS DC/DC converter connector
- 3. EPS sensor connector

- 4. EPS motor connector
- ←: Front

Removal and Installation

INFOID:0000000005440541

Removal

- Remove the engine cover.
- 2. Remove the front wiper arm cover and wiper arm and blade assembly. Refer to <u>WW-73, "FRONT WIPER DRIVE ASSEMBLY</u>: Removal and Installation"
- 3. Remove the cowl top weatherstrip.
- 4. Remove the cowl top end caps. Refer to EXT-18, "Removal and Installation"
- 5. Remove the cowl top finisher assembly. Refer to EXT-18, "Removal and Installation"
- 6. Disconnect the washer hose.
- 7. Remove the strut brace.

EPS CONTROL UNIT


< ON-VEHICLE REPAIR >

- 9. Disconnect the 12-volt battery negative terminal.
- 10. Remove the left cowl extension.
- 11. Disconnect the MAF sensor connector.
- 12. Remove the air cleaner duct, blow-by hose and air cleaner duct hose. Refer to EM-24, "Removal and Installation".
- 13. Remove the fuse and fusible link box.
- 14. Disconnect the harness clips.
- 15. Disconnect the EPS DC/DC converter connector (2), EPS sensor connector (3), and EPS motor connector (4) from the EPS ECU (1).

NOTE:

For EPS DC/DC converter connector (2) and EPS motor connector (4), perform the following:

- Pull lock plate (5) up until it stops.
- Turn the lock lever (6) until it stops.
- Pull the connector to disconnect it.
- 16. Remove the EPS control unit nut and bolts and EPS control unit.

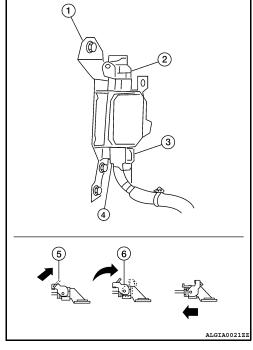

Installation

Installation is in the reverse order of removal.

STC

Α

В

C

D

Е

F

Н


Κ

N

 \cap

EPS DC/DC CONVERTER

Exploded View

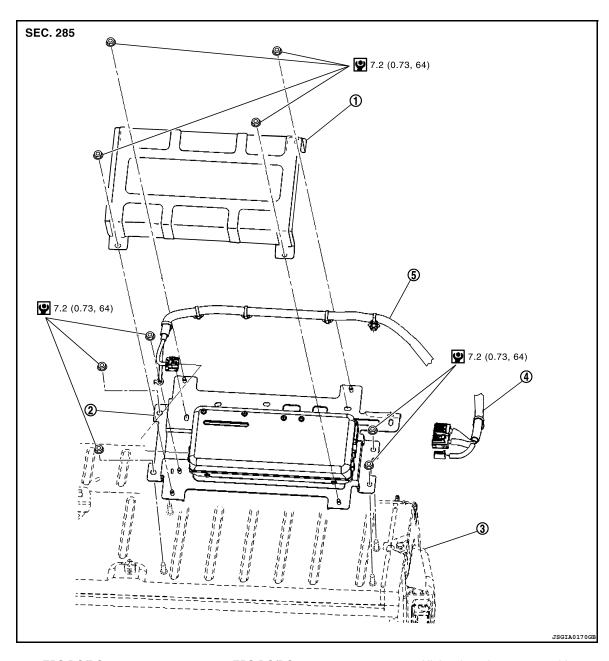

- 1. EPS DC/DC converter cover
- 2. EPS DC/DC converter
- 3. High voltage battery assembly

- 4. EPS motor power line (42 V)
- 5. EPS motor power line (245 V)

Removal and Installation

INFOID:0000000005440543

Removal

- Pull the service plug to disconnect the high voltage battery. Refer to <u>GI-24, "Precautions For High-Voltage System"</u>.
- 2. Remove the rear seat. Refer to <u>SE-24, "Removal and Installation"</u>
- 3. Remove rear body side welt and rear pillar finisher. Refer to INT-19, "Removal and Installation".
- Remove rear parcel shelf finisher and high mount stop lamp, if equipped. Refer to <u>INT-22, "Removal and Installation"</u>.
- 5. Remove trunck room trim. Refer to INT-30, "Removal and Installation".

EPS DC/DC CONVERTER

< ON-VEHICLE REPAIR >

- 6. Remove the EPS DC/DC converter cover nuts and remove the cover.
- 7. Remove the shield earth nut.
- 8. Disconnect the EPS motor power line (245 V) connector and clip.
- 9. Disconnect the EPS motor power line ground.
- 10. Disconnect the EPS motor power line (42 V) connector and clip.
- 11. Remove the EPS DC/DC converter nuts and remove the EPS DC/DC converter.

Installation

Installation is in the reverse order of removal.

CAUTION:

Do not install an EPS DC/DC converter if it has been dropped or shocked, replace with a new one.

STC

Α

В

D

Е

F

Н

J

K

L

M

Ν

 \cap