



Post Office Box 191 Gardena, California 90248 Telephone: (310) 532-3111

TECHNICAL DATABASE INFORMATION

Record ID:	Source Reference l	Number:	Classification:	
FC0007692	STC196		SEPT 92	
Subject:		Entered On:		
ABS LIGHT CODE4		09/18/92		
Model Line:		Model Year:		
PTH 720		91 92 93		

Technical Information Abstract:

INFORMATION: ABS EQUIPPED D21 PICK UPS AND PATHFINDERS WITH REPORTED ABS

WARNING LIGHT ON INTERMITTENTLY OR CONTINUOSLY SHOWING CODE 4.

FIELD FIX: REFER TO SERVICE MANUAL PAGE BR-52 AND CHECK GROUND CONTINUITY AT

ABS ELECTRONIC CONTROL UNIT TERMINAL NUMBER FOUR (4).

IF CONTINUITY EXISTS BETWEEN TERMINAL 4 AND THE BODY GROUND, REPLACE ABS ACTUATOR ASSEMBLY. IF NO CONTINUITY EXISTS BETWEEN TERMINAL 4 OF THE ABS ECU AND BODY GROUND, INSPECT HARNESS AND CONNECTIONS FOR OPEN OR SHORT. REPLACE OR REPAIR AS REQUIRED.

Index : 032045