



JFA T

NISSAN MOTOR CORPORATION IN U.S.A.

Post Office Box 191  
Gardena, California 90248-0191  
Telephone: (310) 532-3111

# SERVICE BULLETIN

Classification: <b>PD92-001</b>	Section: <b>Prop Shaft &amp; Differential</b>	Models: <b>Various</b>
Reference: <b>TECHNICAL BULLETIN NTB92-089</b>	Date: <b>October 13, 1992</b>	

## DRIVE PINION OIL SEAL LEAK

**APPLIED MODELS:** 1992 Pathfinder, Truck, 240SX, and 300ZX

**APPLIED VIN:**

Pathfinder	All	JN8HD17YXNW028505
240SX	Coupe	JN1MS34PXNW108461
240SX	Fastback	JN1MS36PXNW116758
300ZX	2 Seat	JN1RZ24HXNX521921
300ZX	Turbo	JN1CZ24HXNX521002
300ZX	2+2 Seat	JN1RZ26HXNX521956
300ZX	2 Seat	JN1RZ24SXNX060020
300ZX	Turbo	JN1CZ24SXNX060077
300ZX	2+2 Seat	JN1RZ26SXNX060058

RECEIVED  
OCT 13 1992

**APPLIED DATE:**

Pathfinder	March 2, 1992
Truck	April, 1992
240SX	February 11, 1992
300ZX	February 3, 1992

**SERVICE INFORMATION:**

On some 1992 Trucks, Pathfinders, 240SXs and 300ZXs, customers may complain of an oil leak from the drive pinion oil seal area. The condition may be complained of as occurring at both the front and rear differential on the 4wd Truck and 4wd Pathfinder. The source of the leak may be the pinion oil seal itself, which has been countermeasured.

**SERVICE PROCEDURE:**

1. Verify drive pinion oil seal as source of leak.
2. Remove and replace drive pinion oil seal with countermeasure parts listed on page 2.

Index # **030863**

**PARTS INFORMATION:**

Description	New Part #	Former Part #	Differential type	Vehicle application
Oil Seal- Drive Pinion	38189-C7023	38189-C7021	H233	Rear D21/VG30/2WD
	38189-C7011	38189-C7010	C200/H233B	Rear WD21/VG30/2WD and 4WD Rear D21/KA24 and VG30/4WD
	38189-P0116	38189-P0115	H190A	Rear D21/KA24/2WD
	38189-01G16	38189-01G15	R180A	Front D21/KA24/4WD
	38189-21G16	38189-21G15	R200A	Front D21 and WD21/VG30/4WD
	38189-N3111	38189-N3110	R200/C200 w/o ABS	Rear 240SX and 300ZX

**WARRANTY INFORMATION:**

Please reference the "Nissan Warranty Flat Rate Manual", sections "LB-Final Drive (RWD)" and "LD-4WD Front Final Drive" for the appropriate PNC and Op Code combination.