



# TECHNICAL DATABASE INFORMATION

Record ID: <b>FC0009202</b>	Source Reference Number: <b>NMC</b>	Classification: <b>FEB '94</b>
Subject: <b>EXHAUST STUDS</b>	Entered On: <b>02/03/94</b>	
Model Line: <b>NIS</b>	Model Year: <b>ALL</b>	

## Technical Information Abstract:

**SYMPTOMS:** ENGINE EXHIBITS AN EXHAUST NOISE FROM THE EXHAUST MANIFOLD. FOUND ALL VG30E BROKEN MANIFOLD MOUNTING STUDS.  
MODELS

**INFORMATION:** THE EXHAUST MANIFOLD STUD HAS BEEN CHANGED FOR IMPROVED DURABILITY. USE THE FOLLOWING PROCEDURE TO REPAIR VEHICLES WHICH EXHIBIT EXCESSIVE EXHAUST NOISE DUE TO EXHAUST MANIFOLD STUD BREAKAGE.

- 1) REMOVE THE EXHAUST MANIFOLD ON THE SIDE OF THE ENGINE WITH THE BROKEN STUD(S). ===>
- 2) REPLACE ONLY THE BROKEN STUD(S), WITH IMPROVED PART (# 14065-V5003), THESE USUALLY ARE THE FRONT AND/OR REAR STUDS.
- 3) REPLACE THE EXHAUST MANIFOLD WITH A NEW PART.

.....  
Index # **037602**  
.....