Technical Bulletin



*		
SERVICE E	BULLETIN	
Classification:	Reference:	Date:
EL08-033	NTB08-108	December 15, 2008

NISSAN; I-KEY REGISTRATION CAUTION

APPLIED VEHICLES: All Models with Intelligent Key (I-Key)

SERVICE INFORMATION

CAUTION: Before starting **any** I-Key registration procedures:

• #1: The vehicle battery voltage **must be** at and remain above 12.4 volts during the procedure.

THEN

• #2: The transmission selector lever **must be** in the Park position for A/T & CVT vehicles or in the Neutral position for Manual transmission vehicles.

THEN

• #3: "Wiggle" the steering wheel back and forth to make sure the steering lock is not bound-up on the column, and then release the Steering Lock.

THEN

• #4: Proceed with I-Key registration.

If these steps are not followed <u>before</u> I-Key registration is started electronic damage to the Steering Lock may occur.

Electronic damage to the Steering Lock is not covered under warranty if it should occur under these conditions.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.