I BODY

# SECTION IP A INSTRUMENT PANEL C

# CONTENTS

PRECAUTIONS Precautions for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRE-TEN-	. 2
SIONER"	. 2
PREPARATION	. 3
Special Service Tools	. 3
Commercial Service Tools	. 3
SQUEAK AND RATTLE TROUBLE DIAGNOSES	. 4
SQUEAK AND RATTLE TROUBLE DIAGNOSES Work Flow	
	. 4
Work Flow	. 4 . 4
Work Flow CUSTOMER INTERVIEW	. 4 . 4 . 5 . 5

REPAIR THE CAUSE5 CONFIRM THE REPAIR6	F
Generic Squeak and Rattle Troubleshooting	
INSTRUMENT PANEL	
CENTER CONSOLE	G
DOORS	
TRUNK	
SUNROOF/HEADLINER	H
SEATS7	
UNDERHOOD7	
Diagnostic Worksheet8	IP
INSTRUMENT PANEL ASSEMBLY	
Removal and Installation10	
	J

Μ

Κ

D

Ε

# PRECAUTIONS

# PRECAUTIONS

#### PFP:00001

# Precautions for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRE-TENSIONER"

The Supplemental Restraint System such as "AIR BAG" and "SEAT BELT PRE-TENSIONER", used along with a front seat belt, helps to reduce the risk or severity of injury to the driver and front passenger for certain types of collision. Information necessary to service the system safely is included in the SRS and SB section of this Service Manual.

#### WARNING:

- To avoid rendering the SRS inoperative, which could increase the risk of personal injury or death in the event of a collision which would result in air bag inflation, all maintenance must be performed by an authorized NISSAN/INFINITI dealer.
- Improper maintenance, including incorrect removal and installation of the SRS, can lead to personal injury caused by unintentional activation of the system. For removal of Spiral Cable and Air Bag Module, see the SRS section.
- Do not use electrical test equipment on any circuit related to the SRS unless instructed to in this Service Manual. SRS wiring harnesses can be identified by yellow and/or orange harness connectors.

# PREPARATION

# PREPARATION Special Service Tools

PFP:00002

#### EIS00176

А

Μ

The actual shapes of Kent-Moore tools may differ from those of special service tools illustrated here.

Tool number (Kent-Moore No.) Tool name		Description	
 (J-39570) Chassis ear	AAAAA	Locating the noise	
	Ц SBT839		
 (J-43980)		Repairing the cause of noise	
NISSAN Squeak and Rattle kit			
	SBT840		
Commercial Service Too	ls		EI\$00177
Tool name (Kent-Moore No.)		Description	
Engine ear (J-39565)		Locating the noise	
	SIIA0995E		


SIIA0995E

PFP:00003

EIS00178

# SQUEAK AND RATTLE TROUBLE DIAGNOSES

Work Flow

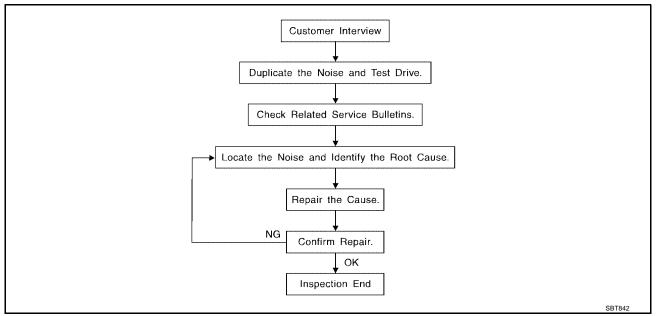

#### **CUSTOMER INTERVIEW**

Interview the customer, if possible, to determine the conditions that exist when the noise occurs. Use the Diagnostic Worksheet during the interview to document the facts and conditions when the noise occurs and any customer's comments; refer to <u>IP-8</u>, "<u>Diagnostic Worksheet</u>". This information is necessary to duplicate the conditions that exist when the noise occurs.

- The customer may not be able to provide a detailed description or the location of the noise. Attempt to obtain all the facts and conditions that exist when the noise occurs (or does not occur).
- If there is more than one noise in the vehicle, be sure to diagnose and repair the noise that the customer is concerned about. This can be accomplished by test driving the vehicle with the customer.
- After identifying the type of noise, isolate the noise in terms of its characteristics. The noise characteristics are provided so the customer, service adviser and technician are all speaking the same language when defining the noise.
- Squeak (Like tennis shoes on a clean floor)
   Squeak characteristics include the light contact/fast movement/brought on by road conditions/hard surfaces = higher pitch noise/softer surfaces = lower pitch noises/edge to surface = chirping
- Creak (Like walking on an old wooden floor)
   Creak characteristics include firm contact/slow movement/twisting with a rotational movement/pitch dependent on materials/often brought on by activity.
- Rattle (Like shaking a baby rattle)
   Rattle characteristics include the fast repeated contact/vibration or similar movement/loose parts/missing clip or fastener/incorrect clearance.
- Knock (Like a knock on a door)
   Knock characteristics include hollow sounding/sometimes repeating/often brought on by driver action.
- Tick (Like a clock second hand)
   Tick characteristics include gentle contacting of light materials/loose components/can be caused by driver action or road conditions.
- Thump (Heavy, muffled knock noise)
   Thump characteristics include softer knock/dead sound often brought on by activity.
- Buzz (Like a bumblebee)
   Buzz characteristics include high frequency rattle/firm contact.
- Often the degree of acceptable noise level will vary depending upon the person. A noise that you may judge as acceptable may be very irritating to the customer.
- Weather conditions, especially humidity and temperature, may have a great effect on noise level.

#### DUPLICATE THE NOISE AND TEST DRIVE

If possible, drive the vehicle with the customer until the noise is duplicated. Note any additional information on the Diagnostic Worksheet regarding the conditions or location of the noise. This information can be used to duplicate the same conditions when you confirm the repair.

If the noise can be duplicated easily during the test drive, to help identify the source of the noise, try to duplicate the noise with the vehicle stopped by doing one or all of the following:

- 1. Close a door.
- 2. Tap or push/pull around the area where the noise appears to be coming from.
- 3. Rev the engine.
- 4. Use a floor jack to recreate vehicle "twist".
- 5. At idle, apply engine load (electrical load, half-clutch on M/T model, drive position on A/T model).
- 6. Raise the vehicle on a hoist and hit a tire with a rubber hammer.
- Drive the vehicle and attempt to duplicate the conditions the customer states exist when the noise occurs.

D

Ε

F

G

IP

J

Κ

L

Μ

• If it is difficult to duplicate the noise, drive the vehicle slowly on an undulating or rough road to stress the vehicle body.

#### CHECK RELATED SERVICE BULLETINS

After verifying the customer concern or symptom, check ASIST for Technical Service Bulletins (TSBs) related to that concern or symptom.

If a TSB relates to the symptom, follow the procedure to repair the noise.

#### LOCATE THE NOISE AND IDENTIFY THE ROOT CAUSE

- 1. Narrow down the noise to a general area. To help pinpoint the source of the noise, use a listening tool H (Chassis Ear: J-39570, Engine Ear: J-39565 and mechanics stethoscope).
- 2. Narrow down the noise to a more specific area and identify the cause of the noise by:
  - Removing the components in the area that you suspect the noise is coming from.
     Do not use too much force when removing clips and fasteners, otherwise clips and fasteners can be broken or lost during the repair, resulting in the creation of new noise.
  - Tapping or pushing/pulling the component that you suspect is causing the noise. Do not tap or push/pull the component with excessive force, otherwise the noise will be eliminated only temporarily.
  - Feeling for a vibration with your hand by touching the component(s) that you suspect is (are) causing the noise.
  - Placing a piece of paper between components that you suspect are causing the noise.
  - Looking for loose components and contact marks.

Refer to IP-6, "Generic Squeak and Rattle Troubleshooting" .

#### REPAIR THE CAUSE

- If the cause is a loose component, tighten the component securely.
- If the cause is insufficient clearance between components:
- Separate components by repositioning or loosening and retightening the component, if possible.
- Insulate components with a suitable insulator such as urethane pads, foam blocks, felt cloth tape or urethane tape. A NISSAN Squeak and Rattle Kit (J-43980) is available through your authorized NISSAN Parts Department.

#### **CAUTION:**

#### Do not use excessive force as many components are constructed of plastic and may be damaged. Always check with the Parts Department for the latest parts information.

The following materials are contained in the NISSAN Squeak and Rattle Kit (J-43980). Each item can be ordered separately as needed.

URETHANE PADS [1.5 mm (0.059 in) thick]

Insulates connectors, harness, etc.

76268-9E005: 100 x 135 mm (3.94 x 5.31 in)/76884-71L01: 60 x 85 mm (2.36 x 3.35 in)/76884-71L02: 15 x 25 mm (0.59 x 0.98 in)

INSULATOR (Foam blocks)

Insulates components from contact. Can be used to fill space behind a panel.

#### IP-5

73982-9E000: 45 mm (1.77 in) thick, 50 x 50 mm (1.97 x 1.97 in)/73982-50Y00: 10 mm (0.39 in) thick, 50 x 50 mm (1.97 x 1.97 in) **INSULATOR** (Light foam block) 80845-71L00: 30 mm (1.18 in) thick, 30 x 50 mm (1.18 x 1.97 in) FELT CLOTH TAPE Used to insulate where movement does not occur. Ideal for instrument panel applications. 68370-4B000: 15 x 25 mm (0.59 x 0.98 in) pad/68239-13E00: 5 mm (0.20 in) wide tape roll The following materials, not found in the kit, can also be used to repair squeaks and rattles. UHMW (TEFLON) TAPE Insulates where slight movement is present. Ideal for instrument panel applications. SILICONE GREASE Used in place of UHMW tape that will be visible or not fit. Note: Will only last a few months. SILICONE SPRAY Use when grease cannot be applied. DUCT TAPE Use to eliminate movement.

#### CONFIRM THE REPAIR

Confirm that the cause of a noise is repaired by test driving the vehicle. Operate the vehicle under the same conditions as when the noise originally occurred. Refer to the notes on the Diagnostic Worksheet.

# **Generic Squeak and Rattle Troubleshooting**

Refer to Table of Contents for specific component removal and installation information.

EIS00179

#### **INSTRUMENT PANEL**

Most incidents are caused by contact and movement between:

- 1. The cluster lid A and instrument panel
- 2. Acrylic lens and combination meter housing
- 3. Instrument panel to front pillar garnish
- 4. Instrument panel to windshield
- 5. Instrument panel mounting pins
- 6. Wiring harnesses behind the combination meter
- 7. A/C defroster duct and duct joint

These incidents can usually be located by tapping or moving the components to duplicate the noise or by pressing on the components while driving to stop the noise. Most of these incidents can be repaired by applying felt cloth tape or silicone spray (in hard to reach areas). Urethane pads can be used to insulate wiring harness.

#### **CAUTION:**

Do not use silicone spray to isolate a squeak or rattle. If you saturate the area with silicone, you will not be able to recheck the repair.

#### **CENTER CONSOLE**

Components to pay attention to include:

- 1. Shifter assembly cover to finisher
- 2. A/C control unit and upper/lower cluster lid C
- 3. Wiring harnesses behind audio and A/C control unit

The instrument panel repair and isolation procedures also apply to the center console.

#### DOORS

Pay attention to the:

- 1. Finisher and inner panel making a slapping noise
- 2. Inside handle escutcheon to door finisher
- 3. Wiring harnesses tapping
- 4. Door striker out of alignment causing a popping noise on starts and stops

Tapping or moving the components or pressing on them while driving to duplicate the conditions can isolate many of these incidents. You can usually insulate the areas with felt cloth tape or insulator foam blocks from the NISSAN Squeak and Rattle Kit (J-43980) to repair the noise.	А
TRUNK	
Trunk noises are often caused by a loose jack or loose items put into the trunk by the owner. In addition look for:	В
1. Trunk lid bumpers out of adjustment	
2. Trunk lid striker out of adjustment	С
3. The trunk lid torsion bars knocking together	
4. A loose license plate or bracket	D
Most of these incidents can be repaired by adjusting, securing or insulating the item(s) or component(s) causing the noise.	D
SUNROOF/HEADLINER	E
Noises in the sunroof/headliner area can often be traced to one of the following:	
1. Sunroof lid, rail, linkage or seals making a rattle or light knocking noise	
2. Sunvisor shaft shaking in the holder	F
3. Front or rear windshield touching headliner and squeaking	
Again, pressing on the components to stop the noise while duplicating the conditions can isolate most of these incidents. Repairs usually consist of insulating with felt cloth tape.	G
SEATS	
When isolating seat noises it is important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise.	Η
Cause of seat noise include:	IP
1. Headrest rods and holders	
2. A squeak between the seat pad cushion and frame	
3. The rear seat back lock and bracket	J
These noises can be isolated by moving or pressing on the suspected components while duplicating the con- ditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area.	
UNDERHOOD	K
Some interior noises may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noises include:	L
1. Any component mounted to the engine wall	
2. Components that pass through the engine wall	N
3. Engine wall mounts and connectors	
4. Loose radiator mounting pins	
5. Hood bumpers out of adjustment	
6 Hood striker out of adjustment	

6. Hood striker out of adjustment

These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or insulating the component causing the noise.

#### **Diagnostic Worksheet**


EIS0017A



#### SQUEAK & RATTLE DIAGNOSTIC WORKSHEET

Dear Nissan Customer:

We are concerned about your satisfaction with your Nissan vehicle. Repairing a squeak or rattle sometimes can be very difficult. To help us fix your Nissan right the first time, please take a moment to note the area of the vehicle where the squeak or rattle occurs and under what conditions. You may be asked to take a test drive with a service advisor or technician to ensure we confirm the noise you are hearing.

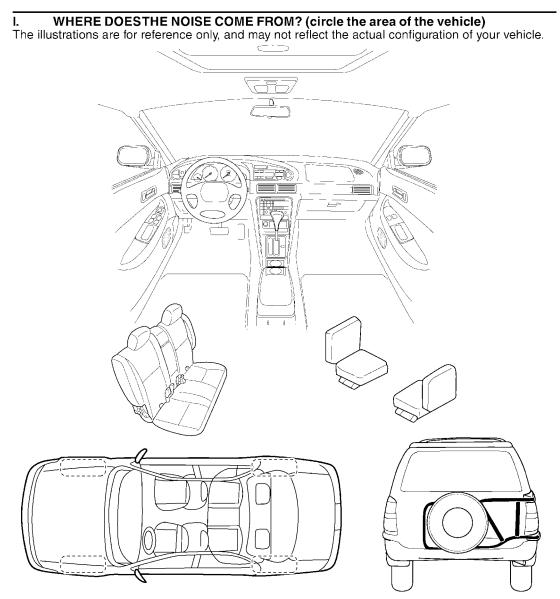

Continue to the back of the worksheet and briefly describe the location of the noise or rattle. In addition, please indicate the conditions which are present when the noise occurs.

Briefly describe the location whe	ere the noise o	ccurs:		
. WHEN DOES IT OCCUR?	(check the boy	ces that a	pply)	
anytime	□ after si	tting out ir	the su	n
$\Box$ 1 <sup>st</sup> time in the morning		t is raining		
only when it is cold outside	-	dusty cond		
only when it is hot outside	⊔ other:			
II. WHEN DRIVING:	IV.	WHAT T	PE O	F NOISE?
☐ through driveways	🗆 sc	jueak (like	tennis	shoes on a clean floor)
□ over rough roads			-	on an old wooden floor)
over speed bumps only at about mph		•	-	a baby rattle)
□ on acceleration		•		on a door) cond hand)
□ coming to a stop				led knock noise)
🗅 on turns : left, right or either (circl		ızz (like a	-	,
with passengers or cargo				
other:	······			
after driving miles or	minutes			
TO BE COMPLETED BY DEALE Test Drive Notes:	RSHIP PERSC	NNEL		
		YES	NO	Initials of person performing
		YES	NO	•
Vehicle test driven with customer - Noise verified on test drive				•
<ul> <li>Noise verified on test drive</li> <li>Noise source located and repaired</li> </ul>				•
<ul> <li>Noise verified on test drive</li> <li>Noise source located and repaired</li> </ul>				•
<ul> <li>Noise verified on test drive</li> <li>Noise source located and repaire</li> <li>Follow up test drive performed to</li> </ul>	confirm repair			•


#### i his form must be attached to work Or

# **INSTRUMENT PANEL ASSEMBLY**

#### **Removal and Installation**

#### **CAUTION:**

- Lock the CD changer unit mechanism (models with CD changer). Refer to <u>AV-11, "LOCKING CD</u> <u>CHANGER UNIT MECHANISM"</u>.
- Disconnect both terminals from battery and wait three minutes.
- Disconnect air bag module connectors in advance.
- Be careful not to scratch pad and other parts.
- Never tamper with or force air bag lid open, as this may adversely affect air bag performance.

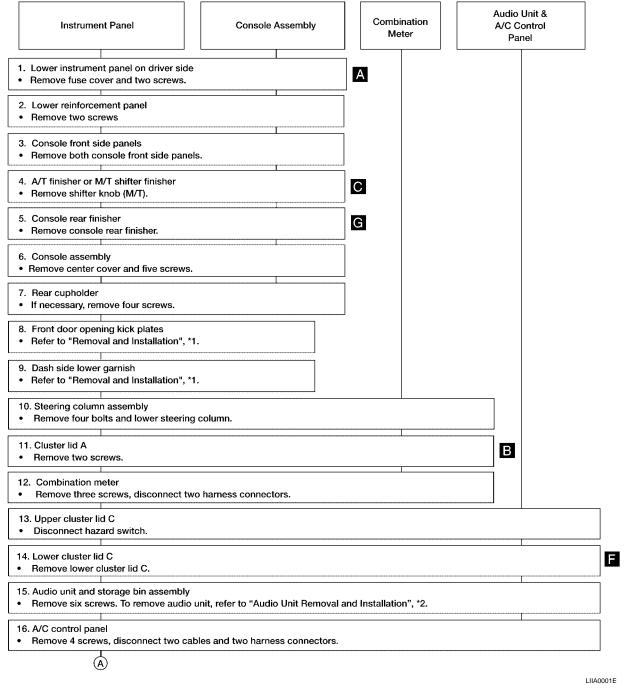

\*1 <u>EI-28</u>

\*2 <u>AV-11</u>

IP-10

PFP:68200

# **INSTRUMENT PANEL ASSEMBLY**

A	
<ul> <li>17. Glove box assembly</li> <li>Remove to screws, two dampers, and six screws.</li> </ul>	D
<ul> <li>18. Front passenger air bag</li> <li>Remove front passenger air bag module, refer to *1, "REMOVAL".</li> </ul>	
<ul> <li>19. Front pillar garnish</li> <li>Refer to "Removal and Installation", *2.</li> </ul>	
<ul> <li>20. Instrument panel assembly</li> <li>Remove two bolts, three screws, and two nuts.</li> </ul>	E
<ul> <li>21. Instrument stay assemblies, if necessary</li> <li>Remove two bolts and two nuts.</li> </ul>	
22. Steering member assembly, if necessary     Remove four nuts and two bolts.	

\*1 <u>SRS-44</u>

\*2 <u>EI-28</u>

IP

Н

G


LIIA0002E

J


K

L

M

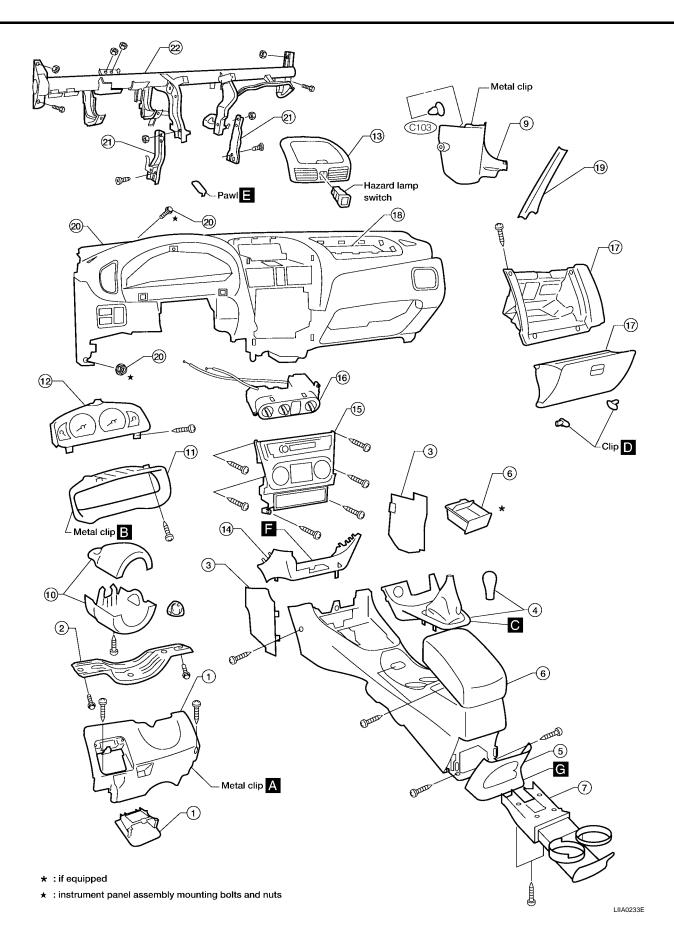

## **INSTRUMENT PANEL ASSEMBLY**

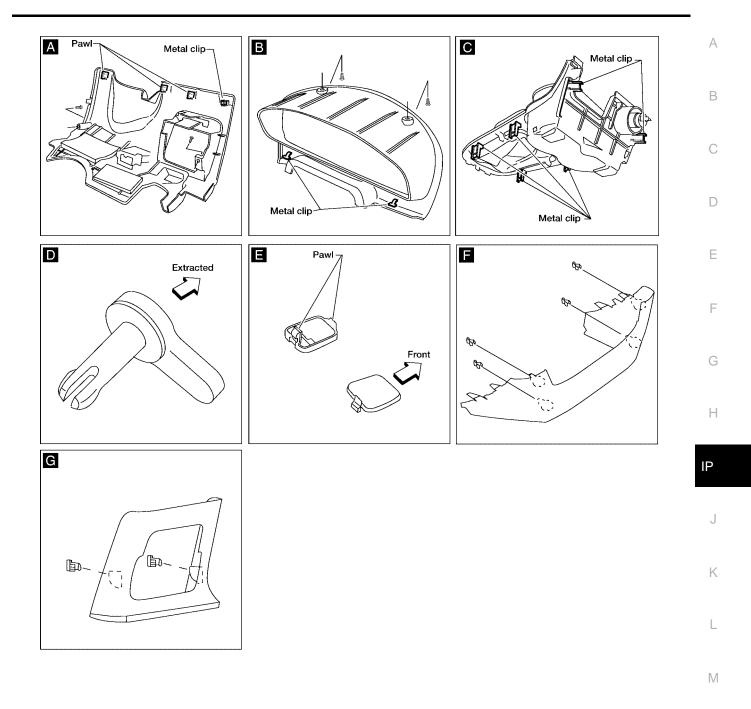

LIIA0004E